

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State  Fee

5. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL  GAS WELL  OTHER-  **Injector**

2. Name of Operator  
**Chevron U.S.A. Inc.**

3. Address of Operator  
**P.O. Box 670, Hobbs, NM 88240**

4. Location of Well  
UNIT LETTER P . 660 FEET FROM THE South LINE AND 660 FEET FROM  
THE East LINE, SECTION 7 TOWNSHIP 21S RANGE 36E NMPM.

7. Unit Agreement Name  
**Eunice Monument South U**

8. Farm or Lease Name

9. Well No.  
**334**

10. Field and Pool, or Wildcat  
**Eunice Monument Graybur, San And**

15. Elevation (Show whether DF, RT, GR, etc.)  
**3615**

12. County  
**Lea**

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <u>re-enter P&amp;A'd wellbore</u> <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.  
**New TD: 3917**

Change out wellhead to 6" 900, NUBOP, Test BOP & WH. OK. Drilling top plug 0 - 32'. Wash & drill paperwood 210' to 649'. Clean out to CIBP at 3677'. Test casing to 600psi. OK. Drilling on CIBP 3677' to 3679'. Push remainder of CIBP to 3795'. Wash over, push junk 3795-3800'. Washed to 3808', shoe jammed. POOH, break down w/o shoe. Received cast iron and packer wire and packer rubber. Circulate hole. Mix and pump 60sx Class H cement plug. Displace w/ FW. Tag cement at 3716. Establish circulation. Drlg to 3732. Circulate hole drlg from 3732 - 3917'. Circulate clean. Flange WH. Leave shut in. Turn over to the unit. Work performed 9-6-87 through 9-12-87.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED M. E. Abrin TITLE Staff Drilling Engineer DATE September 17, 1987

ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT I SUPERVISOR

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE SEP 21 1987

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

1987

1987

OFFICE