

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
 Hobbs Office
 C-102 and C-103
 Effective 1-1-65

APR 29 11 30 AM '66

5a. Indicate Type of Lease	State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.		

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator TEXAS PACIFIC OIL COMPANY	8. Farm or Lease Name State "A" A/c-1
3. Address of Operator P.O. Box 1069 - Hobbs, New Mexico	9. Well No. 67
4. Location of Well UNIT LETTER H, 1980 FEET FROM THE North LINE AND 660 FEET FROM THE East LINE, SECTION 11 TOWNSHIP 23 RANGE 36 NMPM.	10. Field and Pool, or Wildcat Langlie Mattix
15. Elevation (Show whether DF, RT, GR, etc.) 3418' DF	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rigged up. Dumped 1000 gal. NE acid. Pulled and ran tubing w/BP @ 3600'.
2. Spotted 500 gal. NE acid. Swab. Pulled tbg. to perforate.
3. Perforate in acid w/ 3/8" holes 3484-94-3524-30-44-51-72-78-85-92'. Ran tbg. & pkr. @ 3300'. Pumped 25 BO to displace 500 gal. acid.
4. Acidized w/1000 gal. NE acid & balls. Swab and flow.
5. Plug back w/plaster sd. to 3560' & load hole w/ oil.
6. SOT w/15,000 lse. oil & 15,000# 20/40 sd. 1/20 Adomite.
7. Wash sand 3510-3560'. Drill & wash 3552-3618' TD. Ran tbg., SN @ 3590'. Swab & flow.

4-14-66 491 ELOTR

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Area Superintendent DATE 4-28-66

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: