

Citgo AS State No. 1
Langlie Mattix Field
Lea County, New Mexico

Project Engineer: K. L. Midkiff

Office (915) 688-6828
Residence (915) 520-4526

Plug and Abandonment Procedure

1. Notify NMOCD prior to starting job. MIRU PU ND wellhead. NU BOP. Run freepoint to determine where tubing is stuck. Cut off tubing as deep as possible with chemical cutter.
2. Set cement plug immediately on top of tubing stub. Use sufficient cement to bring plug up to 1,350' so the top of salt will be covered. Exact volume will depend on where tubing is cut.
3. Pull up above plug and load hole with 9 ppg gelled brine. Pull up to 470' and set surface plug at surface to 470'. Use 35 sxs of cement.
4. Cut off casing 3' below ground level. Install P&A marker. Remove anchors. Clear, rip and reseed location.

Approved: T. J. Harrington
T. J. Harrington


Date: 22 July 82

RPA
LW

MERIDIAN OIL
CITGO AS STATE NO. 1
JALMAT FIELD
LEA COUNTY, NEW MEXICO

KJMA 4/21/82

CURRENT CONDITION

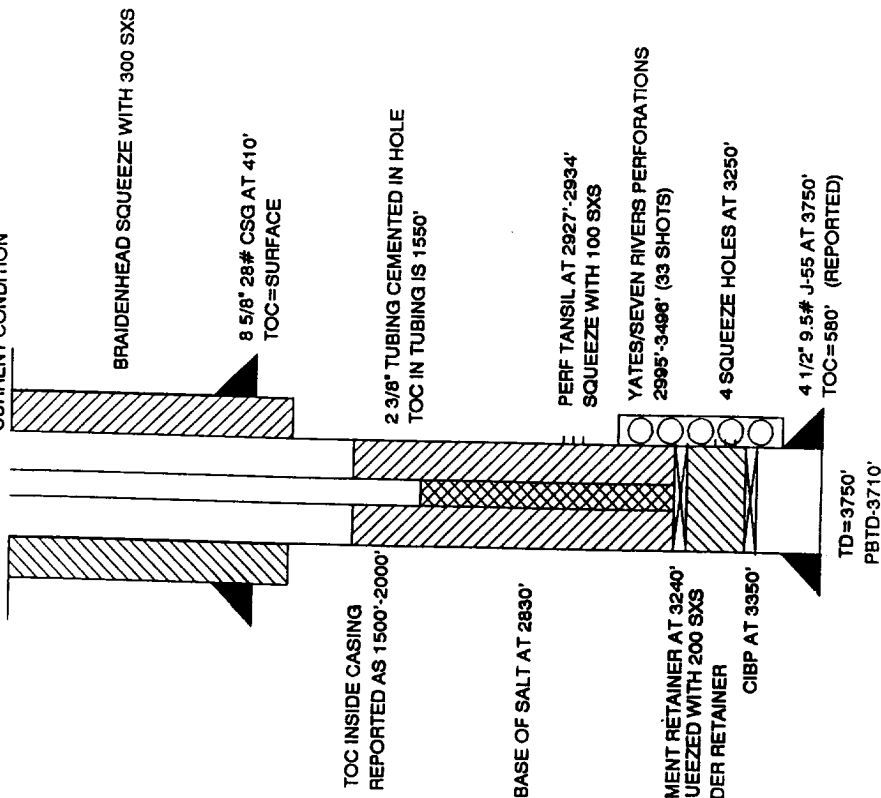

MERIDIAN OIL
CITGO AS STATE NO. 1
JALMAT FIELD
LEA COUNTY, NEW MEXICO

KJMA 4/21/82

CONDITION AFTER P&A

