

1. If packer set at 12,300 can be recovered, set CIBP at 12,600' and place 50' cement plug on top.
2. If packer at 12,300 cannot be recovered, cut off tubing at \pm 12,290' and set CIBP @ \pm 12,275' and place 50' cement plug on top.
3. Spot 9-10# drilling mud between all plugs.
4. Set 200' cement plug 10,900' to 10,700'.
5. Set 200' cement plug 9,310 to 9,110.
6. Attempt to recover 7" casing below 5,200'.
7. If 7" casing is recovered, set 150' cement plug 5,200 to 5,050 across 9 5/8 casing shoe.
8. Set 100' cement plug across 13 3/8 casing shoe from 630' to 530'. WOC and tag plug.
9. Set 50' surface plug on 9 5/8 casing.
10. Set dry hole marker.
11. Rehabilitate and re-seed location and return to original contour.