HOBBS OCD- RECEIVED 11/23/20 Submit 1 Copy To Appropriate District Office State of New Mexico Form C-103 Revised July 18,2013 District I - (575) 393-6161 Energy, Minerals and Natural Resources 1625 N. French Dr., Hobbs, NM 88240 WELL API NO. 30.025.40116 <u>District II</u> - (575) 748-1283 OIL CONSERVATION DIVISION 811 S. First St., Artesia, NM 88210 5. Indicate Type of Lease Disrtict III - (505) 334-6178 1220 South St. Francis Dr. **STATE 4** FEE 1000 Rio Brazos Rd. Aztec, NM 87410 6. State Oil & Gas Lease No. District IV - (505) 476-3460 Santa Fe, NM 87505 1220 S. St. Francis Dr., Santa Fe, NM 87505 SUNDRY NOTICES AND REPORTS ON WELLS 7. Lease Name or Unit Agreement Name (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR DEEPEN OR PLUG BACK TO A DIFFERENT **Mark Owen** RESERVIOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 8. Well Number 1. Type of Well: Oil Well 🔽 Gas Well Other 028 9. OGRID Numer 2. Name of Operator **Apache Corporation** 873 3. Address of Operator 10. Pool Name or Wildcat 303 Veterans Airpark Lane, Ste. 3000, Midland, TX 79705 Bline(6660)Tubb(60240)/Drinkard(19190) 4. Well Location Unit Letter \mathbf{M} 1310 feet from the line and feet from 1 W line Section 35 Township **21S** Range **37E NMPM** County **LEA** 11. Elevation (Show whether DR, RKB,RT, GR, etc.) 3381' GL 12. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data **NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:** ☐ ALTERING CASING PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON REMEDIAL WORK ☐ P AND A TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. ☐ MULTIPLE COMPL CASING/CEMENT JOB PULL OR ALTER CASING DOWNHOLE COMMINGLE **CLOSED-LOOP SYSTEM** OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram or proposed completion or recompletion. 4" diameter 4' tall above ground marker Apache Corporation proposes to P&A the above mentioned well by the attached procedure. A closed loop system will be used for all fluids from this wellbore and disposed of required by OCD Rule 19.15.17.14 NMAC. See Attached Spud Date: Rig Release Date: Conditions of Approval I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Guinn Burks

Guinn Burks

TITLE

SIGNATURE

Type or print name
For State Use Only
APPROVED BY

Conditions of Approval (if any):

DATE

11/19/20

432-556-9143

11/30/20

Sr. Reclamation Foreman DATE

E-mail add. guinn.burks@apachecorp.com PHONE:

Compliance Officer A




 LEASE NAME
 Mark Owen

 WELL #
 #028

 API #
 30.025.40116

 COUNTY
 LEA, NM

0	
719	
	12 1/4" Hole
1437	8 5/8" 24# @ 1213' w/ 700 sx CIRC to surf
2156	
2874	
3593	
	DVT @ 3898'
4311	
	Casing leak @ 4334'-4431' w/PIR of 5 bpm @ 500#
5030	
3030	
	CIBP @ 5400' w/ 35' cmt
5748	
	CIBP @ 6025' w/ 35' cmt
6467	CIBP @ 6350' w/ 35' cmt
	7 7/8" Hole
7185	5 1/2" 17# @ 7185' w/ 1235 sx to surf

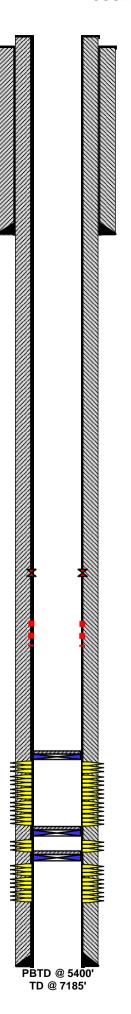

Perfs @ 5459'-5943'

Perfs @ 6067'-6163'

Perfs @ 6384'-6522'



EASE NAME	Mark Owen
WELL#	#028
API#	30.025.40116
COUNTY	LEA, NM

PBTD @ 5400' TD @ 7185'

PROPOSED PROCEDURE

6. PUH & spot 30 sx Class "C" cmt from 300' to surf.(Fill Up) (Water Board & Surf Plug)

5. PUH & spot 25 sx Class "C" cmt from 1263'-1098', WOC/TAG (Surf Shoe & Rustler)

4. PUH & spot 50 sx Class "C" cmt from 2806'-2313', (7 Rvrs, Yates, & Tansill)

3. PUH & spot 70 sx Class "C" cmt from 3948'-3262', WOC/TAG (DVT, San Andres, Grayburg, Penrose, & Queen)

2. PUH & sqz 75 Class "C" cmt from 4284'-4431', WOC/TAG (Repeat if Necessary-Casing Leak)

1. MIRU P&A rig. RIH w/ tbg & verify CIBP @ 5400', CIRC w/MLF, & spot 45 sx Class "C" cmt from 5400'-4993', (Tubb, Blinebry, & Paddock)

Perfs @ 5459'-5943'

Perfs @ 6067'-6163'

Perfs @ 6384'-6522'

12 1/4" Hole 8 5/8" 24# @ 1213' w/ 700 sx CIRC to surf

2156

1437

0

719

2874

3593

DVT @ 3898'

4311

Casing leak @ 4334'-4431' w/PIR of 5 bpm @ 500#

5030

CIBP @ 5400' w/ 35' cmt

5748

CIBP @ 6025' w/ 35' cmt

CIBP @ 6350' w/ 35' cmt

6467

7185

7 7/8" Hole 5 1/2" 17# @ 7185' w/ 1235 sx to surf

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- **19.** No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)