Submit 1 Copy To Appropriate District Office District 1 – (575) 393-6161 State of New Mexico Energy, Minerals and Natural Resource	Form C-103 ces Revised August 1, 2011
1625 N. French Dr., Hobbs, NM 88240 OBBS OCD	WELL API NO. 20-025-40852
811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISIO	5. Indicate Type of Lease
District III – (505) 334-6178 FEB 1 5 2013 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec, NM 87410 St. Francis Dr.	STATE STATE
District IV - (505) 476-3460 Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505 RECEIVED	
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	A Klein 16 State
1. Type of Well: Oil Well X Gas Well Other	8. Well Number 2H
2. Name of Operator	9. OGRID Number
Marshall & Winston, Inc.	14187 10. Pool name or Wildcat
3. Address of Operator	
P. O. Box 50880, Midland, TX 79710-0880 4. Well Location	Scharb; Bone Spring
Unit Letter A : 660 feet from the North line a	and 250 feet from the East line
Section 16 Township 19S Range 35E	
11. Elevation (Show whether DR, RKB, RT, C	
3787' GR	
12. Check Appropriate Box to Indicate Nature of N	lotice, Report or Other Data
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL	
TEMPORARILY ABANDON CHANGE PLANS COMMEN	CE DRILLING OPNS 🖾 P AND A 🗌
PULL OR ALTER CASING MULTIPLE COMPL D	
OTHER: Commence Drilling OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi	
OTHER: Commence Drilling Image: Commence Drilling 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion.	tails, and give pertinent dates, including estimated date
OTHER: Commence Drilling Image: Commence Drilling 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion. 12/04/12 Spud hole @ 7:30 AM. 12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW.	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps
OTHER: Commence Drilling Image: Commence Drilling 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion. 12/04/12 Spud hole @ 7:30 AM. 12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW. PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps
OTHER: Commence Drilling Image: Commence Drilling 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi proposed completion or recompletion. 12/04/12 Spud hole @ 7:30 AM. 12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW. PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci 12/10/12 Test BOP, csg & choke manifold to 500#.	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs.
OTHER: Commence Drilling Image: Commence Driling I	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20
OTHER: Commence Drilling Image: Commence Drilling <thi< td=""><td>tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20</td></thi<>	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20
OTHER:Commence DrillingImage: Commence DrillingImage: Commence DrillingImage: Commence DrillingImage: Commence Drilling13.Describe proposed or completed operations.(Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion.12/04/12Spud hole @ 7:30 AM.12/04/12Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci12/10/12Test BOP, csg & choke manifold to 500#.12/14/12Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high.12/15/12Pressure test csg to 1000#.	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20
 OTHER: Commence Drilling ∑ OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion. 12/04/12 Spud hole @ 7:30 AM. 12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW. PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci 12/10/12 Test BOP, csg & choke manifold to 500#. 12/14/12 Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high. 12/15/12 Pressure test csg to 1000#. 12/21/12 Open hole log w/ Schlumberger. 12/30/12 Drill to TD 13,940' – PBTD 13645'. 	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of , lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20
 OTHER: Commence Drilling ∑ OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion. 12/04/12 Spud hole @ 7:30 AM. 12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW. PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci 12/10/12 Test BOP, csg & choke manifold to 500#. 12/14/12 Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high. 12/15/12 Pressure test csg to 1000#. 12/21/12 Open hole log w/ Schlumberger. 12/30/12 Drill to TD 13,940' – PBTD 13645'. 01/01/13 Ran 335 jts 5 ½" P-110 17# csg. Set @ 13771'. 	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of 7, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test
 OTHER: Commence Drilling ∑ OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion. 12/04/12 Spud hole @ 7:30 AM. 12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW. PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci 12/10/12 Test BOP, csg & choke manifold to 500#. 12/14/12 Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high. 12/15/12 Pressure test csg to 1000#. 12/21/12 Open hole log w/ Schlumberger. 12/30/12 Drill to TD 13,940' – PBTD 13645'. 01/01/13 Ran 335 jts 5 ½" P-110 17# csg. Set @ 13771'. 01/02/13 Cmtd w/ 20 bbl chemical wash spacer, lead w/ 1515 sx Poz H + 5% PF44 + 10% ft 	 tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of <i>v</i>, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ¼#
 OTHER: Commence Drilling ∑ OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion. 12/04/12 Spud hole @ 7:30 AM. 12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW. PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci 12/10/12 Test BOP, csg & choke manifold to 500#. 12/14/12 Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high. 12/15/12 Pressure test csg to 1000#. 12/21/12 Open hole log w/ Schlumberger. 12/30/12 Drill to TD 13,940' – PBTD 13645'. 01/01/13 Ran 335 jts 5 ½" P-110 17# csg. Set @ 13771'. 	 tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of <i>v</i>, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ¼#
OTHER:Commence DrillingImage: Commence Drilling13.Describe proposed or completed operations.(Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion.12/04/12Spud hole @ 7:30 AM.12/08/12Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci12/10/12Test BOP, csg & choke manifold to 500#.12/14/12Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high.12/15/12Pressure test csg to 1000#.12/21/12Open hole log w/ Schlumberger.12/30/12Drill to TD 13,940' - PBTD 13645'.01/01/13Ran 335 jts 5 %" P-110 17# csg. Set @ 13771'.01/02/13Cmtd w/ 20 bbl chemical wash spacer, lead w/ 1515 sx Poz H + 5% PF44 + 10% for PF46. Tail w/ 1416 sx Poz H + 2% PF20 + .7% PF606 + .2% PF65 + %# PF46 + .2% F	 Italis, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of Italis, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of Italis, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of Italis, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of Italis, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of Italis, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of Italis, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and give pertinent dates, and wellbore diagram of Italis, and wellbore diagram of It
OTHER:Commence Drilling \blacksquare OTHER:13.Describe proposed or completed operations.(Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi proposed completion or recompletion.12/04/12 Spud hole @ 7:30 AM.12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci12/10/12 Test BOP, csg & choke manifold to 500#.12/14/12 Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high.12/15/12 Pressure test csg to 1000#.12/21/12 Open hole log w/ Schlumberger.12/30/12 Drill to TD 13,940' - PBTD 13645'.01/02/13 Cmtd w/ 20 bbl chemical wash spacer, lead w/ 1515 sx Poz H + 5% PF44 + 10% I PF46. Tail w/ 1416 sx Poz H + 2% PF20 + .7% PF606 + .2% PF65 + ¼# PF46 + .2% F01/03/13 Release rig @ 2:00 PM.Spud Date:12/04/12	PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ¼# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs.
OTHER: Commence Drilling ☑ OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of 7, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ¼# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs. 01/03/13
OTHER:Commence Drilling \blacksquare OTHER:13.Describe proposed or completed operations.(Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi proposed completion or recompletion.12/04/12 Spud hole @ 7:30 AM.12/08/12 Drill to 1700'. Ran 47 jts 13 3/8" J55 54.5# csg. Set @ 1800'. Cmtd w/ 20 BFW PF29 + 0.25 pps PF46. Tail w/ 200 sx Class C + 1% PF1. Displace w/ 272 BFW. Ci12/10/12 Test BOP, csg & choke manifold to 500#.12/14/12 Drill to 3822'. Ran 100 jts 9 5/8" 40# N80 csg. Set @ 3822'. Cmt w/ 20 BFW, lea + 3# PF42 + .125# PF29 + 1% PF1. Tail w/ 200 sx Class C + .2% PF13. Displace w/ choke manifold to 250# low & 1000# high.12/15/12 Pressure test csg to 1000#.12/21/12 Open hole log w/ Schlumberger.12/30/12 Drill to TD 13,940' - PBTD 13645'.01/02/13 Cmtd w/ 20 bbl chemical wash spacer, lead w/ 1515 sx Poz H + 5% PF44 + 10% I PF46. Tail w/ 1416 sx Poz H + 2% PF20 + .7% PF606 + .2% PF65 + ¼# PF46 + .2% F01/03/13 Release rig @ 2:00 PM.Spud Date:12/04/12	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of 7, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ½# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs. 01/03/13
OTHER: Commence Drilling ☑ OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiproposed completion or recompletion	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of 7, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ¼# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs. 01/03/13
OTHER: Commence Drilling Image: Commence Drilling Image: Commence Drilling 13. Describe proposed or completed operations: (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi proposed completion or recompletion	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of V_{1} lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + %# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs. 01/03/13 owledge and belief.
OTHER: Commence Drilling Image: Commence Drilling 13. Describe proposed or completed operations: (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi proposed completion or recompletion	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of 7, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + %# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs. 01/03/13 owledge and belief. DATE 02/13/13 PATE 02/13/13
OTHER: Commence Drilling Image: Commence Drilling Image: Commence Drilling 13. Describe proposed or completed operations: (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi proposed completion or recompletion	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of 7, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ½# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs. 01/03/13 owledge and belief. DATE 02/13/13 ra@marwitn.com PHONE: 432-684-6373 ngineer
OTHER: Commence Drilling ☑ OTHER: 13. Describe proposed or completed operations: (Clearly state all pertinent det of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multi proposed completion or recompletion	tails, and give pertinent dates, including estimated date iple Completions: Attach wellbore diagram of 1, lead w/ 1285 sx Class C + 4% PF20 + 2% PF1 + 0.125 pps irc 508 sx back to surface. WOC 18 hrs. ad w/ 1450 sx 35:65 Class C + 5% PF44 (BWOW) + 6% PF20 / 287 BFW. Circ 575 sx cmt to surface. WOC 18 hrs. Test PF20 + .2% PF13 + .2% PF153 + 3# PF42 + 1/8# PF29 + ¼# PF153 + .1% PF13. Circ 652 sx to surf. WOC 18 hrs. 01/03/13 owledge and belief. DATE 02/13/13 Fa@mar.win.com PHONE: 432-684-6373 ngineer