

Office

Revised August 1, 2011

District I - (575) 393-6161

1625 N. French Dr., Hobbs, NM 88240

District II - (575) 748-1283

811 S. First St., Artesia, NM 88210

District III - (505) 334-6178

1000 Rio Brazos Rd., Aztec, NM 87410

District IV - (505) 476-3460

1220 S. St. Francis Dr., Santa Fe, NM

87505

## OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

RECEIVED

WELL API NO.

30-025-07917

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil &amp; Gas Lease No.

7. Lease Name or Unit Agreement Name

8. Well Number 102

9. OGRID Number

009338

10. Pool name or Wildcat

CARTER; SAN ANDRES, SOUTH

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

GREAT WESTERN DRILLING COMPANY

3. Address of Operator

P.O. BOX 1659  
MIDLAND, TX 79702

4. Well Location

Unit Letter N : 330 feet from the SOUTH line and 2310 feet from the WEST line

Section 5 Township 18S Range NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

3632

12. Check

Indicate Nature of Notice, Report or Other Data

PERFORM

TE

Approved for Plugging of well bore only.

Liability under bond is retained pending receipt of

C-103 (Specifically for Subsequent Report of Well

Plugging) which may be found at OCD web page

under forms

www.emr.state.nm.us/oed

COMPL

OTHER:

## SUBSEQUENT REPORT OF:

REMEDIAL WORK

☐

ALTERING CASING

☐

COMMENCE DRILLING OPNS.

☐

P AND A

☒

CASING/CEMENT JOB

☐

OTHER:

☐

proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

05/22/13 RU plugging unit. Unset pkr, circ 10# brine water &amp; gel. POH LD inj tbg &amp; pkr. RU Warrior Energy. TIH w/5 1/2" CIBP &amp; set @ 5,100'. Dump 3 sx cmt on top of CIBP. RU &amp; perf 5 1/2" csg @ 2060' &amp; 540' RD WL truck. PU 2 3/8" tbg, move over from #101 &amp; TIH to 1,854; w/pkr &amp; set pkr. SDFD.

05/23/13 Get pump in rate 900 psi @ 1 bpm. Mix &amp; squeeze 30 sx plug @ 2060' WOC 3 1/2 hrs. Unset pkr. TIH tag plug @ 1948'. Pull &amp; LD 2 3/8" tbg to 330'. Get pump in rate 800 @ 1/2 bpm. Mix &amp; squeeze 30 sx plug. SDFD. Talk w/NMOCD before pumping plugs.

05/24/13 Unset pkr TIH &amp; tag plug @ 398' (142' plug 14 sx in 5 1/2", 16 sx outside 5 1/2"). Pull &amp; LD pkr. TIH w/3 jts. Pump 10 sx plug. Circ cmt to surface. RD plugging equipment &amp; release. Installed dry hole marker.

Spud Date:

07/27/1957

Rig Release Date:

05/24/2013

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Louie M. Cure

TITLE CONSULTANT

DATE 07/23/2013

Type or print name LOUIE M. CURE

E-mail address: engineer@gwdc.com

PHONE: (432)682-5241

For State Use Only

APPROVED BY:

E. Gonzalez

TITLE

Dist. Mgr

DATE

7-30-2013

Conditions of Approval (if any):

AUG 29 2013