Submit 1 Copy To Appropriate District Office	State of New Mexico	Form C-103
District I (575) 202 (161	Energy, Minerals and Natural Resources	October 13, 2009 WELL API NO.
1625 N. French Dr., Hobbs, NM 8824 OBS District II – (575) 748-1283	OCD CONGERNATION DIVIGION	30-025-07961
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	5. Indicate Type of Lease
District III – (505) 334-6178 SFP 1 7	2013 1220 South St. Francis Dr.	STATE FEE 🛛
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505 RECFIV	Santa Pe, INIVI 87303	6. State Oil & Gas Lease No.
SUNDRY NOTICE	TAND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		EAST HODDS SAN ANDRES INT
PROPOSALS.)		EAST HOBBS SAN ANDRES UNIT 8. Well Number: 910
	s Well Other	,
2. Name of Operator LINN OPERATING, INC.		9. OGRID Number 269324
3. Address of Operator		10. Pool name or Wildcat
600 TRAVIS, SUITE 5100, HOUSTON, TEXAS 77002		HOBBS; SAN ANDRES, EAST
4. Well Location		
	feet from the N line and 330	
Section 31	Township 18S Range 39	
と - 1 位 - 1 64 ハイ・ハー・・・・・・・・・・・・・・・・・・・・・・・・・・・・・・・・・・	 Elevation (Show whether DR, RKB, RT, GR, etc. 610' 	
12 Charle Ann	rangiata Day to Indicata Natura of Nation	Parant on Other Data
12. Check App	ropriate Box to Indicate Nature of Notice,	Report of Other Data
NOTICE OF INTE	SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK A ALTERING CASING ALTERING CASING		
NOTICE OF INTENTAL PERFORM REMEDIAL WORK OF only receipt of TEMPORARILY ABAN of well bore only receipt of TEMPORARILY ABAN OF WELL OF TEMPORATION OF TEMPORATIO		
PULL OR A Plugging retained	CASING/CEMEN	I JOB 🖊
Approved under both for Subund at C		
Liabinis (Specifich may be	OTHER:	
Plugging) was to nm usloca	coperations. (Clearly state all pertinent details, an	
Plugging) Plugging) under formsl under formsl under formsl wertion or recomm	SEE RULE 19.15.7.14 NMAC. For Multiple Co	mpletions: Attach wellbore diagram of
Plugging) which may O-103 (Spewhich may under formsl under formsl www.emnrd.state.nm.uslocd work).	neuon.	
PLEASE SEE COMPLETED P&A OPERATIONS ATTACHED		
Spud Date:	Rig Release Date:	
	Tag Noteuro Sute.	
I hereby certify that the information abo	ve is true and complete to the best of my knowledg	ge and belief.
SIGNATURE HALLAK	TITLE: Regulatory Compliance Sp	pacialist III DATE Santambar 16, 2012
SIGNATORE STORY	TILE. Regulatory Compliance Sp	DATE September 16, 2013
Type or print name <u>TERRY CALLAHA</u>	N E-mail address tcallahan@linnenergy.com	pHONE: <u>281-840-4272</u>
For State Use Only		
ARREQUED BY	1/ June Notens	p.m9 112 - 13
APPROVED BY: Conditions of Approval (if any):	TITLE DET-WAY	DATE 9-18-2013
Conditions of Approval the allyst		~~/
		7
/		
		SEP 28 2013 7

8/26/2013 - MOVE RIG TO LOCATION

8/27/2013 - MIRUPU, DUG OUT CELLAR, NDWH, NUBOP, RIH w/ TBG, TAGGED CMT ON TOP OF BP @ 4337, RU CMT UNIT, PUMPED 100 BBLS MUD LADEN FLUID, SPOTTED 25 SX CLASS C CMT FROM 4096' TO 4337', NOTIFIED MARK WHITAKER w/ OCD, POH w/ 2000' TBG, SION

8/28/2013 - RIH w/ TBG, TAGGED PLUG @ 4068', POH w/ TBG STOOD BACK 2635', LD REST OF TBG, SET 5 1/2" PKR @ 34', ATTEMPTED TO PRESSURE TEST INTEGRITY OF CSG, WOULD NOT HOLD, RUWL, RIH w/ WL, PERFORATE @ 2935', POH, RIH w/ PKR & TBG TO 2635', SET PKR & ESTABLISHED INJ RATE 1/2 BBL PER MIN @ 500#, SQUEEZED 45 SX CLASS C CMT, DISPLACED TO 2835', SHUT IN WELL w/ 900#, NOTIFIED MARK WHITAKER w/ OCD, WOC, RIH w/ WL TAGGED PLUG @ 2826', POH/LD TBG TO 1580', RUWL, RIH w/ WL & PERFORATED @ 1930', POH, SET PKR & ESTABLISHED INJ RATE 3/4 BBL PER MIN @ 400#, SQUEEZED 55 SX CLASS C CMT, DISPLACED CMT TO 1780', SION w/ 800#

8/29/2013 - RUWL, RIH w/ WL TAGGED PLUG @ 1760', POH, UNSET PKR, POH/LD TBG & PKR, RUWL & PERFORATING CHARGES, RIH w/ WL & PERFORATED @ 300', POH, SET PKR @ 34', ESTABLISHED INJ RATE, CIRCULATED, LD PKR, NUBOP, SET PKR @10', SQUEEZED 80 SX CLASS C CMT TO SURFACE, NOTIFIED MARK WHITAKER w/ OCD, WOC, LD PKR, CUT OFF WH, VERIFIED CMT @ SURFACE, RDPUMO

8/30/2013 – DUG OUT WH, CUT OF WH, MADE & INSTALLED ABOVE GROUND DRY HOLE MARKER, DUG UP & CUT OFF DEADMEN, FILL IN CELLAR, CLEAN LOCATION.