Submit 3 Copies To Appropriate District Office	State of New Mexico		Form C-103		
<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources		May 27, 2004		
District II 1301 W. Grand Ave., Artesia, NM 88210	OUL CONCERNATION DIVISION		30-025-2215		
District III	1220 South St. Francis Dr.		5. Indicate Type of Lease STATE X FEE		
1000 Rio Brazos Rd., Aztec, NM 87410 District IV	NM 87410 Santa Fe, NM 87505		6. State Oil & Gas Lease No.		
1220 S. St. Francis Dr., Santa Fe, NM 87505			VO-8335		
SUNDRY NOTICES AND REPORTS ON WELLS			7. Lease Name or Unit Agreement Name		
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS )			GROSS		
1.1(01.000/1100)			8. Well Number 2		
1. Type of Well: Oil WellG2. Name of Operator	as Well D Other SWD		9 OGRID N	umber 024010	
V-F PETROLEUM INC.		DEC 2 3 2013			
3. Address of Operator			10. Pool name or Wildcat		
P.O. BOX 1889, MIDLAND, TEXAS 79702 <b>RECEIVED</b>			VADA UPPER PENN		
Unit Letter       F       1,980       feet from the NORTH line and 2,130       feet from the WEST       line         Section 15       Township 10-S       Range 33-E       NMPM       LEA       County					
	11. Elevation (Show whethe				
		198' GL			
Pit or Below-grade Tank Application or Closure         Pit type Depth to Groundwater Distance from nearest fresh water well Distance from nearest surface water					
Pit typeDepth to Groundwate Pit Liner Thickness: mil	Below-Grade Tank: Volume		onstruction Materi		
	ck Appropriate Box to Indicat				
			-		
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING					
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PAND A					
PULL OR ALTER CASING  MULTIPLE COMPL CASING/CEMENT JOB					
OTHER:		OTHER: BETU			
<ol> <li>Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.</li> </ol>					
<b>-</b>					
(SEE BACK)					
				ħ	
I hereby certify that the information abor grade tank has been/will be constructe					
OCD-approved plan $\Box_{\gamma\gamma}$	a of closed according to room	OCD guidennes, a g	general per init [	_] of an (attached) after native	
SIGNATURE Sondy La	rulia TITLI	E Vice President	1	DATE <u>12/17/13</u>	
Type or print name Sandre K. Lawl		il address: <u>skl@vfpetro</u>		Telephone No. (432) 683-3344	
	\				
(This space for State use)					
APPPROVED BY Manh white TITLE ( ougliance Officer DATE 12/26/2013					
Conditions of approval, if any:					

## DEC 30 2013

08/16/13 - 08/20/13	Building location.
08/21/13 - 08/30/13	WO WSU.
08/31/13	MIRU Basic WSU. Start drlg at 3' 11:40 p.m. 8/31/13. Drilling through midnight 08/31/13.
09/04/13	RD power swivel & RD rel WSU.
09/19/13	MIRU Basic WSU. Dril cmt 6' – 10'. RD rel WSU.
10/01/13	MIRU Basic WSU.
10/02/13 - 11/05/13	Drilling cement to 464'. RD rel WSU.
11/06/13 - 11/12/13	WOO.
11/13/13	MIRU Basic WSU. Move drill pipe & drill clrs from Aztec #1 to Gross #2. TIH w/11" mill tooth bit. Tag TD @ 463'. PU to 390'. Break circ. RU reverse unit. Lower bit to 424'. Tag top of metal in hole. Rotate in metal for 4 hrs. Make 1'. Circ hole clean. Pull bit inside 12 ¼" csg. SWI. SDFN.
11/14/13	TOH. Bit did not have def wear pattern. TIH w/10 5/8" lead impression block. TOH. Had partial circle of what appears to be pipe looking up. SWI. SDFN.
11/15/13	Start TIH w/11 5/8" concave mill. Fnd thread bad on top of mill. Mill to shop for repair. SWI. SDFN.
11/16/13	TIH w/10 5/8" concave mill. Tag metal @ 424'. Mill metal to 429'. Had two different types of metal cuttings in returns. Circ hole clean. TOH. Had excessive wear on outer edge of mill. Some wear near center. SWI. SDFW.
11/17/13 -	SDFW.
11/18/13	
11/19/13	TIH w/10 5/8" lead impression blk. Set dwn on top of junk. Start TOH. Block hung in bttm of 12 3/4" surf csg. Work & free lead blck. Fin TOH. Start TIH w/11" bit. Tag junk in inside 12 3/4" csg @ 398'. TOH. SD to build fishing tool
11/20/13	TIH w/finger basket. Tag junk inside surf csg @ 348'. Work to catch junk & basket. Unable to do so. Push junk dwn hole to 429'. Work to close basket on junk. TOH. Did not have junk SWI. SDFN.
11/21/13	TIH w/magnet. Work to load magnet. TOH. Had phase of magnet covered w/steel shot. Clean magnet. TIH w/same magnet. Rotate & circ. TOH. Had 4 pieces of metal ranging from 2-4' long. Clean magnet. TIH w/same magnet. Work to load magnet. TOH. Did not have metal on magnet. TIH w/10 5/8" concave mill. Tag on junk @ 430'. Mill to 432'. Getting metal in returns. Circ hole clean. SWI. SDFN.
11/22/13	Mill on junk to 475'. Circ hole clean. SWI. SDFN.
11/23/13	TOH. Pipe had parted in bttm of 2 <sup>nd</sup> drill clr above mill. SWI. SD due to bad weather.
11/24/13 -	SDFW.
11/25/13	
11/26/13	Attempt to start all equip. SD due to bad weather.
11/27/13	TIH w/wall hooked & overshot. Latch onto parted drill collar. TOH. Well had random marks indicating drilling on unknown junk. LD drill clrs & drill pipe out of derrick. SWI. SDFN. Rel all re-entry equip.
11/28/13	Load out drill pipes, pipe racks, all rental equip. RD rel WSU.
11/29/13	WOO
11/30/13	Well to be plugged and abandoned. No further work to be performed until P&A.
11/30/13 - 12/16/13	SD WO P&A.

. .