يجان ا	
Submit   Copy To Appropriate District State of New Mexico	Form C-103
Office District I – (575) 393-6161 Energy, Minerals and Natural Resources	
1625 N. French Dr., Hobbs, NM 88240	WELL API NO.
District II – (575) 748-1283 811 S. First St. Artesia NM 88210 OIL CONSERVATION DIVISION	30-025-03453
811 S. First St., Artesia, NM 88210OIL CONSERVATION DIVISIONDistrict III - (505) 334-61781220 South St. Francis Dr.	Calledon Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	STATE XX FEE
$\frac{\text{District IV}}{\text{Strict IV}} = (505) 476-3460$ Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	BO-0444
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	Superior State
1. Type of Well: Oil Well X Gas Well Other	8. Well Number 002
2. Name of Operator	9. OGRID Number
Harvard Petroleum Company, LLC	10155
3. Address of Operator	10. Pool name or Wildcat
PO Box 936, Roswell, NM 88202-0936	Eumont; Yates 7RVRS Queen
4. Well Location	
Unit Letter <u>N</u> : <u>660</u> feet from the FSL line and 2	2310 feet from the FWL line
Section 12 Township 21S Range 35E	NMPM Lea County
11. Elevation (Show whether DR, RKB, RT, GR, etc.	
GL 3602	
12. Check Appropriate Box to Indicate Nature of Notice.	Report or Other Data
	•
E-PERMITTING SUE	SEQUENT REPORT OF:
P&A NR P&A R REMEDIAL WOR	
	IT JOB
	IT JOB
TA RBDMS CHART	IT JOB
CHG Loc     TA     RBDMS CHART       OTHER:     OTHER:	
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, article and the state all pertinent details)       Image: OTHER:	nd give pertinent dates, including estimated date
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completed operations.	nd give pertinent dates, including estimated date
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, article and the state all pertinent details)       Image: OTHER:	nd give pertinent dates, including estimated date
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: Image	d give pertinent dates, including estimated date mpletions: Attach wellbore diagram of
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: Image	nd give pertinent dates, including estimated date simpletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up	Ind give pertinent dates, including estimated date sompletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up.
CHG LOC       TA       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Corproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14	Ind give pertinent dates, including estimated date ompletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. Ind the mill. Milled & released CIBP.
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         Had to change out wellhead to get mill through it. Picked up 4 collars at 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down	Ind give pertinent dates, including estimated date sompletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. Ind the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'.
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         10/27/14       Had to change out wellhead to get mill through it. Picked up 4 collars ar 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and	Ind give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. Ind the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at
<ul> <li>CHG LOCRBDMS CHARTOTHER:</li> <li>OTHER:</li> <li>Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.</li> <li>Moved in dug out cellar. Installed BOP. Moved in remaining J&amp;B Well laying down pipe from the well.</li> <li>Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14 Had to change out wellhead to get mill through it. Picked up 4 collars at 10/27/14 Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and 1650'. RIH with tubing to 1716' and spotted 40 sx cement. POOH and</li> </ul>	Ind give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. Ind the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION.
CHG LOC       CHG LOC         TA       RBDMS CHART       OTHER:         01HER:       Image: OTHER:       Image: OTHER:       Image: OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         10/27/14       Had to change out wellhead to get mill through it. Picked up 4 collars ar 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and	ad give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. ad the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held.
CHG LOC         TA       RBDMS CHART         OTHER:       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         Had to change out wellhead to get mill through it. Picked up 4 collars at 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and 1650'. RIH with tubing to 1716' and spotted 40 sx cement. POOH and 10/28/14         10/28/14       RIH and tagged cement at 1519'. POOH and perforated at 250'. Could	nd give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. nd the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 ¾"
CHG LOC         TA       RBDMS CHART         OTHER:       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         Had to change out wellhead to get mill through it. Picked up 4 collars at 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and 1650'. RIH with tubing to 1716' and spotted 40 sx cement. POOH and 10/28/14         10/28/14       RIH and tagged cement at 1519'. POOH and perforated at 250'. Could RIH with tubing to 318' and circulated cement to surface with 55 sacks.	nd give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. nd the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 ¾"
CHG LOC         TA       RBDMS CHART         OTHER:       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         Had to change out wellhead to get mill through it. Picked up 4 collars at 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and 1650'. RIH with tubing to 1716' and spotted 40 sx cement. POOH and 10/28/14         10/28/14       RIH and tagged cement at 1519'. POOH and perforated at 250'. Could RIH with tubing to 318' and circulated cement to surface with 55 sacks.	nd give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. nd the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 ¾"
CHG LOC TA	Ind give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. nd the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 ¾" marker. Cut off anchors.
CHG LOC TA	Ind give pertinent dates, including estimated date empletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. nd the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 ¾" marker. Cut off anchors.
CHG LOC       RBDMS CHART         OTHER:       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         Had to change out wellhead to get mill through it. Picked up 4 collars at 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and 1650'. RIH with tubing to 1716' and spotted 40 sx cement. POOH and 1650'. RIH with tubing to 318' and circulated cement to surface with 55 sacks. annulus to surface from 60'. Fill up 5 ½'' casing to the top and installed         I hereby certify that the information above is true and complete to the best of my knowledge	ad give pertinent dates, including estimated date ompletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. ad the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 <sup>3</sup> / <sub>4</sub> " marker. Cut off anchors.
CHG LOC       RBDMS CHART         OTHER:       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, ar of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Coproposed completion or recompletion.         10/22/14       Moved in dug out cellar. Installed BOP. Moved in remaining J&B Well laying down pipe from the well.         10/23/14       Picked up scraper and workstring. RIH to 3742'. POOH and picked up 10/24/14         Had to change out wellhead to get mill through it. Picked up 4 collars at 10/27/14         Pushed CIBP to bottom with the collars and mill. POOH and laid down Circulated mud and spotted 25 sx cement on CIBP. POOH to 3146' and 1650'. RIH with tubing to 1716' and spotted 40 sx cement. POOH and 1650'. RIH with tubing to 318' and circulated cement to surface with 55 sacks. annulus to surface from 60'. Fill up 5 ½'' casing to the top and installed         I hereby certify that the information above is true and complete to the best of my knowledge	ad give pertinent dates, including estimated date ompletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. ad the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 <sup>3</sup> / <sub>4</sub> " marker. Cut off anchors.
CHG LOC	Ind give pertinent dates, including estimated date ompletions: Attach wellbore diagram of Service (Bobby Sterns) equipment and started 7" CIBP. Ran 2 stands and CIBP hung up. Ind the mill. Milled & released CIBP. tools. Picked up 7" CIBP and set at 3720'. spotted 25 sx cement. POOH and perforated at closed BOP. Pressured up to 200# and SION. not circulate. Pressured up to 750# and held. Cut off wellhead and 1 inched 7"X 10 ¾" marker. Cut off anchors. ge and beliefDATE11/11/14
CHG LOC	Image: constraint of the second state of the second sta
CHG LOC	Image: constraint of the second state of the second sta
CHG LOC	Image: constraint of the second state of the second sta
CHG LOC	Image: constraint of the second state of the second sta

JAN 13	2015
--------	------

fur