Submit   Copy To Appropriate Dis Office	State of New Mexico		Form C-103 Revised July 18, 2013
<u>District 1</u> ~ (575) 393-6161 1625 N. French Dr., Hobbs, NM 8	= -	vardiai Resources	WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210			30-025-28258 5. Indicate Type of Lease
District III – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 8	1220 South St. I		STATE FEE X
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, N	Santa Fe, NM	1 87505	6. State Oil & Gas Lease No.
87505 SUNDRY	Y NOTICES AND REPORTS ON WE	LLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR DIFFERENT RESERVOIR. USE	PROPOSALS TO DRILL OR TO DEEPEN OF "APPLICATION FOR PERMIT" (FORM C-10	R PLUG BACK TO A	/ Jameson
PROPOSALS.)  1. Type of Well: Oil Well  Gas Well  Other			8. Well Number 2
2. Name of Operator	formerly Canyon E&P Company	APR 2 3 2015 V	9. OGRID Number
3. Address of Operator			10. Pool name or Wildcat
1625 N. French Drive 4. Well Location	Hobbs, NM 88240	RECEIVED	Jalmat
Unit Letter F: 1650 feet from the North line and 2310 feet from the West line			
Section 15	Township 24S	Range 36E	NMPM County Lea
	11. Elevation (Show whether		
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO: E-PERMITTING <swd injection=""></swd>			
PERFORM REMEDIAL WO		RE CONVE	
TEMPORARILY ABANDON CHANGE PLANS CORFILIRN TO TA			
PULL OR ALTER CASING DOWNHOLE COMMINGLE	☐ MULTIPLE COMPL ☐	CA CSNG_	CHG LOC
CLOSED-LOOP SYSTEM		INT TO	PA P&A NR P&A R
OTHER:  OThers.  13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date			
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of			
proposed completion or recompletion.			
MIRU plugging equipment. POOH with production equipment.			
2. Set CIBP at 3550'. Circulate hole with mud laden fluid. Pressure test casing to 500 psi.			
<ul><li>3. Spot 25 sx cement on CIBP.</li><li>4. POOH to 3000'. Spot 25 sx cement. (Base of salt)</li></ul>			
5. Perforate at 1473'. Squeeze with 30 sx cement. WOC and tag. (Shoe and top of salt plug)			
6. Perforate at 300'. Pump sufficient cement to circulate cement to surface inside/outside of 4 1/2" casing.			
7. Cut off wellhead 4' below ground level and install P&A marker. Verify cement to surface on all strings.			
Cut off anchors.			
Spud Date:	Rig Release	e Date:	
<del>\</del>			
I hereby certify that the information above is true and complete to the best of my knowledge and belief.			
$\backslash \Lambda$			
SIGNATURE / Wal	Whitahu FITLE C	ompliance Officer	DATE
Type or print name Mark V For State Use Only	Vhitaker E-mail add	ress:	PHONE:
APPROVED BY: Valuy Strawn TITLE Dist. Supervise DATE 4/23/2015			
Conditions of Approval (if any)			

## Canyon E&P Company Jameson No. 2 30-025-28258

8 5/8" @ 1423' w/ 690 sx. Circ cmt

4 1/2" @ 3620' w/ 300 sx. TOC at 2120'

Open hole 3620-3635'

TD 3635'