Office <u>District I</u> – (575) 393-6161	State of 1	New Me	xico	Form C	-103
District I – (575) 393-6161 Energy, Minerals and Natural Resources				August 1	, 2011
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283				WELL API NO.	
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION			30-025-38079 5. Indicate Type of Lease	
District III - (505) 334-6178	1220 South St. Francis Dr.			STATE STATE	
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> = (505) 476-3460	Santa Fe, NM 87505			6. State Oil & Gas Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM					
87505 SUNDRY NOT	ICES AND REPORTS ON	LWELLS		7. Lease Name or Unit Agreement N	me
(DO NOT USE THIS FORM FOR PROPO	SALS TO DRILL OR TO DEEP	EN OR PLU	JG BACK TO A	West Pearl 36 State	
DIFFERENT RESERVOIR. USE "APPLI	CATION FOR PERMIT" (FORM				
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well Other	HOE	BS OCD	8. Well Number 1	
2. Name of Operator				9. OGRID Number	,
COG Operating LLC		1111	2 9 2015	229137	: !
3. Address of Operator				10. Pool name or Wildcat	•
2208 W. Main Street, Artesia, N	M 88210	453,300	AND DESCRIPTION OF THE PROPERTY.	Lea; Delaware, Northeast	
4. Well Location		KE	CEIVED	j	
Unit Letter <u>F</u> :	feet from the	N	line and1	740 feet from the W	line
Section 36	Township 19S			MPM County Lea	
	11. Elevation (Show wh 3716 GR	ether DR,	RKB, RT, GR, etc.)	
	3/10 OK				
12. Check A	appropriate Box to Indi	icate Na	ture of Notice T	Report or Other Data	
		·		toport of other Data	
	E-PERMITTING <swd injection=""> SUB</swd>				
CONVERSION	RBDMS		REMEDIAL WOR		3 <u> </u>
	TA		1	ILLING OPNS. P AND A	\boxtimes
	CHG LOC		CASING/CEMEN	T JOB	
	PMP&AR				
	1 an I	/ □	OTHER:		П
	leted operations. (Clearly s	state all pe		give pertinent dates, including estimate	d date
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of					
proposed completion or recompletion.					
06/12/15 MIRU plugging equipment. ND wellhead. NU BOP. RIH w/ wireline and tagged CIBP @ 5880'. POH.					
					بشن
06/15/15 Perf'd 7" csg @	3600'. Set 7" packer @	3126'. Sq	z'd 65 sx cement a	and displaced to 3350'. WOC. 06/16/	
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. P	3600'. Set 7'' packer @ acker got stuck and tbg p	3126'. Sq arted. PC	z'd 65 sx cement a DH w/ tbg. 06/16/1	and displaced to 3350'. WOC. 06/16/ 5 Fished packer andtubing out of ho	
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. P 06/17/15 RIH w/ tbg and	3600'. Set 7" packer @ acker got stuck and tbg p tagged cement plug @ 33	3126'. So arted. PC 319'. Circ	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu	and displaced to 3350'. WOC. 06/16/ 15 Fished packer andtubing out of houd laden fluid. Set packer at 30' and	e
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. P 06/17/15 RIH w/ tbg and pressured up on csg to 5	9 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute	3126'. So arted. PC 319'. Circ es. Perf'd	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p	and displaced to 3350'. WOC. 06/16/ 5 Fished packer andtubing out of ho	e
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pagged plug @ 3319'. Pagged plug w/ tbg and pressured up on csg to 50 RIH w/ tbg to 2070 and sagged plug @ 1868'. P	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' S	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak ' @ 380' and sqz'd	and displaced to 3350'. WOC. 06/16/ 15 Fished packer andtubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 165 sx cement. Displaced to 555'. WO	e. rfs.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pagged plug @ 3319'. Pagged plug @ to 2070 and some pressured up on csg to 50 RIH w/ tbg to 2070 and some plug @ 1868'. Pagged plug @ 539'. Performance in the pagged plug @ 539'.	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' S rf'd csg @ 60'. Sqz'd 45 sr	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak ' @ 380' and sqz'd and circulated cer	and displaced to 3350'. WOC. 06/16/15 Fished packer andtubing out of hold laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified	e. rfs.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pour 15 Perf'd 7" csg @ Tagged plug @ 3319'. Pour 15 Perf'd 7" csg @ 506/17/15 RIH w/ tbg to 2070 and so Tagged plug @ 1868'. Pour 15 Perf eementat surface and right comments surface surface and right comments surface and right comments surface sur	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' S rf'd csg @ 60'. Sqz'd 45 sy gged down and moved off.	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg. @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde	and displaced to 3350'. WOC. 06/16/15 Fished packer andtubing out of hold laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Perf'd 7" csg @ 06/17/15 RIH w/ tbg and pressured up on csg to 50 RIH w/ tbg to 2070 and stagged plug @ 1868'. Performed programmed plug @ 539'. Performed plug	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' S rf'd csg @ 60'. Sqz'd 45 sy gged down and moved off.	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg. @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde	and displaced to 3350'. WOC. 06/16/15 Fished packer andtubing out of hold laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pour 15 Perf'd 7" csg @ Tagged plug @ 3319'. Pour 15 Perf'd 7" csg @ 506/17/15 RIH w/ tbg to 2070 and so Tagged plug @ 1868'. Pour 15 Perf eementat surface and right comments surface surface and right comments surface and right comments surface sur	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' S rf'd csg @ 60'. Sqz'd 45 sy gged down and moved off.	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg. @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde	and displaced to 3350'. WOC. 06/16/15 Fished packer andtubing out of hold laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 50 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe cementat surface and rig wellhead. Welded on "A moved off.	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 szged down and moved off. bove Ground Dry Hole M	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1 larker".	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer andtubing out of hold laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Perf'd 7" csg @ 06/17/15 RIH w/ tbg and pressured up on csg to 50 RIH w/ tbg to 2070 and stagged plug @ 1868'. Performed programmed plug @ 539'. Performed plug	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 szged down and moved off. bove Ground Dry Hole M	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer andtubing out of hold laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 50 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe cementat surface and rig wellhead. Welded on "A moved off.	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 szged down and moved off. bove Ground Dry Hole M	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1 larker".	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer andtubing out of hold laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 56 RIH w/ tbg to 2070 and se Tagged plug @ 1868'. Pe Tagged plug @ 539'. Per cementat surface and rig wellhead. Welded on "A moved off. Spud Date:	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 szged down and moved off. bove Ground Dry Hole M	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1 Iarker''. I	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/50 jts tbg. 06/18/15 l65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location as	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 50 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe cementat surface and rig wellhead. Welded on "A moved off.	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 szged down and moved off. bove Ground Dry Hole M	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1 Iarker''. I	z'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/50 jts tbg. 06/18/15 l65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location as	e. rfs. C.
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 56 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe cementat surface and rig wellhead. Welded on "A moved off. Spud Date:	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 srged down and moved off. bove Ground Dry Hole M Rig	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer c cement 06/26/1 larker". I	gz'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/50 jts tbg. 06/18/15 165 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location and belief.	e. rfs. C. f and
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 56 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe cementat surface and rig wellhead. Welded on "A moved off. Spud Date:	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 srged down and moved off. bove Ground Dry Hole M Rig	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement . 06/26/1 Iarker''. I	gz'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/50 jts tbg. 06/18/15 l65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location as	e. rfs. C. f and
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 5 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe Tagged plug @ 539'. Pe cementat surface and rig wellhead. Welded on "A moved off. Spud Date:	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 srged down and moved off. bove Ground Dry Hole M Rig	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement 06/26/1 larker". I	gz'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/50 jts tbg. 06/18/15 165 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location and belief. DATE 6-29-10	e. rfs. C. f and
O6/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe O6/17/15 RIH w/ tbg and pressured up on csg to 50 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe Tagged plug @ 539'. Pe cementat surface and rig wellhead. Welded on "A moved off. Spud Date: I hereby certify that the information SIGNATURE Type or print name Bear Month	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 srged down and moved off. bove Ground Dry Hole M Rig	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement 06/26/1 larker". I	gz'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/50 jts tbg. 06/18/15 165 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location and belief.	e. rfs. C. f and
O6/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe O6/17/15 RIH w/ tbg and pressured up on csg to 56 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe Tagged plug @ 539'. Pe cementat surface and rig wellhead. Welded on "A moved off. Spud Date: I hereby certify that the information SIGNATURE Type or print name Be Mount For State Use Only	acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 20 OH. Perf'd csg @ 655' S rf'd csg @ 60'. Sqz'd 45 s gged down and moved off. bove Ground Dry Hole M Rig above is true and complete TITLE	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement 06/26/1 larker". I	gz'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/ 50 jts tbg. 06/18/15 65 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location and belief. DATE 6-29-10	e. rfs. C. f and
06/15/15 Perf'd 7" csg @ Tagged plug @ 3319'. Pe 06/17/15 RIH w/ tbg and pressured up on csg to 5 RIH w/ tbg to 2070 and s Tagged plug @ 1868'. Pe Tagged plug @ 539'. Pe cementat surface and rig wellhead. Welded on "A moved off. Spud Date:	2 3600'. Set 7'' packer @ acker got stuck and tbg p tagged cement plug @ 33 00 psi. Held for 20 minute spotted 30 sx cement @ 26 OH. Perf'd csg @ 655' Srf'd csg @ 60'. Sqz'd 45 srged down and moved off. bove Ground Dry Hole M Rig	3126'. So arted. PC 319'. Circ es. Perf'd 070-1890 et packer x cement 06/26/1 larker". I	gz'd 65 sx cement a DH w/ tbg. 06/16/1 culated hole w/ mu csg @ 2020'. Set p per Mark Whitak @ 380' and sqz'd and circulated cer 5 Moved in welde Backfilled cellar. I	and displaced to 3350'. WOC. 06/16/15 Fished packer and tubing out of houd laden fluid. Set packer at 30' and packer @ 300' and pressured up on peer OCD. POH w/50 jts tbg. 06/18/15 165 sx cement. Displaced to 555'. WO ment to surface 06/19/15 Verified er and backhoe. Dug out cellar. Cut of Removed deadmen. Cleaned location and belief. DATE 6-29-10	e. rfs. C. f and

Form provided by Forms On-A-Disk (214) 340-9429 · FormsOnADisk.com