

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-28658
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name HIGGINS TRUST INC
8. Well Number 1
9. OGRID Number 240974
10. Pool name or Wildcat NORTHEAST LOVINGTON (PENN)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐ **HOBBS OCD**

2. Name of Operator
LEGACY RESERVES OPERATING LP / **SEP 16 2015**

3. Address of Operator
PO BOX 10848, MIDLAND, TX 79702

4. Well Location

Unit Letter L : 1980 feet from the SOUTH line and 510 feet from the WEST line
Section 21 Township 16S Range 37E NMPM County LEA

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3804' GL

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☒
OTHER: ☐

E-PERMITTING <SWD INJECTION>
CONVERSION RBDMS
RETURN TO TA
CSNG ENVIRO CHG LOC
INT TO P&A NR P&A R
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

---SEE ATTACHED P&A PROCEDURE ALONG WITH CURRENT AND PROPOSED WELLBORE DIAGRAMS---

The Oil Conservation Division
MUST BE NOTIFIED 24 Hours
Prior to the beginning of operations

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kent Williams TITLE SENIOR ENGINEER DATE 09/14/2015

Type or print name KENT WILLIAMS E-mail address: kwilliams@legacylp.com PHONE: 432-689-5200

For State Use Only

APPROVED BY: Mary Brown TITLE Dist. Supervisor DATE 9/14/2015

Conditions of Approval (if any):

SEP 21 2015

PLUG AND ABANDONMENT PROCEDURE-PROPOSED

Higgins Trust #1

Field/Pool: Northeast Lovington (Penn)
Lea Co., NM
API: 30-025-28658

Date: 9/8/15

Engineer: Kent Williams

Company: Legacy Reserves Operating, LP

Purpose Of Procedure: Plug and abandon. PXA Plug #1 (RBP) was set during unsuccessful attempt to repair casing in a October 2014 operation. Plugging job utilizes both Class C and Class H cement.

Procedure:

1. MIRU plugging company. NU 2000# minimum rated BOP.
2. Plug #1 (Perforation Plug) RU wireline. RIH w/ 5 1/2" CIBP and set at 11275'. RIH w/ wireline dump bailer and dump 5 sxs of Class H cement on CIBP from 11235'-11275' (40'). No tag required.
3. RIH w/ tubing to 11235' PBTD. Circulate hole w/ 261 bbls of 9.5 PPG mud laden fluid
3. Plug #2 (Casing Plug) Perforate 5 1/2" csg at 8500'. RIH w/ pkr and tbq. Squeeze 80 sxs Class H Cement from 8300'-8500' (200'). No tag required.
4. Plug #3 (Casing Plug) Spot 70 sxs Class C Cement from 5100'-5775' (675'). No tag required.
5. Plug #4 (Casing Shoe Plug) Perforate 5 1/2" csg at 4400'. RIH w/ pkr and tbq. Squeeze 60 sxs Class C Cement from 4225'-4400' (175'). WOC. Tag plug.
PERF ? SQZ 25 SXS CMT 3200'. WOC & TAG
6. Plug #5 (Casing Plug) Perforate 5 1/2" csg at ~~2350'~~ *2100'* RIH w/ pkr and tbq. Squeeze 45 sxs Class C Cement from ~~2200'-2350'~~ *1950'-2100'* (150'). No tag required.
7. Plug #6 (Casing Shoe Plug) Perforate 5 1/2" csg at 435'. RIH w/ pkr and tbq. Squeeze 30 sxs Class C Cement from 335'-435' (100'). WOC. Tag plug.
8. Plug #7 (Surface Plug). Perforate 5 1/2" csg at 60'. Pump and circulate 16 sxs Class C cement down 5 1/2" csg, and back to surface inside 5 1/2" x 8 5/8" surface casing annulus.
9. POH. Top off cmt to surface to fillup csg as necessary.
10. Cut off well head. Weld on dry hole marker. Backfill cellar. Clean location. RDMO.

Note:

- Use Class "H" Neat Cement , 1.08 ft3/sx cmt yield (Plugs #1,2)
- Use Class "C" Neat Cement , 1.32 ft3/sx cmt yield (Plugs #3,4,5,6,7)
- Use 9.5 PPG mud laden fluid (25 sxs @ 50 # gel/sx in 100 bbls brine).
- Notify NMOCD in Hobbs Office (575-393-6161) 24 hrs. prior to commencing operation.



Higgins Trust, Inc. #1

LOCATION: 1980' FSL & 510' FWL, Sec 21, T16S, R37E

Wellbore Diagram - Current

FIELD: NE Lovington Penn

COUNTY: Lea

STATE: New Mexico

GL: 3804'


KB: 3818'

SPUD DATE: 04/06/1984

LATEST UPDATE: 11/17/2014

BY: K Williams

API No: 30-025-28658

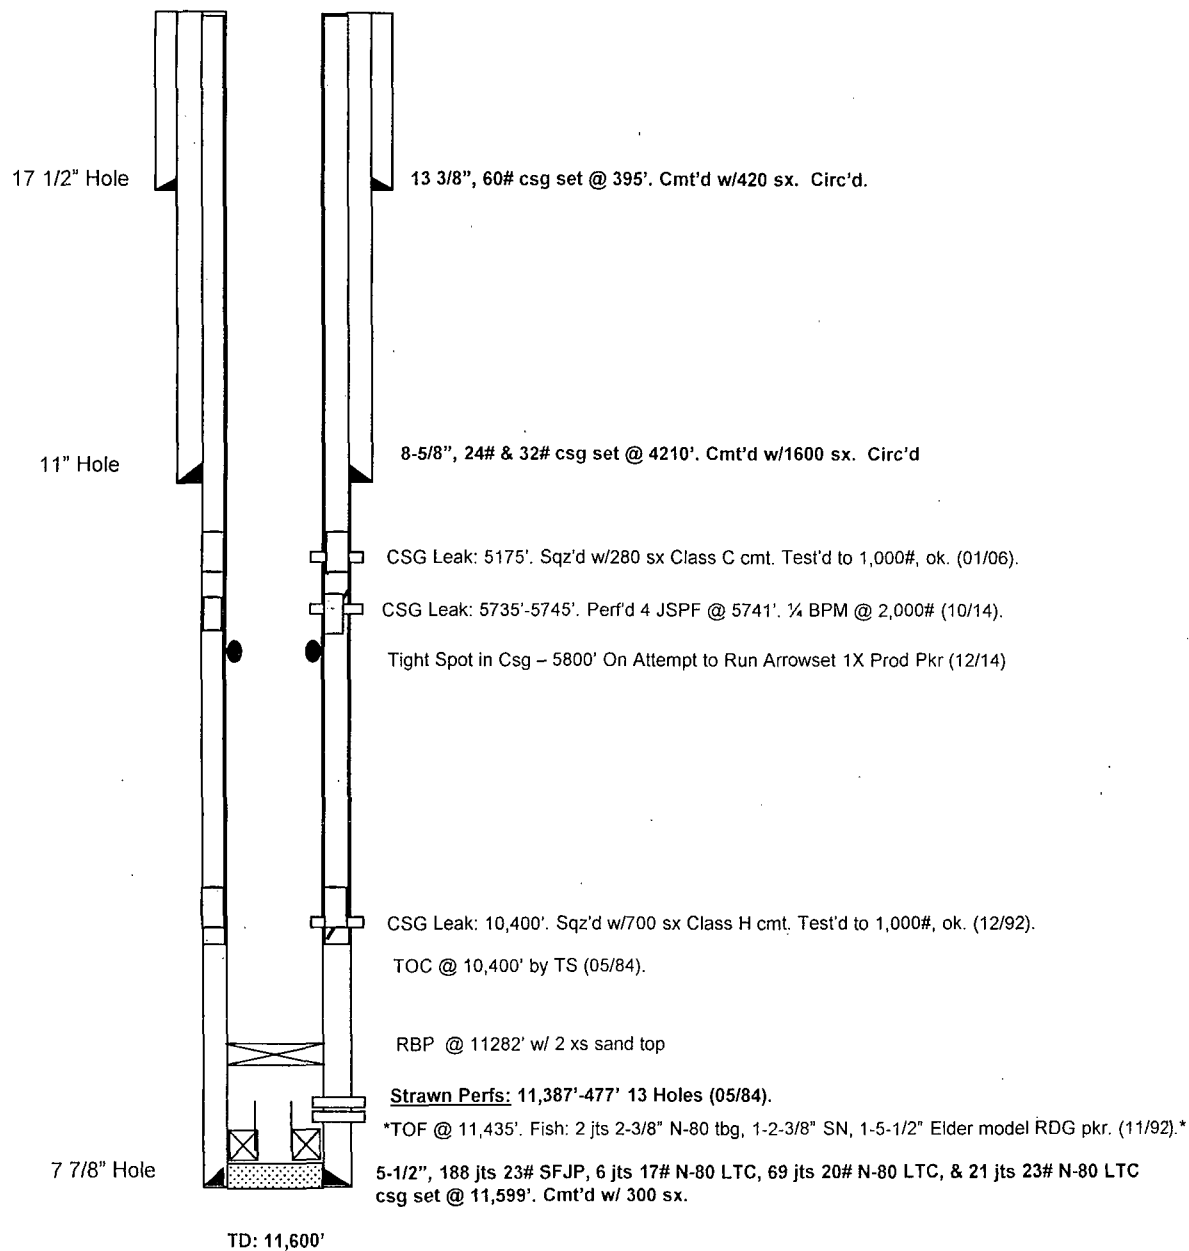

OPBTD: 11,553'



Higgins Trust, Inc. #1

LOCATION: 1980' FSL & 510' FWL, Sec 21, T16S, R37E

Wellbore Diagram - Proposed PXA

FIELD: NE Lovington Penn

COUNTY: Lea

STATE: New Mexico

GL: 3804'

KB: 3818'

SPUD DATE: 04/06/1984

LATEST UPDATE: 11/17/2014

BY: K Williams

API No: 30-025-28658

