

Submit 1 Copy To Appropriate District Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-005- 60469 ✓
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input checked="" type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/> ✓
2. Name of Operator State of New Mexico formerly Canyon E&P Company		6. State Oil & Gas Lease No.
3. Address of Operator 811 South 1st Street Artesia, NM 88210		7. Lease Name or Unit Agreement Name Twin Lakes San Andres Unit
4. Well Location Unit Letter J : 2310 feet from the S line and 2310 feet from the E line Section 1 Township 9S Range 28E NMPM County Chaves ✓		8. Well Number 75 ✓
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number
		10. Pool name or Wildcat Twin Lakes, San Andres (Assoc)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		E-PERMITTING <SWD INJECTION>	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	CONVERSION <input type="checkbox"/>	RBDMS <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	RETURN TO <input type="checkbox"/>	TA <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CSNG <input type="checkbox"/>	ENVIRO <input type="checkbox"/>
DOWNHOLE COMMINGLE <input type="checkbox"/>		INT TO P&A <input checked="" type="checkbox"/>	CHG LOC <input type="checkbox"/>
CLOSED-LOOP SYSTEM <input type="checkbox"/>		P&A NR <input type="checkbox"/>	P&A R <input type="checkbox"/>
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

HOBBS OCD

NOV 04 2015

RECEIVED

See Attached Procedure and Schematic

The Oil Conservation Division
MUST BE NOTIFIED 24 Hours
Prior to the beginning of operations

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE _____ DATE _____

Type or print name _____ E-mail address: _____ PHONE: _____

For State Use Only

APPROVED BY: Maley & Brown TITLE: Dist. Supervisor DATE: 11/4/2015

Conditions of Approval (if any):

NOV 04 2015

mw

Canyon E&P Company
Twin Lakes San Andres Unit No. 75
30-005-60469
UL – J, Sec. 1, T9S, R28E

8 5/8" csg at 40' w/ ready mix, circulated
4 1/2" 9.5 # csg at 2583' w/ 250 sx cmt, (7 7/8" hole) TOC unknown
TD – 2638' O.H. 2583' – 2638'
CIBP set at 2498' in 2001.


1. MIRU plugging equipment.
2. Confirm CIBP at 2498', circulate hole w/ mud laden fluid, and pressure test csg to 500 psi. (If no CIBP found, run at set one at 2500'.)
3. Spot 45 sx cement on CIBP.
4. Perf at 1000'. Sqz w/ 35 sx cmt. WOC and tag.
5. Perf at 100'. Pump sufficient cement to circulate to surface inside/outside 4 1/2" casing.
6. Cut off wellhead 4 feet below ground level.
7. Verify cement to surface on all strings.
8. Install upright P&A marker and cut off anchors.

NOTES: Mud laden fluid consists of 9.5 ppg with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to preceding with P&A.

TWIN LAKES SAN ANDRES UNIT #75

PROPOSED

CUT OFF WELLHEAD & INSTALL DRY HOLE MARKER

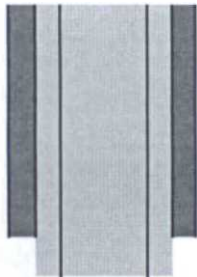

8 5/8" @ 40' w/ Ready Mix to Surface

PERF @ 100'. CIRCULATE CEMENT TO SURFACE



PERF AT 1000'. SQZ W/ 35 SX. WOC AND TAG.

TOC - UNKNOWN



CIRCULATE MUD LADEN FLUID

TAG CIBP AT 2498'. CAP WITH 45 SX

Record indicate CIBP at approximately 2500'.

4 1/2 " 9.5# @ 2583' w/ 200 sx.

OPEN HOLE 2583'-2638'