Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR

OCD-HOBBS -OCD-MUDDS

BU	LAPITES	. July 51, 2010	_					
SUNDRY Do not use thi	5. Lease Serial No. NMNM33955							
abandoned wel	If Indian, Allottee or Tribe Name							
SUBMIT IN TRI	7. If Unit or CA/Agreement, Name and/or No.							
I. Type of Well ☐ Gas Well ☑ Oth	8. Well Name and No. HALFWAY SWD 1							
Name of Operator R360 PERMIAN BASIN	Contact: (E-Mail: chrisr@was	CHRIS R R	UANE s.com o. (include 164 co 42-2200	DBBS OCD	9. API Well No. 30-025-42545	4		
3a. Address 3 WATERWAY SQUARE PLA THE WOODLANDS, TX 7738	10. Field and Pool, or Exploratory BLUE BIRD DRILL ISLAND							
4. Location of Well (Footage, Sec., T. Sec 22 T20S R32E SWSW 84			RECE	EIVED	11. County or Parish, LEA COUNTY,			
12. CHECK APPR	OPRIATE BOX(ES) TO	INDICATE	NATURE OF	F NOTICE, RI	EPORT, OR OTHE	R DATA		
TYPE OF SUBMISSION	TYPE OF ACTION							
□ Notice of Intent	Acidize	□ Dee		_	ion (Start/Resume)	☐ Water Shut-Off		
Subsequent Report ■	☐ Alter Casing	_	cture Treat	☐ Reclam		☐ Well Integrity		
	Casing Repair	☐ New Construction ☐ Recomplete		737	Other			
☐ Final Abandonment Notice	Change Plans		g and Abandon		arily Abandon			
La Venezia	Convert to Injection	□ Plu		□ Water D				
13. Describe Proposed or Completed Ope If the proposal is to deepen directiona Attach the Bond under which the wor following completion of the involved testing has been completed. Final Ab- determined that the site is ready for fin	Ily or recomplete horizontally, g k will be performed or provide to operations. If the operation rest andonment Notices shall be file	give subsurface he Bond No. o ults in a multip	locations and mea n file with BLM/E le completion or re	asured and true ve BIA. Required sub ecompletion in a r	rtical depths of all pertir psequent reports shall be new interval, a Form 316	nent markers and zones. filed within 30 days i0-4 shall be filed once		
1st Intermediate: 17/2 17 TD 1st intermediate at approve and circulate cement to surface Run 66 joints of 13 3/8?, 68ppf at 1800?	e to cover the Potash.							
7/21/2015 Pump: Cement 13 3/8" Casing Lead+ additives (12.7 ppg / 2.1 (12.7 ppg / 2.10 cf/sx) ,Tail w/ displace w/ 428 bbls (170 FW/ Drop bomb,Pressure up on DV	0 cf/sx) 562 sxs Class "C" additiv 258 Brine)	es (14.8 ppg	/ 1.35 cf/sx), (drop plug,	ss "C"			
14. I hereby certify that the foregoing is	Electronic Submission #3	20670 verifie	d by the BLM W	/ell Information	System			
No. Ohio III. In Inc.		ERMIAN BA	SIN, sent to the			our parties		
Name (Printed/Typed) JEREMY CANNADY			Title ENGI	NEERING				

14. Thereby certify	For R360 PERMIAN BA	d by the SIN, se	e BLM Well Infent to the Hobb	ormation s	System			
Name (Printed/1	Typed) JEREMY CANNADY	Title	ENGINEER	ING				
Signature (Electronic Submission)			10/20/2015	ACCEPTED FOR RECORD				
W/ANS/	THIS SPACE FOR FEDERA	AL OR	STATE OF	ICE U	SE	Long to the		
Approved By		Title		+ 1	OCT	2 0 2015	oste	
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office		BUREAU OF LAND MANAGEMENT				
Title 18 U.S.C. Section	on 1001 and Title 43 U.S.C. Section 1212, make it a crime for any pe	erson kno	wingly and will	fully to ma	ike to any depa	rtment or agency of	the United	

** OPERATOR-SUBMITTED ** OPERATOR-SUBMITTED ** COPERATOR-SUBMITTED **



Additional data for EC transaction #320670 that would not fit on the form

32. Additional remarks, continued

several attempts to open tool & circ, Call BLM, Talked to Marshall, wew will run a temperature log after 6 hrs to establish TOC, then Perf and pump Stage 2 cement

7/22/2015

Wait on cement till 9:00 so we could run temp survey.

Rig up Rotary wireline, run temp survey in 13 3/8" csg. Top of cement @ 1,750'. Marlin with BLM was on location. He contacted Chris and engineer in the Carlsbad office with BLM. The were good with plan of perferating casing @ 1,700' to establish circulation and cement 2nd stage as intended. No Sundry notice needed. So we shot 8 - 3/8" holes @ 1,700' to 1,703'. Pull wireline out of the hole shots went off. Hook Baker back up to cementing head, establish circulation. 6 bbls min @ 450 psi., After establishing circulationwe rigged down Rotary wireline truck. Circulate well bore with Baker Huges @ 7 bbls min @ 500 psi. Pump 2nd stage cmt job as follows: 2nd stage: 10 bbls FW spacer,

Huges @ 7 bbls min @ 500 psi. Pump 2nd stage cmt job as follows: 2nd stage: 10 bbls FW spacer, pumped @ 3 bbls min @ 108 psi, 2nd stage Lead: 1,100 sx of 60-40 P, blended with, 4% bentonite + 1% calcium chloride, mixed @ 13.5 ppg, 1.73 yld ft3, 9.14 gal fw/sx pumped @ 6 bbls min @ 550 psi for a 370 bbls slurry. 2nd stage Tail: 275 sx of class C, blended with nothing, mixed @ 14.8 ppg, 1.32 yld ft3, 6.32 gal fw/sx, pumped @ 5 bbls min at 310 psi for a 65 bbls slurry. Shut down and dropped plug, displace hole with 239 bbls fw, this puts the plug 100' above the perfs in the casing @ 1,700'. Shut in casing valve with 500 psi to hole plug in place. Circulated 179 bbls or 580 sx of cement to pit. Bump plug/spotted plug @ 15:30 NM time.

bbls or 580 sx of cement to pit. Bump plug/spotted plug @ 15:30 NM time.

Rig down Baker Huges.
Wait on cement for 24 hrs (BLM Regs) before we can cut off casing etc. Start cleaning pits, rusty bins etc get ready for the 12 1/4" hole.

Wait on cement and clean pits. We will be able to cut casing off @ 14:30 tomorrow eve NM time.