Form 3160-5 (September 2001)

NMOCD UNITED STATES DEPARTMENT OF THE INTERIOR Hobbs BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

FORM APPROVED OM B No. 1004-0135 Expires: January 31, 2004

220		-				
N	M	IN	M	83	1	9

Do not use this form for propos abandoned well. Use Form 3160			an, Allottee or I floe Name
SUBMIT IN TRIPLICATE- Other	instructions on reverse	7. If Unit	or CA/Agreement, Name and/or No.
1. Type of Well Oil Well Gas Well O	ubon / JUN	0 9 2016	
	THE T	8. Well N	lame and No. ERAL 23 #2
2. Name of Operator RIDGEWAY ARIZONA OIL CORI	REC	CEIVED 9. APIV	
3a Address 777 N ELDRIDGE PKWY #150 HOUSTON, TX 7707	3b. Phone No. (include area) 832-485-8522	code)	and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Descri,	iption)		VEROO, SAN ANDRES
SECTION 23, 07S-33E 660 FSL 1980 FWL			y or Parish, State SEVELT COUNTY, NM
12. CHECK APPROPRIATE BOX(E	S) TO INDICATE NATURE C	OF NOTICE, REPORT, C	OR OTHER DATA
TYPE OF SUBMISSION	ТҮРЕ О	F ACTION	
	Deepen Fracture Treat New Construction	Production (Start/Resume) Reclamation Recomplete	Water Shut-Off Well Integrity ✓ Other AMENDING
Final Abandonment Notice Change Plans	Plug and Abandon	Temporarily Abandon	PREVIOUS
Convert to Injectio	n Plug Back	Water Disposal	SUBMITTAL
RIDGEWAY ARIZONA OIL CORP REQUESTS ATTACHED REVISED PLUGGING PROCEDU THE COMPANY WILL NOTIFY BLM 24 HOU	RE.		
E-PERMITTING <swdinje chg="" conversion="" csng="" enviro="" int="" l="" nrp&a<="" p&a="" page="" rbdms_="" return="" ta="" th="" to=""><th>oc CONI</th><th>ATTACHED FO</th><th></th></swdinje>	oc CONI	ATTACHED FO	
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed)			
JAMIE L HOGUE	Title VP RE	GULATORY AFFAIRS	
Signature Comments Signature	Date	05/24/2016	
THIS SPACE F	OR FEDERAL OR STAT	E OFFICE USE	7 2016
Approved by Conditions of approval, if any, are attached. Approval of this certify that the applicant holds legal or equitable title to those r which would entitle the applicant to conduct operations thereo	notice does not warrant or rights in the subject lease n. Office	SUREAU OF CARLSB	Date C MW M
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, ma States any false, fictitious or fraudulent statements or represent	ake it a crime for any person knowing ations as to any matter within its juris	gly and willfully to make to a	ny department or agency of the United

(Instructions on page 2)

MUB/OCD 6/9/2016




Plugging Procedure Federal 23 #2 API No. 30-041-00196 N-23-07S-33E 660 FSL 1980 FWL

- 1. Prepare location and test anchors
- 2. MIRU plugging rig
- 3. Notify BLM 24 hours prior to commencement of P & A procedure.
- 4. NDWH/NU BOP
- 5. RIH w-4 ½ CIBP on 2 3/8 WS @ 4080' (+/-) within 50' of top perf (4130')
 - a. Spot 35' of cement on CIBP by wireline or 25 5x5 by theg.
 - b. WOC -4030' (+/-)
- 6. Load well with a minimum of 9 lb. mud and conduct MIT to 500 psi; test for leak off.
 - a. Bleed pressure off after MIT.
- 7. MIRU WL and RIH w/perf gun to 3389' 3489 per diagram (50 be low those)
 - a. perforate @ 2 JSPF
 - b. POOH w/WL
 - c. RDWL
- 8. TIH w/WS Squeeze 100' cement from 3489' to 3389' (+/-)
 - a. Casing shoe @ 3439'
 - b. Wait on cement
 - c. Tag plug @ 3389' or above.
- yatra 2243' L 9. TIH w/WS - Spot 125' cement from 2300' to 2175' (+/-)
 - a. Wait on cement
 - b. Tag plug @ 2175' or above
- 10. TIH w/WS Squeeze 100' cement from 555' to 455' (+/-)
 - a. Casing shoe @ 505'
 - b. Wait on cement
 - c. Tag plug @ 455' or above
- 11. TIH w/WS Circulate cement plug from 60' to surface
 - a. Wait on cement
 - b. Cut off well head 4' below ground level
 - c. Cut anchors
- 12. RDMO Plugging Rig
- 13. Install below grade P & A marker at least 3' below ground level

Lease	NMNM83197		
Well Name	Federal 23	Well No.	2
Field	Chaveroo		
County	Roosevelt		
State	NM		
Date	5/3/2016		
Date Comp			
KB	0.00		

Description	O.D.	Grade	Weight	Depth	Cmt Sx	TOC
Surface Csg	13 3/8	0	48	505	400	Surface
Inter Csg	11		24#	3439	800	Surface
Prod Csg	4 1/2	0	9 1/2	4384	300	0
Liner O.D.	0	0	0	0	0	0

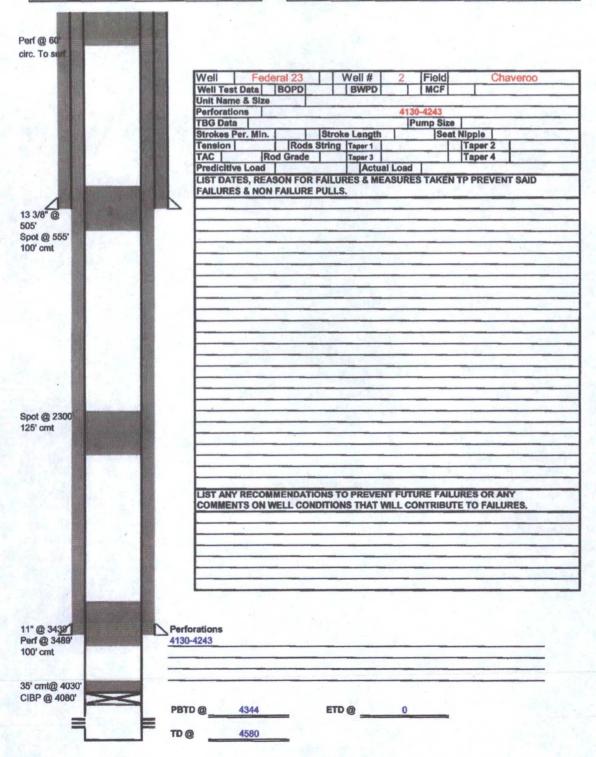

Federal 23 2 30-041-00196 Ridgeway Arizona Oil Corp

- Conditions of Approval

 1. Operator shall place CIBP at 4,080' (50'-100' above top most perf) and place 35' of Class C cement on top as proposed. WOC and TAG.

 2. Operator shall perf and squeeze at 3,489 (50' below casing shoe) tagging plug at a minimum of 3,389' to seal the intermediate casing shoe
- 3. Operator shall perf and squeeze at 2,300'as proposed. Operator shall place a balanced Class C cement plug from 2,300'-2,175' to seal the top of the Yates formation. WOC and TAG.
- 4. Operator shall perf and squeeze at 555'as proposed tagging plug at 455' to seal the surface shoe.
- 5. Operator shall place a balanced Class C cement plug from 60'- surface as proposed
- 6. See Attached for general plugging stipulations.

JAM 052716

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 West Second Street Roswell, New Mexico 88201 (575) 627-0272

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

- 1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon. If you are unable to plug the well by the 90th day provide the BLM Roswell Field Office (RFO), prior to the 90th day, with the reason for not meeting the deadline and a date when the BLM Roswell Field Office can expect the well to be plugged. Failure to do so will result in enforcement action. Unless the well has been properly plugged, the rig shall not be removed from over the hole without prior approval.
- 2. <u>Notification:</u> Contact the BLM Roswell Field Office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, during office hours or after office hours call (575) 627-0205. Engineer on call during office hours phone (575) 627-0237 or phone (after hours) call (575) 626-5749.
- 3. <u>Blowout Preventers:</u> A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9090 feet; a 3M system for a well not deeper than 13636 feet; and a 5M system for a well not deeper than 22727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at a rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement:</u> Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. In lieu of a cement plug in cased hole, a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 50 feet of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" for up to 7500 feet of depth, mixed at 14.8 lbs./gal with 6.3 gallons of fresh water per sack or class "H" for deeper than 7500 feet plugs, mixed at 16.4 lbs./gal with 4.3 gallons of fresh water per sack.

- 6. <u>Dry Hole Marker:</u> All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10 feet in length, 4 feet above the ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to the BLM Roswell Field Office. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

Following the submittal and approval of the Subsequent Report of Abandonment, a Notice of Intent for Final Abandonment with the proposed surface restoration procedure must be submitted for approval.