

Submit 1 Copy To Appropriate District
Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

WELL API NO.
30-005-60809

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Twin Lakes San Andres Unit

8. Well Number 76

9. OGRID Number

10. Pool name or Wildcat
Twin Lake; San Andres (Assoc)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH
PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ Other ☒ INJECTION

2. Name of Operator
State of New Mexico for Blue Sky NM, Inc

3. Address of Operator
1625 N. French Drive Hobbs, NM 88240

4. Well Location
Unit Letter I : 2310 feet from the South line and 990 feet from the East line
Section 1 Township 9S Range 28E NMPM County Chaves

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

SEE ATTACHED PROCEDURE AND SCHEMATIC

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mark Whitaker TITLE P.E.S. DATE 05/22/2017

Type or print name Mark Whitaker E-mail address: _____ PHONE: 575-393-6161

For State Use Only
APPROVED BY: Maury S. Brown TITLE AO/II DATE 5/23/2017
Conditions of Approval (if any): _____

Blue Sky NM, Inc.

Twin Lakes San Andres Unit No. 76 (Inj. Well)

30-005-60809

UL – I, Sec. 1, T9S, R28E

2310' FSL & 990' FEL

8 5/8" 20 # csg at 130' w/ 75 sx cmt (circ)

4 1/2" 9.5 # csg at 2730' w/ 200 sx cmt (TOC 1895')

TD – 2730' Perfs 2617' – 2656

1. MIRU plugging equipment. POOH w/ production equipment.
2. Run gauge ring. Set CIBP at 2517'. Circulate hole w/ mud laden fluid and pressure test casing to 500 psi.
3. Spot 45 sx cement on CIBP.
4. Perforate at 900'. Squeeze w/ 35 sx. WOC & Tag.
5. POOH to 180'. Pump sufficient cement to circulate to surface inside/outside 4 1/2" casing.
6. Cut off wellhead 4 feet below ground level.
7. Verify cement to surface on all strings.
8. Install upright P&A marker and cut off anchors.

NOTES: Mud laden fluid consists of 9.5 ppg with 25 sx salt gel per 100 bbls of fluid. If casing will not hold pressure, contact the OCD for instructions prior to preceding with P&A.

Blue Sky NM, Inc.
TWIN LAKES SAN ANDRES UNIT #76

PROPOSED
30-005-60809

CUT OFF WELLHEAD, VERIFY CEMENT TO SURFACE,
& INSTALL DRY HOLE MARKER

8 5/8" 20# @ 130' (circ cmt)

PERF @ 180'. CIRCULATE CEMENT TO SURFACE

PERFORATE AT 900'. SQZ W/ 35 SX. WOC & TAG.

TOC 1895'

PRESSURE TEST CASING
CIRCULATE MUD LADEN FLUID

SET CIBP AT 2517'. CAP WITH 45 SX

Perfs 2617'-2656'
4 1/2 " 9.5# @ 2730'