

Submit I Copy To Appropriate District State of New Mexico	Form C-103
District 1 – (575) 393-6161 Energy, Minerals and Natural Resour	ces Revised August 1, 2011
1625 N. French Dr., Hobbs, NM 88240	WELL API NO.
District II – (575) 748-1283 811 S. First St., Artesia, NM 88210 OIL CONSERVATION DIVISIO	N <u>30-025-07593</u>
District III - (505) 334-6178 1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 Santa Ed. NIM 97505	STATE FEE
$\frac{D(strict IV}{D} = (505) 476-3460$ Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	
SUNDRY NOTICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	
PROPOSALS.)	8. Well Number: 47
1. Type of Well: Oil Well Gas Well Other:	
2. Name of Operator	9. OGRID Number: 157984
1. Type of Well: Oil Well Gas Well Other: 2. Name of Operator Occidental Permian Ltd. 3. Address of Operator HCR 1 Box 90 Denver City, TX 79323 4. Well Location	
3. Address of Operator	10. Pool name or Wildcat Hobbs (G/SA)
HCR 1 Box 90 Denver City, TX 79323	
4. Well Location	
Unit LetterK_:1980feet from theSouth_ Time and	_1980feet from theWestline
Section 3 Township 19S Range	38E NMPM Lea County
11. Elevation (Show whether DR, RKB, RT,	
11. Elevation (Snow whether DR, RRB, RT, 3607' (GL)	OK, <i>etc.</i>)
3007 (OL)	
12. Check Appropriate Box to Indicate Nature of N	Notice, Report or Other Data
	SUBSEQUENT REPORT OF:
	AL WORK 🔲 ALTERING CASING 🗌
TEMPORARILY ABANDON 🔲 CHANGE PLANS 🗍 COMME	NCE DRILLING OPNS.
PULL OR ALTER CASING 🔲 MULTIPLE COMPL 🔲 CASING/	CEMENT JOB
OTHER: OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent de	
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Mul	tiple Completions: Attach wellbore diagram of
proposed completion or recompletion.	
	During this procedure we plan to use
I. MIRU PU.	the closed-loop system with a steel
2. Drill out cement and CIBP at 3880'. Tag TD at 4280'	the closed loop system to the required
3. Circulate plugging mud from 4280' to 4110'	tank and haul contents to the required
4. Spot 7" shoe plug from 4110'-4000'. WOC and Tag.	disposal per ODC Rule 19.19.17
5. Circulate plugging mud from 4000' to 2950'.	disposal per ODC Rule 19.15.17
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4'' shoe plug from 1750' to 1600'. WOC at 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. Cut off wellhead and install marker, 4" diameter and 4' tall. 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. Cut off wellhead and install marker, 4" diameter and 4' tall. Remove anchors and debris 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. Cut off wellhead and install marker, 4" diameter and 4' tall. 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. Cut off wellhead and install marker, 4" diameter and 4' tall. Remove anchors and debris 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. Cut off wellhead and install marker, 4" diameter and 4' tall. Remove anchors and debris 	
 Circulate plugging mud from 4000' to 2950'. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag Circulate plugging mud to 1800' Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a Circulate plugging mud to 250'. Perforate at 250' and circulate cement to surface. Circulate cement inside 8-5/8 from 250' to surface. Rig down pulling unit. Cut off wellhead and install marker, 4" diameter and 4' tall. Remove anchors and debris 	nd tag. See Attached Conditions of Approval
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4" diameter and 4' tall. 14. Remove anchors and debris Spud Date: 	nd tag. See Attached Conditions of Approval
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4" diameter and 4' tall. 14. Remove anchors and debris Spud Date: 	nd tag. See Attached Conditions of Approval
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4" diameter and 4' tall. 14. Remove anchors and debris Spud Date: 	nd tag. Conditions of Approval nowledge and belief.
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4" diameter and 4' tall. 14. Remove anchors and debris Spud Date: Rig Release Date: Rig Release Date: SIGNATURE 	nd tag. Conditions of Approval nowledge and belief. <u>neer</u> DATE <u>1/21/2019</u>
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4'' shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4'' diameter and 4' tall. 14. Remove anchors and debris Spud Date: 	nd tag. Conditions of Approval nowledge and belief. <u>neer</u> DATE1/21/2019
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4" diameter and 4' tall. 14. Remove anchors and debris Spud Date: Rig Release Date: Rig Release Date: SIGNATURE 	nd tag. Conditions of Approval nowledge and belief. <u>neer</u> DATE <u>1/21/2019</u>
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4'' shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4'' diameter and 4' tall. 14. Remove anchors and debris Spud Date:	nd tag. Conditions of Approval nowledge and belief. neerDATE1/21/2019 PHONE:13-215-7546_
 5. Circulate plugging mud from 4000' to 2950'. 6. Perforate at 2950' and squeeze Yates plug from 2950' to 2750'. WOC and tag 7. Circulate plugging mud to 1800' 8. Perforate at 1750 and squeeze 10-3/4" shoe plug from 1750' to 1600'. WOC a 9. Circulate plugging mud to 250'. 10. Perforate at 250' and circulate cement to surface. 11. Circulate cement inside 8-5/8 from 250' to surface. 12. Rig down pulling unit. 13. Cut off wellhead and install marker, 4" diameter and 4' tall. 14. Remove anchors and debris Spud Date:	nd tag. Conditions of Approval nowledge and belief. neerDATE1/21/2019 PHONE:13-215-7546_

Conditions of Approval (if any):

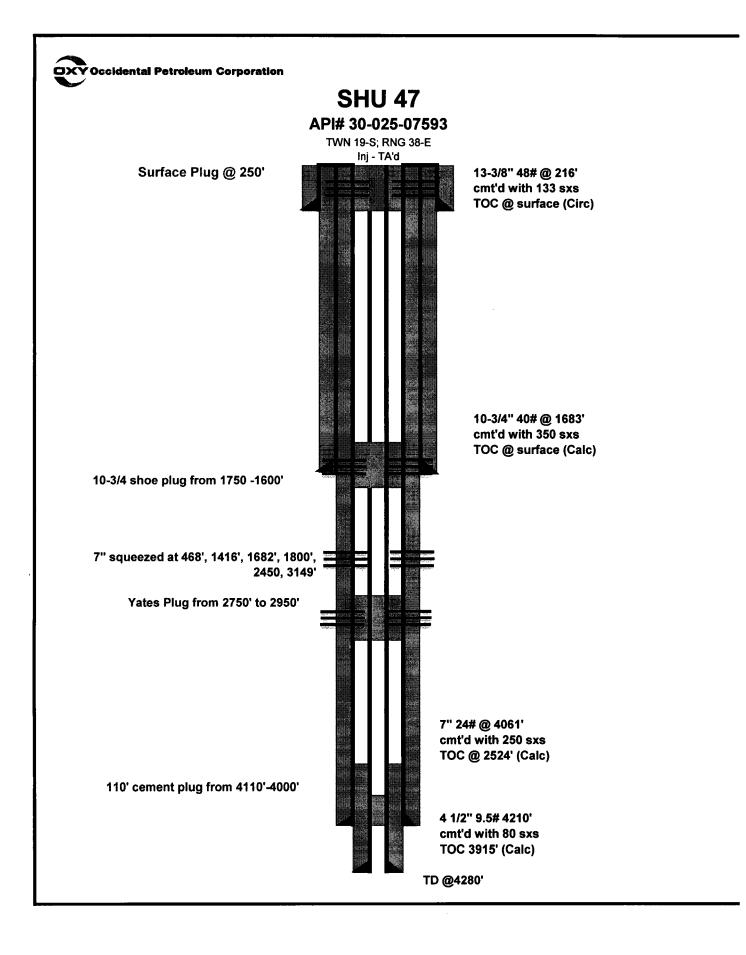

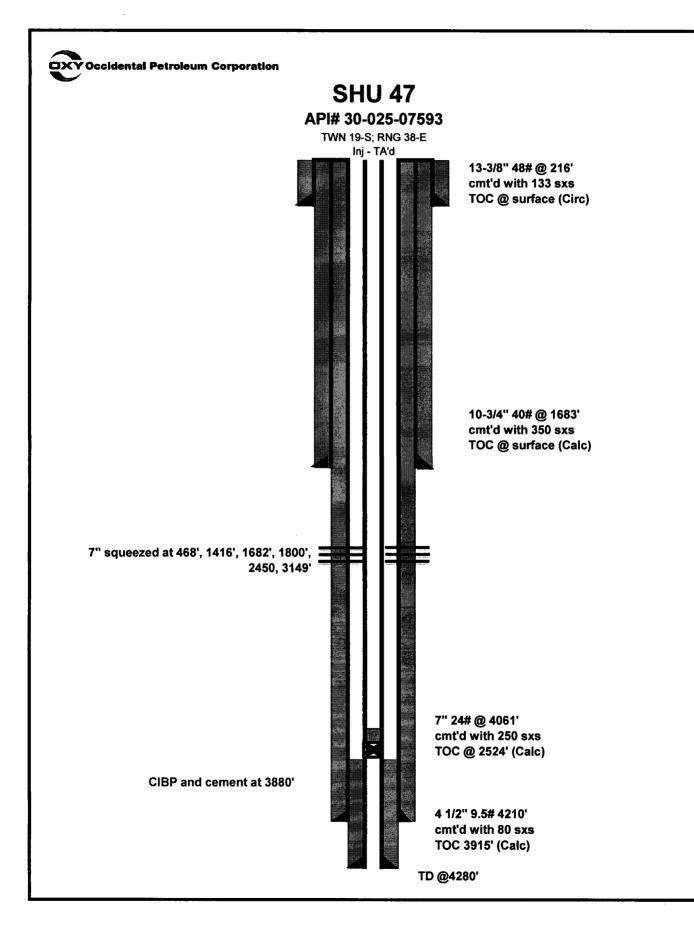

GENERAL CONDITIONS OF APPROVAL:

- 1) Insure all bradenheads have been exposed, identified, and valves are operational prior to rigging up on well.
- 2) Contact the appropriate NMOCD District Office no later than 24 hours prior to moving in and rigging up.
- 3) A copy of the approved C103 intent to P&A should be distributed to the onsite company and plugging representatives. <u>Approved procedures are good for a period of one year from approved date, unless otherwise specified on the C103 intent</u>. Approvals past this date will require the submission and approval of a new C103 intent.
- 4) A company representative is required to be present to witness all operations including setting CIBP's, circulation of mud laden fluids, perforating, squeezing or spotting cement plugs, tags, or any other operations approved on the C103 intent to P&A. Company representative should contact the NMOCD and report all operations.
- 5) Any changes that may be required during plugging operations should be approved by the NMOCD before proceeding.
- 6) A closed loop system is to be used for all plugging operations. Contents of the steel pits to be hauled to a NMOCD permitted disposal facility.
- 7) Mud laden fluids must be placed between all cement plugs mixed at 25 sacks of salt gel per 100 barrels of brine.
- All cement plugs will be 100' or 25 sacks cement, whichever is greater. Class 'C' cement will be used above 7500' and Class 'H' below 7500'. Plugs should be no more than 3000' apart
- 9) Site remediation due within one year of well plugging completion.