

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

OCD Artesia

FORM APPROVED  
OMB NO. 1004-0137  
Expires: January 31, 2018SUNDRY NOTICES AND REPORTS ON WELLS  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.*5. Lease Serial No.  
NMLC067230

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

SUBMIT IN TRIPLICATE - Other instructions on page 2

APR 10 2019

## 1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other8. Well Name and No.  
FEDERAL 3 2

## 2. Name of Operator

MARSHALL &amp; WINSTON INC

Contact: SHERRY L. ROBERTS

E-Mail: sroberts@mar-wln.com

## 9. API Well No.

30-025-25701-00-S1

## 3a. Address

MIDLAND, TX 79710-0880

## 3b. Phone No. (include area code)

Ph: 432-684-6373

Fx: 432-682-1316

10. Field and Pool or Exploratory Area  
LUSK

## 4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

Sec 3 T19S R32E NWSE 1980FSL 1730FEL

## 11. County or Parish, State

LEA COUNTY, NM

## 12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

## TYPE OF SUBMISSION

## TYPE OF ACTION

☒ Notice of Intent☐ Subsequent Report☐ Final Abandonment Notice☐ Acidize☐ Alter Casing☐ Casing Repair☐ Change Plans☐ Convert to Injection☐ Deepen☐ Hydraulic Fracturing☐ New Construction☒ Plug and Abandon☐ Plug Back☐ Production (Start/Resume)☐ Reclamation☐ Recomplete☐ Temporarily Abandon☐ Water Disposal☐ Water Shut-Off☐ Well Integrity☐ Other

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

Marshall & Winston, Inc. respectfully request permission to plug and abandon the Federal 3 #2. (see attached proposed plug & abandon procedure)

RECEIVED

APR 01 2019

SEE ATTACHED FOR  
CONDITIONS OF APPROVAL

DISTRICT II-ARTESIA O.C.D.

## 14. I hereby certify that the foregoing is true and correct.

Electronic Submission #454120 verified by the BLM Well Information System

For MARSHALL &amp; WINSTON INC, sent to the Hobbs

Committed to AFMSS for processing by DEBORAH MCKINNEY on 02/12/2019 (19DLM0250SE)

Name (Printed/Typed) TODD PASSMORE

Title OPERATIONS MANAGER

Signature (Electronic Submission)

Date 02/11/2019

## THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved By

Title

SPET

3-9-19  
Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

LFD

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

\*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\* BLM REVISED \*\*

X7 NM OCD 4-25-19

FOR RECORD ONLY

Federal 3 #2  
LEA COUNTY, NEW MEXICO  
API #30-025-25701

INTENT TO PLUG AND ABANDON  
SUNDRY DATED 02/11/19 ATTACHMENT

Proposed Plug and Abandon Procedure:

1. Notify NMOCD of plugging operations.
2. Move in rig up pulling unit & nipple up blow out preventer.
3. Run in hole w/ cast iron bridge plug @ 9130'
4. Tag cast iron bridge plug w/ tubing, confirm depth.
5. Pump 25 sx of cement on plug.
6. Displace w/ 9.0 ppg salt gel based mud.
7. Pressure Test casing to 500 psi. — Add Plug. Start 25 sx 7220 - 7800. (T/Bone, Spring)
- P&S — 8. Spot 25sx @ 6,000'. WOC & TAG 5665 - 5465. (T/De/aware)
9. Pump cement plug from 4615' up to 4415' (Notify NMOCD). Perf 4565, SQZ cnt to 4415' woc Tag (Shoe)
10. Displace w/ 9.0 ppg salt gel based mud.
11. Wait on cement.
12. Tag cement w/ NMOCD official on location. 4415'.
- P&S — 13. Spot 25sx @ 3,000' Perf @ 2850, SQZ cnt to 2730, woc Tag (B/salt)
14. Displace w/ 9.0 ppg salt gel based mud.
- P&S — 15. Spot 25sx @ 1,500' Perf @ 1455, SQZ cnt to 1355, woc Tag T/salt,
16. Displace w/ 9.0 ppg salt gel based mud.
17. Spot 25sx @ 800'
18. Displace w/ 9.0 ppg salt gel based mud.
- P&S — 19. Pump cement from 470' — 360' (Notify NMOCD). Perf 460, SQZ cnt to 360. woc Tag (Shoe)
20. Displace w/ 9.0 ppg salt gel based mud.
21. Wait on cement.
22. Tag cement w/ NMOCD official on location. 360
23. Displace w/ 9.0 ppg salt gel based mud.
- P&S — 24. Pump cement from 60' - surface. Perf @ 60', SQZ cnt to surf.
25. Cut off wellhead 3' below surface.
26. Cap well with 1/2" steel plate.
27. Well marker on plate, no more than 4' above ground w/ well name, operator, legal location and plug & abandon date.
28. Reclaim location.

Below ground level dry hole marker required. LAC Habitat.

BLM to be contacted. Not OCD.  
575-393-3612

API 30-025-25701


**M:WA**  
Morgan & Associates, Inc.

Federal 3 #2

Lea County, NM

P&A Wellbore Sketch

Proposed TD: 13,150' TD

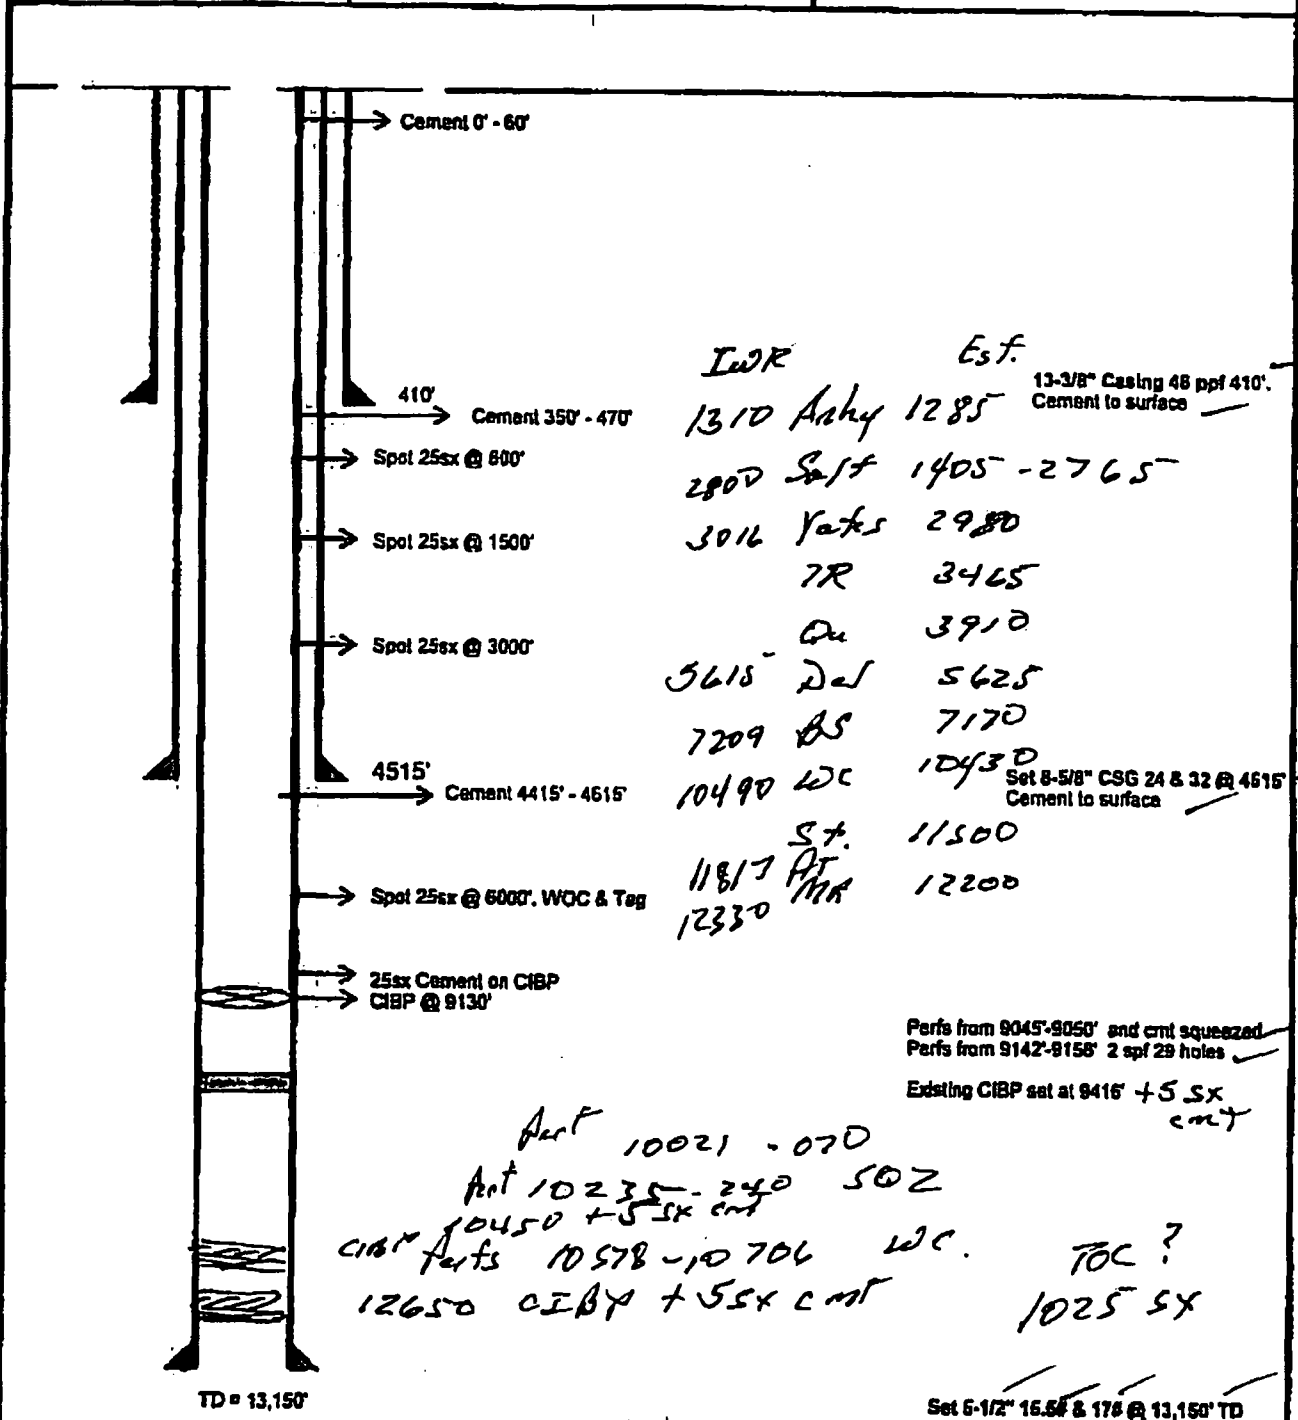

Well Information

Surface Location: Sec 3 T19S R32E, Lea County, NM

**BUREAU OF LAND MANAGEMENT**  
**Carlsbad Field Office**  
**620 East Greene Street**  
**Carlsbad, New Mexico 88220**  
**575-234-5972**

**Permanent Abandonment of Federal Wells**  
**Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within ninety (90) days from the approval date of this Notice of Intent to Abandon.

**If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.**

**The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.**

2. Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.