Submit 1 Copy To Appropriate District District I - (575) 393-6161

State of New Mexico Energy, Minerals and Natural Resources

Form C-103 Revised August 1, 2011

W	ELL API NO.			
30	-005-21028			
5.	Indicate Type of	of Lease		
	STATE	FEE	X	
6	State Oil & Ga	s I ease No	`	

<u>District II</u> - (575) 748-1283 811 S. First St., Artesia, NM 88210			30-005-21028	1				
	OIL CONSERVATION	DIVISION						
District III - (505) 334-6178	cis Dr.	5. Indicate Type of I						
1000 Rio Brazos Rd., Aztec, NM 87410	505	STATE	FEE X					
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87	303	6. State Oil & Gas L	ease No.				
87505		_						
	CES AND REPORTS ON WELLS	HARRS O	Lease Name or U	nit Agreement Name				
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUGBACK TO A								
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH								
PROPOSALS.) 1. Type of Well: Oil Well X C	Gas Well 🔲 Other	MAY 2 2 CO	8. Well Number					
1. Type of went. On went X	, as wen outer		OGRID Number					
2. Name of Operator		RECEIV	1). OOIGD Hamou					
CIMAREX ENERGY CO. OF COL	-ORADU	1/2-	162683 215099					
3. Address of Operator		10. Pool name or Wildcat						
600 N. MARIENFELD, SUITE 600		UNDES. WOLFCAMP						
4. Well Location								
Unit Letter D: 990 feet from the NORTH line and 660 feet from the WEST line								
Section 13	Township 15S	Range	31E NMPM	CHAVES County				
Section 13	11. Elevation (Show whether DR,			CHAVES County				
	4,372' – GR		.)					
	4,372 - 01	<u> </u>						
10 01 1 4			D . O.1 D					
12. Check A	appropriate Box to Indicate Na	ature of Notice,	Report or Other Da	ita P				
NOTICE OF IN	TENTION TO:	QI IE	SEQUENT REPO	DT OF				
NOTICE OF IN								
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WOR		TERING CASING				
TEMPORARILY ABANDON	CHANGE PLANS			AND A X				
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMEN	IT JOB					
DOWNHOLE COMMINGLE								
OTHER.		OTHER MELL	PLUGGED AND ABAND	ONED DEMEMO				
OTHER:	leted operations. (Clearly state all p							
	rk). SEE RULE 19.15.7.14 NMAC							
proposed completion or reco		. For Muniple Co	impletions. Attach wen	bore diagram or				
proposed completion of reco	Ampietion.							
05/13/10: SET 5-1/2" CIRP @ 8 800	'. CIRC WELL W/MIF.PRES	TEST CSG X CI	BP TO 500# - HELD O	K PLIMP 25 SXS				
CMT. @ 8,800'-8,620'; PU	JMP 25 SXS. CMT. @ 7,588'-7,75	8'; PUMP 75 SXS	s. CMT. @ 6,029'; WO	C.				
05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75 0' (OK'D BY OCD); CUT 5-1/2" (8'; PUMP 75 SXS CSG. @ 3,800' – N	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S	C. SXS. CMT. W/ 2%				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC	JMP 25 SXS. CMT. @ 7,588'-7,75' 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665';	8'; PUMP 75 SXS CSG. @ 3,800' – N CUT 5-1/2" CSG.	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI	C. BXS. CMT. W/ 2% E.				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W	8'; PUMP 75 SXS CSG. @ 3,800' – N CUT 5-1/2" CSG. VOC X TAG CMT	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK	C. SXS. CMT. W/ 2% E. 'D BY OCD); PERF.				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P	8'; PUMP 75 SXS CSG. @ 3,800' – N CUT 5-1/2" CSG. VOC X TAG CMT RES. UP TO 1,00	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25	C. SXS. CMT. W/ 2% E. 'D BY OCD); PERF. SXS. CMT. @ 1,500'-				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A 1,350' (PER OCD); PERF.	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CA	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. VOC X TAG CMT RES. UP TO 1,00 CL @ 475'; WOC	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (C. SXS. CMT. W/ 2% E. 'D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC.				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC I'; DIG OUT X CU	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (UT OFF WELLHEAD 3	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W .TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CAI . ANNULI, 30 SXS. CMT. @ 75'-3	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC I'; DIG OUT X CU	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (UT OFF WELLHEAD 3	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W .TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CAI . ANNULI, 30 SXS. CMT. @ 75'-3	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC I'; DIG OUT X CU	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (UT OFF WELLHEAD 3	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W .TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CA ANNULI, 30 SXS. CMT. @ 75'-3 . ANNULI; WELD ON STEEL PLA	8'; PUMP 75 SXS CSG. @ 3,800' – N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC I'; DIG OUT X CU ATE TO CSGS. X	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 E X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W .TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CA ANNULI, 30 SXS. CMT. @ 75'-3 . ANNULI; WELD ON STEEL PLA	8'; PUMP 75 SXS CSG. @ 3,800' – N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC I'; DIG OUT X CU ATE TO CSGS. X	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (UT OFF WELLHEAD 3	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W .TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CA ANNULI, 30 SXS. CMT. @ 75'-3 . ANNULI; WELD ON STEEL PLA	8'; PUMP 75 SXS CSG. @ 3,800' – N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC I'; DIG OUT X CU ATE TO CSGS. X	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 E X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A 1,350' (PER OCD); PERF. TO SURF., FILLING ALL CMT. TO SURF. ON ALL MIRU PXA EQUIP.	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CA ANNULI, 30 SXS. CMT. @ 75'-3 . ANNULI; WELD ON STEEL PLA	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC V'; DIG OUT X CU ATE TO CSGS. X	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 E X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W .TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CA ANNULI, 30 SXS. CMT. @ 75'-3 . ANNULI; WELD ON STEEL PLA	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC V'; DIG OUT X CU ATE TO CSGS. X	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 E X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A 1,350' (PER OCD); PERF. TO SURF., FILLING ALL CMT. TO SURF. ON ALL MIRU PXA EQUIP.	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P . X SQZ. 40 SXS. CMT. w/ 2% CA ANNULI, 30 SXS. CMT. @ 75'-3 . ANNULI; WELD ON STEEL PLA	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. VOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC V'; DIG OUT X CU ATE TO CSGS. X	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 E X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE	C. SXS. CMT. W/ 2% E. ''D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A 1,350' (PER OCD); PERF. TO SURF., FILLING ALL CMT. TO SURF. ON ALL MIRU PXA EQUIP. Spud Date:	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P X SQZ. 40 SXS. CMT. w/ 2% CA: ANNULI, 30 SXS. CMT. @ 75'-3 ANNULI; WELD ON STEEL PLA 05/10/19 Rig Release Dat	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. WOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC ATE TO CSGS. X RDMO PX.	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE A EQUIP. 05/16/19	C. SXS. CMT. W/ 2% E. 'D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A 1,350' (PER OCD); PERF. TO SURF., FILLING ALL CMT. TO SURF. ON ALL MIRU PXA EQUIP. Spud Date:	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P X SQZ. 40 SXS. CMT. w/ 2% CA: ANNULI, 30 SXS. CMT. @ 75'-3 ANNULI; WELD ON STEEL PLA 05/10/19 Rig Release Dat	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. WOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC ATE TO CSGS. X RDMO PX.	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE A EQUIP. 05/16/19	C. SXS. CMT. W/ 2% E. 'D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A 1,350' (PER OCD); PERF. TO SURF., FILLING ALL CMT. TO SURF. ON ALL MIRU PXA EQUIP. Spud Date:	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P X SQZ. 40 SXS. CMT. w/ 2% CA: ANNULI, 30 SXS. CMT. @ 75'-3 ANNULI; WELD ON STEEL PLA 05/10/19 Rig Release Dat	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. WOC X TAG CMT PRES. UP TO 1,00 CL @ 475'; WOC ATE TO CSGS. X RDMO PX.	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 S X TAG CMT. PLUG (JT OFF WELLHEAD 3 INSTALL DRY HOLE A EQUIP. 05/16/19	C. SXS. CMT. W/ 2% E. 'D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				
CMT. @ 8,800'-8,620'; PU 05/14/19: TAG CMT. PLUG @ 4,23 CACL @ 4,018' (PER OC 05/15/19: PUMP 25 SXS. CMT. W/ SQZ. HOLES @ 1,450'; A 1,350' (PER OCD); PERF. TO SURF., FILLING ALL CMT. TO SURF. ON ALL MIRU PXA EQUIP.	JMP 25 SXS. CMT. @ 7,588'-7,75: 0' (OK'D BY OCD); CUT 5-1/2" (D); WOC X TAG CMT. @ 3,665'; 2%CACL @ 3,100' (PER OCD); W TTEMPT TO EST. INJ. RATE – P X SQZ. 40 SXS. CMT. w/ 2% CA: ANNULI, 30 SXS. CMT. @ 75'-3 ANNULI; WELD ON STEEL PLA 05/10/19 Rig Release Dat	8'; PUMP 75 SXS CSG. @ 3,800' - N CUT 5-1/2" CSG. WOC X TAG CMT RES. UP TO 1,00 CL @ 475'; WOC I'; DIG OUT X CU ATE TO CSGS. X RDMO PX. te:	S. CMT. @ 6,029'; WOO NOT FREE; PUMP 40 S . @ 3,000' – NOT FREI T. PLUG @ 2,752' (OK 0# X HOLD; PUMP 25 EX TAG CMT. PLUG @ JT OFF WELLHEAD 3 INSTALL DRY HOLE A EQUIP. 05/16/19	C. SXS. CMT. W/ 2% E. 'D BY OCD); PERF. SXS. CMT. @ 1,500'- @ 367'; PERF. X CIRC. '' B.G.L.; VERIFY				

Type or print name:

DAVID A. EYLER

E-mail address: DEYLER@MILAGRO-RES.COM PHONE: 432.687.3033

For State Use Only

APPROVED BY: Klyy
Conditions of Approval (if app):

TITLE Compliance Office DATE 6-7-19