
B SUNDRY Do not use th abandoned we	N WELLS to re-enter an such proposals.	enter an roposals.		FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018 5. Lease Serial No. NMNM17238 6. If Indian, Allottee or Tribe Name		
SUBMIT IN	TRIPLICATE - Other instruction	ns on pape BBS	000	7. If Unit or CA/Agree	ment, Name and/or No.	
1. Type of Well Soli Well Gas Well Ot	SEP 23	SEP 2 3 2019 8. Well Name and No. SMITH RANCH FEDERAL				
2. Name of Operator COG OPERATING LLC		IL ANDERSON ssociates.com DFCE	IVED	 API Well No. 30-025-26810-00 	D-C1	
3a. Address ONE CONCHO CENTER 60 MIDLAND, TX 79701-4287	3b. Pl	one No. (include area code) 132-580-7161		10. Field and Pool or E TEAS	xploratory Area	
4. Location of Well (Footage, Sec., 7	T., R., M., or Survey Description)			11. County or Parish, S	County or Parish, State	
Sec 11 T20S R33E SWNW 1	980FNL 660FWL			LEA COUNTY, M	OUNTY, NM	
12. CHECK THE A	PPROPRIATE BOX(ES) TO IN	DICATE NATURE OF	NOTICE,	REPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION		TYPE OF	ACTION			
		🗖 Deepen	Product	ion (Start/Resume)	□ Water Shut-Off	
Notice of Intent	□ Alter Casing	Hydraulic Fracturing	🗖 Reclam	ation	Well Integrity	
Subsequent Report	Casing Repair	New Construction	🗖 Recomp	olete	D Other	
Final Abandonment Notice		Plug and Abandon Plug Back	Tempor Water I	arily Abandon		
determined that the site is ready for t 1. Tag 5 1/2" CIBP @ 9450' v 2. Set 5 1/2" CIBP @ 9267'. S 3. Set 5 1/2" CIBP @ 6254'. C WOC & Tag. 4. Spot 25 sx cmt @ 5112-49 5. Perf & Sqz 380 sx cmt @ 3 6. Perf & Sqz 110 sx cmt @ 3 7. Cut off well head, verify fm ↓ Dr:ll out plugs @ Stot Cart 1105;	12' cmt on top. D:11 out Spot 25 sx cmt @ 9267-9070'. Circulate hole w/ MLF. Pressure to 12'. WOC & Tag (8 5/8" Shoe) (2 182-1300'. WOC & Tag (DV Too 537' to Surface. to surface, weld on Below Grou 9450 A 994 . Clean 2 - 10842. Teg	R-11 Ping 3 Add Ping 8 est csg. Spot 25 sx cmt Del) 1 & R-111-P Potash Are nd Dry Hole Marker	1P 3312-8 @ 6254-6(a) <u>τ</u> ∕sł) ŞEB	Secretary 132.(T/BS) 134: Spot crit to EATTACHE	r Portach Tay, IZ 046. Tay D.FOR	
14. I hereby certify that the foregoing i	s true and correct. Electronic Submission #480307	verified by the BLM Well TING LLC, sent to the H	Information obbs	n System	7	
	ANDERSON	Title REGULA		,		
Signature (Electronic	Submission)	Date 08/23/20	19			
	THIS SPACE FOR FE			SE		
Approved By	C. Conro	Title SAL-	7		9-15-19 Date	
Conditions of approval, if any, are attached certify that the applicant holds legal or eq which would entitle the applicant to cond	uitable title to those rights in the subject	rant or lease Office CFC	,			
Title 18 U.S.O. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a crime for statements or representations as to any n	r any person knowingly and vatter within its jurisdiction.	willfully to ma	ake to any department or	agency of the United	
(Instructions on page ²) ** BLM REV	VISED ** BLM REVISED ** BI	-m revised ** blm 9-24-19	REVI PE	RECOR	DONLY	

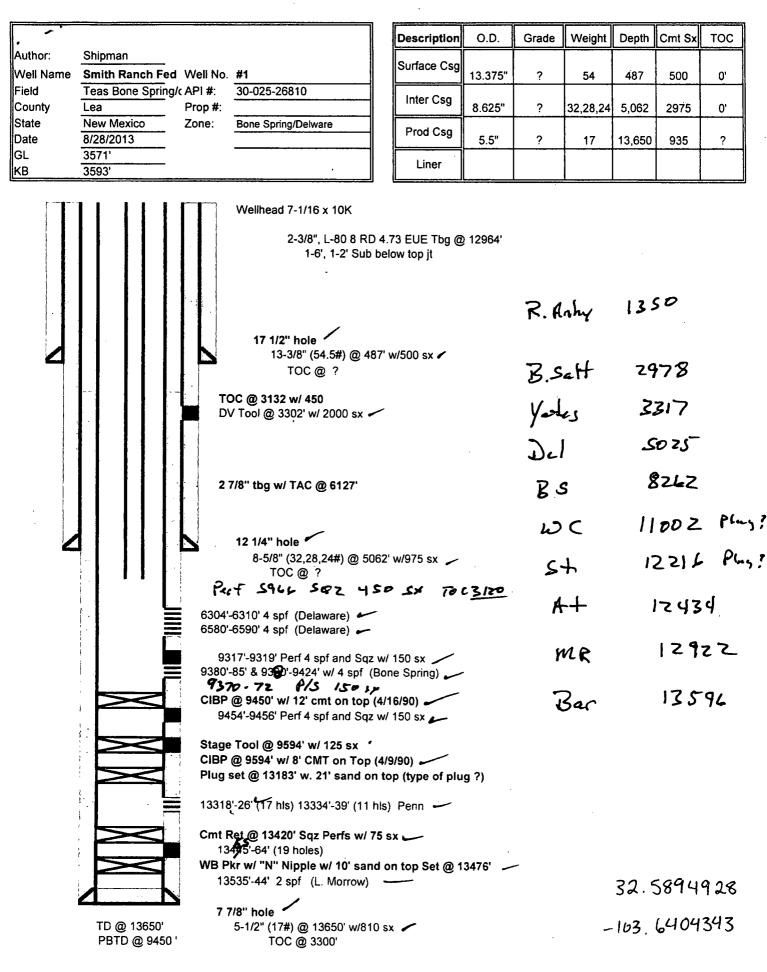

C:\Users\BCM\AppData\Local\Microsoft\Windows\INetCache\Content.Outlook\LTMTU8AM\Smith Ranch 11 Fed #1 WBD (2)

• مر			
Author:	Shipman		
Well Name	Smith Ranch Fed	Well No.	#1
Field	Teas Bone Spring/c	API #:	30-025-26810
County	Lea	Prop #:	
State	New Mexico	Zone:	Bone Spring/Delware
Date	8/28/2013		
GL	3571'		
КВ	3593'		

Description	O.D.	Grade	Weight	Depth	Cmt Sx	тос
Surface Csg	13.375"	?	54	487	500	0'
Inter Csg	8.625"	?	32,28,24	5,062	2975	0'
Prod Csg	5.5"	?	17	13,650	935	?
Liner						

17 1/2" hole 13-3/8" (54.5#) @ 487' w/500 sx TOC @ ? 6. Perf & Sqz 110 sx cmt @ 537' to Surface. 5. Perf & Sqz 380 sx cmt @ 3182-1300'. WOC & Tag (DV Tool & R-111-P Potash Area) TOC @ 3132 w/ 450 DV Tool @ 3302' w/ 2000 sx 12 1/4" hole 8-5/8" (32,28,24#) @ 5062' w/975 sx TOC @ ? 4. Spot 25 sx cmt @ 5112-4912'. WOC & Tag (8 5/8" Shoe) 3. Set 5 1/2" CIBP @ 6254'. Circulate hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 6254-6054'. WOC & Tag. 6304'-6310' 4 spf (Delaware) 6580'-6590' 4 spf (Delaware) 2. Set 5 1/2" CIBP @ 9267'. Spot 25 sx cmt @ 9267-9070'. 9317'-9319' Perf 4 spf and Sqz w/ 150 sx 9380'-85' & 9390'-9424' w/ 4 spf (Bone Spring) 1. Tag 5 1/2" CIBP @ 9450' w/ 12' cmt on top. CIBP @ 9450' w/ 12' cmt on top (4/16/90) 9454'-9456' Perf 4 spf and Sqz w/ 150 sx Stage Tool @ 9594' w/ 125 sx CIBP @ 9594' w/ 8' CMT on Top (4/9/90) Plug set @ 13183' w. 21' sand on top (type of plug ?) 13318'-26' (17 hls) 13334'-39' (11 hls) Penn Cmt Ret @ 13420' Sqz Perfs w/ 75 sx 13445'-64' (19 holes) WB Pkr w/ "N" Nipple w/ 10' sand on top Set @ 13476' 13535'-44' 2 spf (L. Morrow) 7 7/8" hole TD @ 13650' 5-1/2" (17#) @ 13650' w/810 sx PBTD @ 9450 ' TOC @ 3300'

C:\Users\BCM\AppData\Local\Microsoft\Windows\INetCache\Content.Outlook\LTMTU8AM\Smith Ranch 11 Fed #1 WBD

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged</u>.

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted