Office	State of New Mexico	Form C-103			
District I - (575) 393-6161	Energy, Minerals and Natural Resources	Revised August 1, 2011			
1625 N. French Dr., Hobbs, NM 88240 District II - (575) 748-1283		WELL API NO. 30-025-30299			
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	5. Indicate Type of Lease			
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South Francis DOCD	STATE STATE FEE			
<u>District IV</u> – (505) 476-3460	Santa Fe, NM 87505	6. State Oil & Gas Lease No.			
1220 S. St. Francis Dr., Santa Fe, NM 87505	DEC 0 2 2019				
(DO NOT USE THIS FORM FOR PROPO DIFFERENT RESERVOIR. USE "APPLIC PROPOSALS.)	CES AND REPORTS ON WELLS SALS TO DRILL OR TO DEEPEN CONTROL OF SUCH CATION FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name WEST DOLLARHIDE QUEEN SAND UNIT			
1. Type of Well: Oil Well	Gas Well Other INJECTOR	8. Well Number 142			
2. Name of Operator		9. OGRID Number			
RAM ENERGY LLC 3. Address of Operator		309777 10. Pool name or Wildcat			
2100 S. UTICA AVE., SUITE	175, TULSA, OK 74114	DOLLARHIDE QUEEN (018810)			
4. Well Location	O Continue de CONTINUE D'accide 000	Cod Cod day TAGT 1			
	0feet from the _SOUTH line and900_	feet from theEAST_line			
Section 32	Township 24S Range 38E 11. Elevation (Show whether DR, RKB, RT, GR, etc.)	NMPM LEA County			
	3170' GR				
12. Check A	Appropriate Box to Indicate Nature of Notice,	Report or Other Data			
	F.W.	•			
NOTICE OF IN PERFORM REMEDIAL WORK □	PLUG AND ABANDON REMEDIAL WOR	SEQUENT REPORT OF: K			
TEMPORARILY ABANDON	CHANGE PLANS COMMENCE DRI				
PULL OR ALTER CASING	MULTIPLE COMPL CASING/CEMENT				
DOWNHOLE COMMINGLE					
OTHER:	CT OTHER.				
	☐ OTHER:	<u></u>			
13. Describe proposed or comp	leted operations. (Clearly state all pertinent details, and				
13. Describe proposed or comp of starting any proposed we	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Cor				
13. Describe proposed or comp	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Cor				
Describe proposed or comp of starting any proposed we proposed completion or rec NOTIFY NMOCD 24 HRS	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. BEFORE MIRU.				
 Describe proposed or comp of starting any proposed we proposed completion or rec NOTIFY NMOCD 24 HRS MIRU. ND WH, NU BOPF 	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. BEFORE MIRU. E.				
 Describe proposed or composed starting any proposed we proposed completion or rec NOTIFY NMOCD 24 HRS MIRU. ND WH, NU BOPE SET CIBP@3550'. SPOT 2 	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'.				
 Describe proposed or comp of starting any proposed we proposed completion or rec NOTIFY NMOCD 24 HRS MIRU. ND WH, NU BOPF SET CIBP@3550'. SPOT 2 CIRCULATE 9.5 PPG ML 	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. BEFORE MIRU. BESSX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING.	npletions: Attach wellbore diagram of			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPE 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. C" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO") CEMENT FROM 1250'-1100'. WOC&TAG. (T.SA)	npletions: Attach wellbore diagram of ES/B.SALT) LT)			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPE 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. C" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SAC''' CEMENT FROM 465'-SURFACE. VERIFY CEME	npletions: Attach wellbore diagram of ES/B.SALT) LT) ENT TO SURFACE. (FW/SHOE/SURFACE).			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPP 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. C" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO") CEMENT FROM 1250'-1100'. WOC&TAG. (T.SA)	npletions: Attach wellbore diagram of ES/B.SALT) LT) ENT TO SURFACE. (FW/SHOE/SURFACE).			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPP 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A RECLAMATION.	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. BEFORE MIRU. B. BEFORE MIRU. C. CEMENT FROM 3550'-3300'. F AND TEST CASING. C. CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'). C. CEMENT FROM 1250'-1100'. WOC&TAG. (T.SAIO'). C. CEMENT FROM 465'-SURFACE. VERIFY CEMENT CEMENT FROM 465'-SURFACE.	npletions: Attach wellbore diagram of ES/B.SALT) LT) ENT TO SURFACE. (FW/SHOE/SURFACE).			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPP 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A RECLAMATION.	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. C" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SAC''' CEMENT FROM 465'-SURFACE. VERIFY CEME	ES/B.SALT) LT) LT) NT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPP 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A' RECLAMATION. CLOSED LOOP CONTAIN	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. C" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SA. C''' CEMENT FROM 465'-SURFACE. VERIFY CEMENT OR SINCHORS 3' BELOW SURFACE AND INSTALL DREAD OF THE SURFACE	es/B.salt) LT) NT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPP 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A RECLAMATION.	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. BEFORE MIRU. B. BEFORE MIRU. C. CEMENT FROM 3550'-3300'. F AND TEST CASING. C. CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'). C. CEMENT FROM 1250'-1100'. WOC&TAG. (T.SAIO'). C. CEMENT FROM 465'-SURFACE. VERIFY CEMENT CEMENT FROM 465'-SURFACE.	es/B.salt) LT) NT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPP 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A' RECLAMATION. CLOSED LOOP CONTAIN	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. C" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SA. C''' CEMENT FROM 465'-SURFACE. VERIFY CEMENT OR SINCHORS 3' BELOW SURFACE AND INSTALL DREAD OF THE SURFACE	ES/B.SALT) LT) LT) NT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPE 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A RECLAMATION. CLOSED LOOP CONTAIN	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. BEFORE MIRU. B. BEFORE MIRU. C. CEMENT FROM 3550'-3300'. F AND TEST CASING. C. CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO') WOC&TAG. (T.SA. C. CEMENT FROM 1250'-1100'. WOC&TAG. (T.SA. C. CEMENT FROM 465'-SURFACE. VERIFY CEMENT OF COMMENT SYSTEM WILL BE USED FOR FLUIDS. Rig Release Date:	es/B.salt) LT) ENT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR See Attached Conditions of Approval			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPE 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A RECLAMATION. CLOSED LOOP CONTAIN	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. B. BEFORE MIRU. B. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. C" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SA. C''' CEMENT FROM 465'-SURFACE. VERIFY CEMENT OR SINCHORS 3' BELOW SURFACE AND INSTALL DREAD OF THE SURFACE	es/B.salt) LT) ENT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR See Attached Conditions of Approval			
13. Describe proposed or comp of starting any proposed we proposed completion or rec 1. NOTIFY NMOCD 24 HRS 2. MIRU. ND WH, NU BOPE 3. SET CIBP@3550'. SPOT 2 4. CIRCULATE 9.5 PPG ML 5. SPOT 35SX OF CLASS "C 6. SPOT 25SX OF CLASS "C 7. SPOT 55SX OF CLASS "C 8. CUTOFF WELLHEAD, A RECLAMATION. CLOSED LOOP CONTAIN	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. 3. BEFORE MIRU. 3. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. 2" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SAC''' CEMENT FROM 465'-SURFACE. VERIFY CEMENT HOW SURFACE AND INSTALL DREAD OF THE NAMENT SYSTEM WILL BE USED FOR FLUIDS. Rig Release Date:	ES/B.SALT) LT) ENT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR See Attached Conditions of Approval e and belief.			
13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or re	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. 3. BEFORE MIRU. 3. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. FAND TEST CASING. 2" CEMENT FROM 2725'-2405'. WOC&TAG. (YATI.)" CEMENT FROM 1250'-1100'. WOC&TAG. (T.SA.)" CEMENT FROM 465'-SURFACE. VERIFY CEMENCHORS 3' BELOW SURFACE AND INSTALL DR. NMENT SYSTEM WILL BE USED FOR FLUIDS. Rig Release Date: Above is true and complete to the best of my knowledge. TITLE OPERATIONS MAN.	ES/B.SALT) LT) LT) ENT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR See Attached Conditions of Approval e and belief. AGERDATE11/25/19			
13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or re	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. 3. BEFORE MIRU. 3. 25SX OF CLASS "C" CEMENT FROM 3550'-3300'. F AND TEST CASING. 2" CEMENT FROM 2725'-2405'. WOC&TAG. (YATIO'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SAC''' CEMENT FROM 465'-SURFACE. VERIFY CEMENT HOW SURFACE AND INSTALL DREAD OF THE NAMENT SYSTEM WILL BE USED FOR FLUIDS. Rig Release Date:	ES/B.SALT) LT) LT) ENT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR See Attached Conditions of Approval e and belief. AGERDATE11/25/19			
13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or re	leted operations. (Clearly state all pertinent details, and ork). SEE RULE 19.15.7.14 NMAC. For Multiple Corompletion. 3. BEFORE MIRU. 3. CEMENT FROM 2725'-2405'. WOC&TAG. (YATAC'' CEMENT FROM 1250'-1100'. WOC&TAG. (T.SAC'' CEMENT FROM 465'-SURFACE. VERIFY CEMENCHORS 3' BELOW SURFACE AND INSTALL DRAWNENT SYSTEM WILL BE USED FOR FLUIDS. Rig Release Date: Above is true and complete to the best of my knowledged by TITLE OPERATIONS MANATERSON E-mail address: MPATTERSON@RAM	ES/B.SALT) LT) LT) ENT TO SURFACE. (FW/SHOE/SURFACE). YHOLE MARKER. TURN OVER FOR See Attached Conditions of Approval e and belief. AGERDATE11/25/19			

/

WELLBORE DIAGRAM WEST DOLLARHIDE QUEEN SAND UNIT #142

Created:	11/25/19	By:	LEE R.		Weil #:	142	_	
Updated:		By:		•	API .		30-025-30299	
Lease:	WEST DOOLARI		SAND UNIT	,	Unit Ltr.:	Р	Sec.	32
Field:		DUEEN		•	TSHP/Rng:		24S-T38E	
Surf. Loc.:	800' FS	SL & 900' FE	<u>EL</u>		Pool Code:	·	OGRID:	309777
Bot. Loc.:					<u>.</u>			
County:	LEA	St.:	NM	•	Directions:			
Status:								
Surface Cas Size: Wt., Grd.: Depth: Sxs Cmt: Circulate: TOC: Hole Size:	8-5/8" 24# 415' 250 YES SURFACE 12-1/4"							
FORMATION T.Salt B. Salt	1200' EST. 2505' EST.							
Intermediate	e Casing		(
Size:	5-1/2"							
Wt., Grd.:	15.5#/17#			•	Que	en: 3645	'-3831'(OA)	
Depth:	3900'		}	•	 			
Sxs Cmt:	1100		(
Circulate:	YES							
TOC:	SURFACE							
Hole Size:	7-7/8"							

WELLBORE DIAGRAM WEST DOLLARHIDE QUEEN SAND UNIT #142

E 1 - 1, 2, 1, 2

Created:	11 <u>/25/19</u>	By: LE	ER.	Well #:		142	_	
Updated:		By:		API	_		30-025-30299	
Lease:	WEST DOOLARHIE		UNIT	Unit Ltr	.: _	P	Sec.	32
Field:		JEEN		TSHP/F			24S-T38E	
Surf. Loc.:	800' FSL	& 900' FEL	<u></u>	Pool Co	ode: _		OGRID:	309777
Bot. Loc.: County:	LEA	St.: N	M	Direction				
Status:		Ju	1141	Directio	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,		· · · · · · · · · · · · · · · · · · ·	
				· · · · · · · · · · · · · · · · · · ·				
Surface Cas Size: Wt., Grd.: Depth: Sxs Cmt: Circulate: TOC: Hole Size:	8-5/8" 24# 415' 250 YES SURFACE 12-1/4"							
		ےا	4		-			165'-SURFACE.
			·		VERI	FY. (FW/	SHOE/SURFAC	CE)
)					
			MLF					
			(
			1		1000	T DECV	OF CHIT EDO	M 1250'-1100'.
					ı			W 1290-1100.
					WOC	JAIAG.	(T.SALT)	
			MLF	1 1				
FORMATION T.Salt	1200' EST.				(BBA	₩ SERV	or out roo	M 2725'-2405'.
B. Salt	2505' EST.		MLF					
				_			YATES/B.SA	
1-4	0im-m		7	1 (_		OT 25SX ON TOP
Intermediate	_			-	FRO	<u>М 3550'-</u>	3300'.(PERFS	<u> </u>
Size:	5-1/2"			>			= = = = = = = = = = = = = = = = = = = =	
Wt., Grd.:	15.5#/17#		(Que	en: 364	5'-3831'(OA)	
Depth:	3900')					
Sxs Cmt:	1100							
Circulate:	YES			-				
TOC:	SURFACE							
Hole Size:	7-7/8"							

GENERAL CONDITIONS OF APPROVAL:

- 1) Insure all bradenheads have been exposed, identified, and valves are operational prior to rigging up on well.
- 2) Contact the appropriate NMOCD District Office no later than 24 hours prior to moving in and rigging up.
- 3) A copy of the approved C103 intent to P&A should be distributed to the onsite company and plugging representatives. <u>Approved procedures are good for a period of one year from approved date, unless otherwise specified on the C103 intent</u>. Approvals past this date will require the submission and approval of a new C103 intent.
- 4) A company representative is required to be present to witness all operations including setting CIBP's, circulation of mud laden fluids, perforating, squeezing or spotting cement plugs, tags, or any other operations approved on the C103 intent to P&A. Company representative should contact the NMOCD and report all operations.
- 5) Any changes that may be required during plugging operations should be approved by the NMOCD before proceeding.
- 6) A closed loop system is to be used for all plugging operations. Contents of the steel pits to be hauled to a NMOCD permitted disposal facility.
- 7) Mud laden fluids must be placed between all cement plugs mixed at 25 sacks of salt gel per 100 barrels of brine.
- 8) All cement plugs will be 100' or 25 sacks cement, whichever is greater. Class 'C' cement will be used above 7500' and Class 'H' below 7500'. Plugs should be no more than 3000' apart
- 9) Site remediation due within one year of well plugging completion.