Submit I Copy To Appropriate District	State of New Me	vico	Form C-103
Office	fice		Revised August 1, 2011
District I – (575) 393-6161 Energy, Minerals and Natural Resources 1625 N. French Dr., Hobbs, NM 88240			WELL API NO.
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	District II – (575) 748-1283 OIL CONSERVATION DIVISION		30-025-32338
<u>District III</u> – (505) 334-6178 1220 South St. Francis Dr.		5. Indicate Type of Lease STATE 🛛 FEE 🗖	
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	Santa Fe, NM 8	7505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505			
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101)			7. Lease Name or Unit Agreement Name
PROPOSALS.)			Vacuum Glorieta West Unit 8. Well Number: 133
1. Type of Well: Oil Well Gas Well Other Injection MAY 2 9 2020			
Chevron U.S.A. Inc			9. OGRID Number 4323
3. Address of Operator		ECEIVED	10. Pool name or Wildcat
6301 DEAUVILLE BLVD., N	AIDLAND, TX 79706		Vacuum Glorieta
4. Well Location			
Unit Letter <u>O</u> : <u>355</u> feet from the <u>South</u> line and <u>1875</u> feet from the East line			
Section 36 Township 17S Range 34E NMPM County Lea 11. Elevation (Show whether DR, RKB, RT, GR, etc.) 11. Elevation (Show whethetc.)			
	3,991' GL, 4,005' KB	, KKB, KI, GK, eic.)	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:			
NOTICE OF INTENTION TO: SUBSEQUENT RE PERFORM REMEDIAL WORK DILUG AND ABANDON REMEDIAL WORK			-
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS.			— — —
PULL OR ALTER CASING D MULTIPLE COMPL CASING/CEMENT J			ГЈОВ 🗌 —
	I		
OTHER:	П	OTHER:	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date			
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of			
proposed completion or recompletion. 8-5/8" @ 1,460' TOC Surface, 5-1/2" @ 8,100' TOC Surface. Please see WBD for plug back and open hole sidetrack information.			
Chevron USA INC respectfully requests to abandon this well as follows:			
All Cement sack volumes are calculated using 1.32 yield for Class C and 1.18 yield for Class H. Adjust volumes to			
match footage as necessary based on the yield used at the time of execution.			
1. Call and notify NMOCD 24 hrs before operations begin.			
2. Pressure test casing to 500 psi for 15 minutes rig-less (or maximum anticipated pressure).			
a. If pressure test fails, contact engineer.			
3. MIRU CTU.			
4. Check well pressures, kill well as necessary, perform bubble test on surface casing annuli, if bubble test fails			
Chevron intends to Zonite, cut and pull casing, or eliminate SCP with another means after the well is plugged to a			
certain point agreed upon by the NMOCD and Chevron.			
a. Bubble test should be at least 30 minutes and follow the bubble test SOP.b. Bubble tests should occur each morning, critical times are prior to pumping upper hydrocarbon plug or			
pumping cement to surface.			
5. N/U BOP and pressure test as per SOP.			
a. 250 psi low for 5 minutes, and MASP or 500 psi, or highest expected pressure (whichever is greater) for the			
job for 10 minutes each.			
6. TIH and tag CIBP cement cap at 5,695'.			
7. Spot MLF, subtracting cement volumes. Do not place MLF until casing pressure tests.			
8. Spot 25 sx CL "C" cement f/ 5,695' t/ 5,449' (Glroieta).			
a. IUC must be at 5,630° or shallower.			
 c. Perform final bubble test after cement has hardened. 5. N/U BOP and pressure test as per SOP. a. 250 psi low for 5 minutes, and MASP or 500 psi, or highest expected pressure (whichever is greater) for the job for 10 minutes each. 6. TIH and tag CIBP cement cap at 5,695'. 7. Spot MLF, subtracting cement volumes. Do not place MLF until casing pressure tests. 8. Spot 25 sx CL "C" cement f/ 5,695' t/ 5,449' (Glroieta). a. TOC must be at 5,630' or shallower. b. Discuss with NMOCD on waiving WOC and tag if casing passed a pressure test. 9. Spot 40 sx CL "C" cement f/ 4,222' t/ 3,827' (San Andres, Grayburg). 			

- a. TOC must be at 3,872' or shallower.
- 10. Spot 25 sx CL "C" cement f/ 2,765' t/ 2,519' (Yates). a. TOC must be at 2,665' or shallower.
- 11. Spot 170 sx CL "C" cement f/ 1,636' t/ Surface (Shoe, Salt, FW).
 - a. Deepest freshwater zone in the area is $\sim 169^{\circ}$.
- 12. Cut all casings & anchors & remove 3' below grade. <u>Verify</u> cement to surface & weld on dry hole marker (4" diameter, 4' tall). Clean location.

Note: All cement plugs class "C" (<7,500') or "H" (>7,500') with closed loop system used, and MLF spotted between plugs.

 I hereby certify that the information above is true and complete to the best of my knowledge and belief.


 SIGNATURE
 P&A Engineer, Attorney in fact

 DATE
 05/28/2020

 Type or print name_Howie Lucas
 E-mail address: howie.lucas@chevron.com
 PHONE: (832)-588-4044


 For State Use Only
 How for the second second

CURRENT

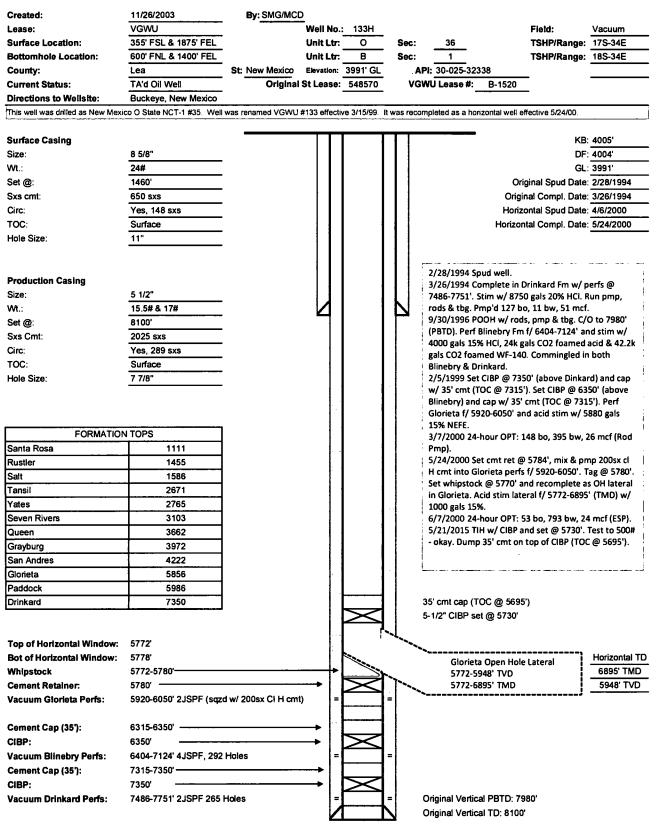

Remarks:

Proposed WELLBORE DIAGRAM

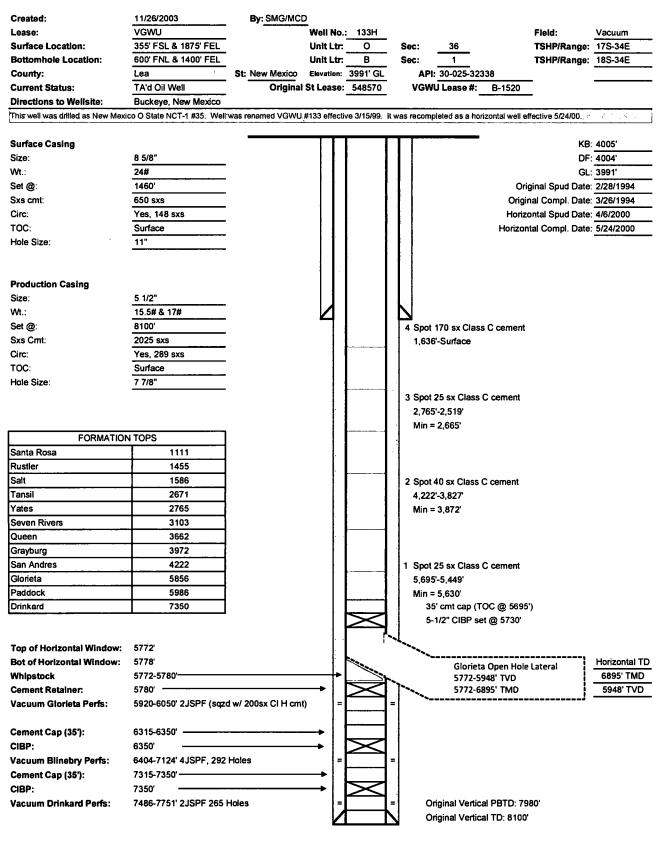

Remarks:

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify **NMOCD District Office I** (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.

2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.

3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.

4. Filing a subsequent C-103 will serve as notification that the well has been plugged.

5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.

6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.

7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.

8. Produced water will not be used during any part of the plugging operation.

9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.

10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.

11. Class 'C' cement will be used above 7500 feet.

12. Class 'H' cement will be used below 7500 feet.

13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged

14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set

17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.

18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.

20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops

- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.

K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least¹/₄" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION