

MIW ... CORPORATION
BUTON-UP UNIT, WELL NO. 2 continued

10/09/94

11 Days. PD: 4,350'. MW: 9.8. Vis: 29. Drill f/3,836'-3,903'. Survey @ 3,863' - 3°. Drill to 4,027'. Survey @ 3,987' - 2-3/4°. Drill to 4,150'. Survey @ 4,110' - 2°. Drill to 4,275'. Survey @ 4,235' - 2°. Drill to 4,350'. TC: \$227,100

10/10/94

12 Days. PD: 4,890'. MW: 9.8. Vis: 29. Drill f/4,350'-4,400'. WL survey @ 4,360' - 1°. Drill to 4,528'. Plugged jets, chase pipe, jets unplugged. Drill to 4,890'. TC: \$239,950

10/11/94

13 Days. PD: 5,578'. MW: 9.8. Vis: 29. Drill f/4,890'-5,578'. TC: \$257,250

10/12/94

14 Days. PD: 6,074'. MW: 10.0. Vis: 29. Drill f/5,578'-6,074'. TC: \$269,500

10/13/94

15 Days. PD: 6,547'. MW: 10.1. Vis: 29. Drlg f/6,074'-6,547'. TC: \$281,750

10/14/94

16 Days. PD: 6,850'. MW: 10.1. Vis: 29. Drlg f/6,547'-6,850'. TOO. Rig repair. TC: \$289,700

10/15/94

17 Days. PD: 6,993'. MW: 10.2. Vis: 39. Rig repair (installed new brake blocks & changed drlg line). TIH. Drlg 6,850'-6,993'. TC: \$296,900

10/16/94

18 Days. PD: 7,352'. MW: 10.1. Vis: 47. Drlg 6,993'-7,352'. TC: \$308,750

10/17/94

19 Days. PD: 7,737'. MW: 10.2. Vis: 49. Drlg 7,352'-7,567'. Hole heaving. Circ, clean up hole. Drlg 7,567'-7,737'. TC: \$318,750

10/18/94

20 Days. No report. TC: \$318,750

10/19/94

21 Days. PD: 8,105'. MW: 10.1. Vis: 51. Drlg 7,914'-8,105'. TC: \$330,150

10/20/94

22 Days. PD: 8,265'. MW: 10.1. Vis: 54. Drlg f/8,105'-8,265'. TOO. TC: \$335,400

10/21/94

23 Days. PD: 8,395'. MW: 9.8. Vis: 42. TOO. HCR valve inoperative. Removed HCR for repairs. TIH. Circ. Hole trying to pack off. Drlg 8,265'-8,395'. TC: \$339,800

10/22/94

24 Days. PD: 8,656'. MW: 9.7. Vis: 40. Drlg 8,395'-8,656'. TC: \$347,500

RECEIVED

DEC 22 1994

U.S. HOUSE
OFFICE