

to Appropriate District Office
DISTRICT I
 P.O. Box 1980, Hobbs, NM 88240
DISTRICT II
 P.O. Drawer DD, Artesia, NM 88210
DISTRICT III
 1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
 P.O. Box 2088
 Santa Fe, New Mexico 87504-2088

WELL API NO. _____
 5. Indicate Type of Lease
 STATE FEE
 6. State Oil & Gas Lease No. _____

SUNDRY NOTICES AND REPORTS ON WELLS
 (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
 OIL WELL GAS WELL OTHER _____

2. Name of Operator
 Murphy Operating Corporation

3. Address of Operator
 P.O. Drawer 2648, Roswell, New Mexico 88202-2648

4. Well Location
 Unit Letter A : 660 Feet From The North Line and 660 Feet From The East Line
 Section 22 Township 8 South Range 37 East NMPM Roosevelt County

7. Lease Name or Unit Agreement Name
 Hinton

8. Well No.
 1

9. Pool name or Wildcat
 Bluit San Andres Assoc.

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
 4018' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: _____ <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: _____ <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

8 5/8" casing set @ 365', circulated cement to surface.
 5 1/2" casing set at 4930', 250 sxs cement, TOC @ 2944'.
 Perforations : 4753'-4847'.

PROPOSED PLUGGING PROCEDURE:

- MIRU. POOHwith rods, pump, and tubing.
- Set 5 1/2" CIBP @ 4700' to cover perfs. and cap with 35 sxs cement. Load hole with 25#/bb1 mud.
- Set 60 sxs cement plug at 2900'- 2330' to cover top and base of salt.
- Perforate 5 1/2" casing w/4 holes @ 415', Set 30 sxs plug. Leave 100' in 5 1/2".
- WOC 1 hr. Tag plug.
- Spot 10 sxs surface plug.(7) Cut off anchors and install dry hole marker.
- Rehabilitate location per state requirements.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE C. Dale Kelton TITLE Consultant DATE 1-28-92
 TYPE OR PRINT NAME C. Dale Kelton TELEPHONE NO. 623-7210

(This space for State Use)
 ORIGINAL SIGNED BY JERRY SEXTON
 DISTRICT I SUPERVISOR DATE _____
 APPROVED BY _____ DATE _____
 CONDITIONS OF APPROVAL, IF ANY:

FEB 05 '92