

UNITED STATES DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIP
(Other instructions
reverse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	7. UNIT AGREEMENT NAME <i>South Eunice Unit</i>
2. NAME OF OPERATOR <i>Conoco Inc.</i>	8. FARM OR LEASE NAME <i>South Eunice Unit</i>
3. ADDRESS OF OPERATOR <i>P.O. Box 460 - Hobbs, New Mexico 88240</i>	9. WELL NO. <i>25</i>
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface <i>660' FSL & 660' FFL - Unit Letter P</i>	10. FIELD AND POOL, OR WILDCAT <i>7 RVRs / Queen South</i>
14. PERMIT NO. <i>30-025-08999</i>	15. ELEVATIONS (Show whether DP, RT, GR, etc.)
	12. COUNTY OR PARISH <i>Lea</i>
	13. STATE <i>NM</i>

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF	☐	PULL OR ALTER CASING	☐
FRACTURE TREAT	☐	MULTIPLE COMPLETE	☐
SHOOT OR ACIDIZE	☐	ABANDON*	☐
REPAIR WELL	☐	CHANGE PLANS	☐
(Other) <i>Clean Out, Open Adit, Plug & Acidize</i>	☒		

SUBSEQUENT REPORT OF:

WATER SHUT-OFF	☐	REPAIRING WELL	☐
FRACTURE TREATMENT	☐	ALTERING CASING	☐
SHOOTING OR ACIDIZING	☐	ABANDONMENT*	☐
(Other)	☐		

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. MIRR. Kill well w/ 2% KCL TFW w/ 1 gal Adomall/1000 gals if necessary. Tag fill & tally out of hole.
2. Mill out bridge plug & cement to 3800' & POCH.
3. Run csq scraper to 3800' & POCH.
4. Perforate interval 3770'-76' & 3780-93' w/ 4 jsp F for total of 76 shots.
5. Set pki at 3500'.
6. Acidize interval 3614'-3793' at 4-6 BPM w/ maximum surface treating pressure of 1500 psi w/ 120 bbls 15% HCL-FE acid w/ 80 gals Checker-Sol and 600 lbs graded rock salt mixed in 5 bbls gelled 9" brine in 3 equal stages. Flush w/ 120 bbls 2% KCL TFW w/ 1 gal Adomall/1000 gals. Seal well.
7. Release pki at 3500' & POCH.
8. Land SN at 3738'. Run producing equipment & place on production. If you have any questions, please call Jay Vashler at 393-4141.

18. I hereby certify that the foregoing is true and correct

SIGNED *Walter J. Finner*

TITLE *Administrative Supervisor*

DATE *March 4, 1988*

FOR SPACE FOR FEDERAL OR STATE OFFICE USE

APPROVAL OF APPROVAL, IF ANY:

TITLE

DATE *3-18-88*

*See instructions on Reverse Side

Title 18 USC Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

B.M. - Calsbad (6) Arco (2) Amero (2) Phoenix (1) L.P.

RECEIVED

MAR 21 1988

CCU
HOEBS OFFICE