

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO. 30-025-12244
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. B-9519

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE 'APPLICATION FOR PERMIT' (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER INJECTION	7. Lease Name or Unit Agreement Name WEST DOLLARHIDE DRINKARD UNIT
---	---

2. Name of Operator Texaco Exploration and Production Inc.	8. Well No. 14
---	-------------------

3. Address of Operator P.O. Box 730, Hobbs, NM 88241-0730	9. Pool name or Wildcat Dollarhide Tubb-Drinkard
--	---

4. Well Location Unit Letter <u>D</u> : <u>990</u> Feet From The <u>N</u> Line and <u>330</u> Feet From The <u>W</u> Line Section <u>29</u> Township <u>24S</u> Range <u>38E</u> NMPM Lea County
--

10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3201' GL
--

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: TEMPORARILY ABANDON <input checked="" type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- CLEAN 5 1/2" CSG TO 6825'.
- SET CIBP @ 6805'. PREP TO ACIDIZE PERFS 6688'-6770'.
- ENCOUNTER TIGHT SPOTS @ 6370' & 6430'.
- SET PACKER @ 6212'. COULD NOT PRESSURE TUBING/CSG ANNULUS.
- SET PACKER @ 6180'. HELD OK.
- SET CIBP @ 6180'. LOAD 5 1/2" CSG W/INHIBITED WATER.
- TEST 5 1/2" CSG FROM SURFACE TO 6180' 500# 30 MIN-HELD OK. (CHART ATTACHED)
- REQUEST TA STATUS.


I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE L.W. Johnson TITLE Engr. Asst. DATE 5-18-92  
 TYPE OR PRINT NAME L.W. Johnson TELEPHONE NO. (505) 397-0426

(This space for State Use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE MAY 20 1992

This Approval of Temporary Abandonment Expires 4-28-97

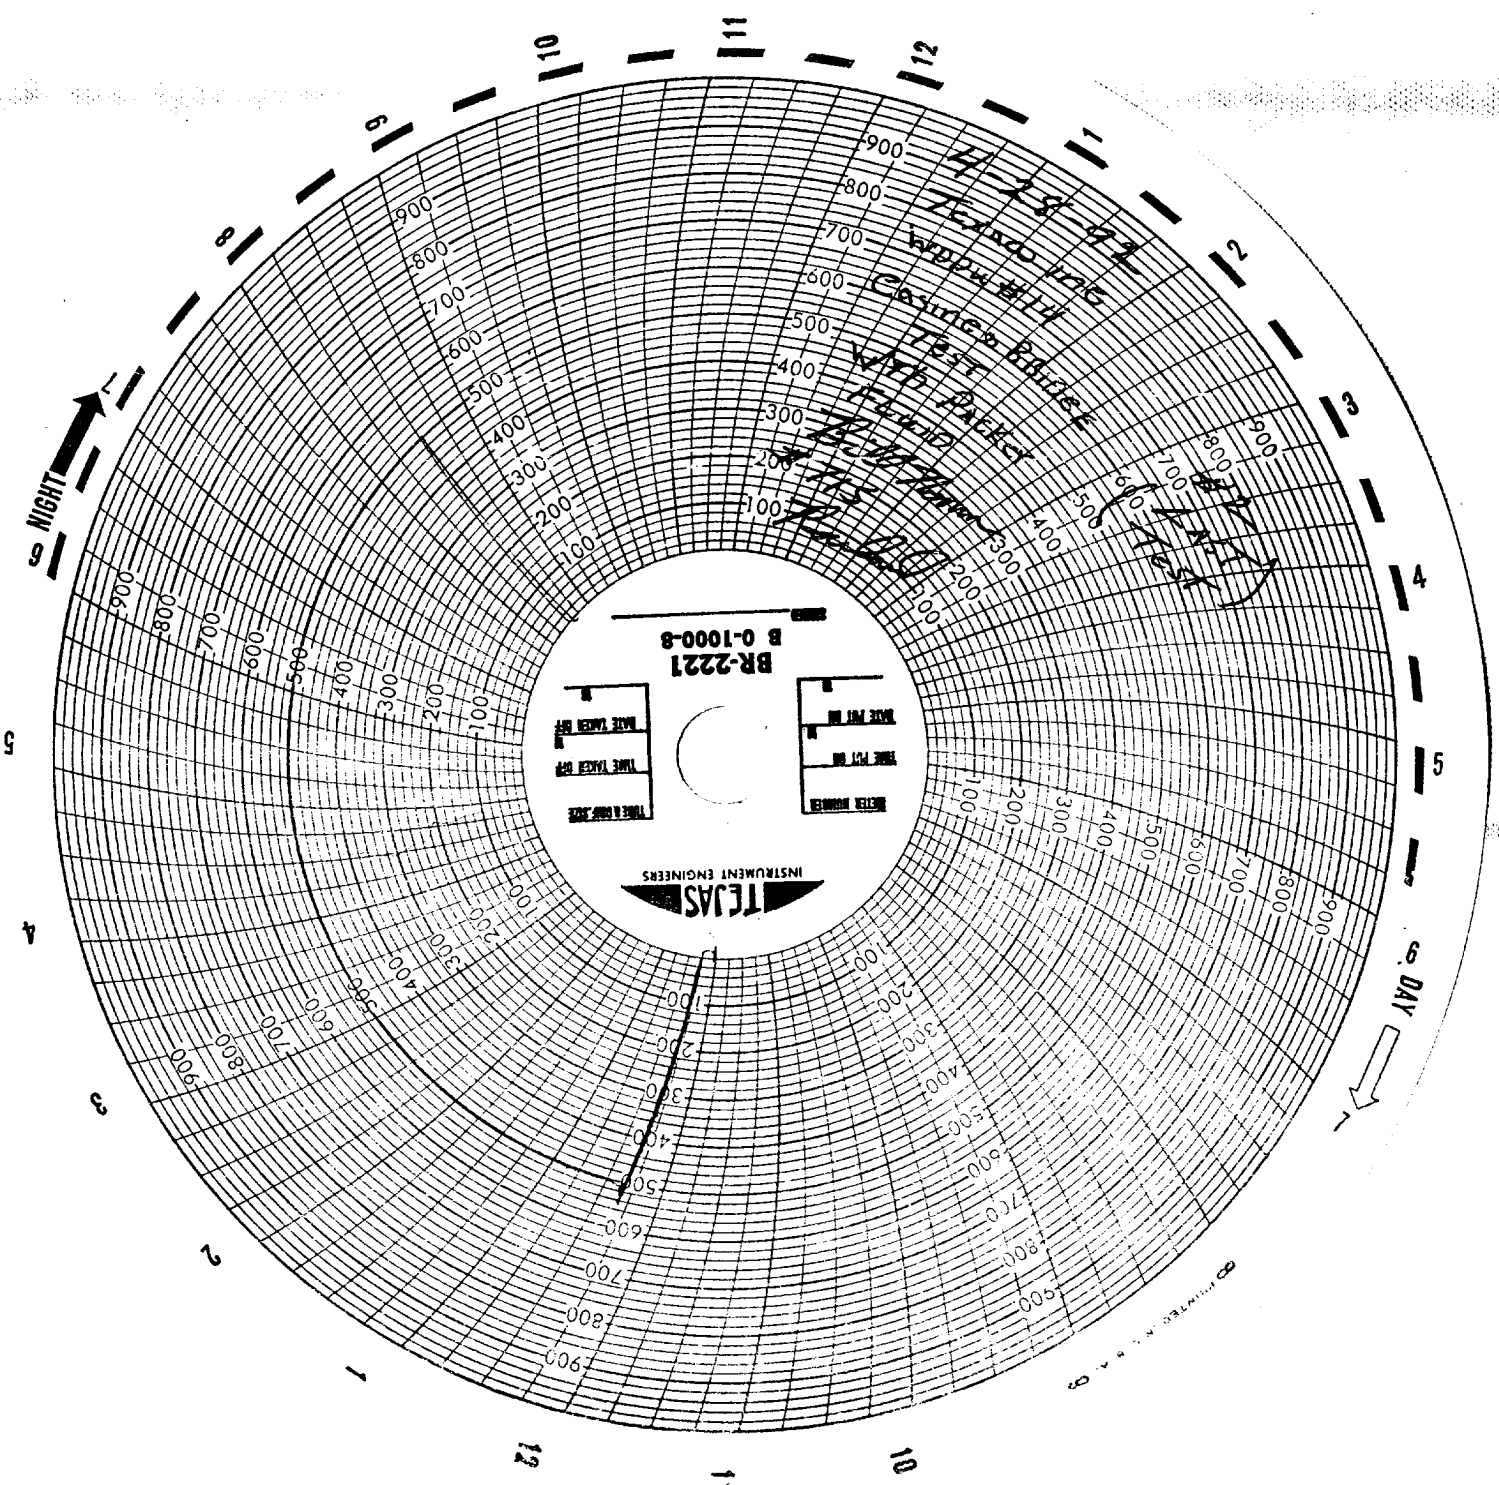

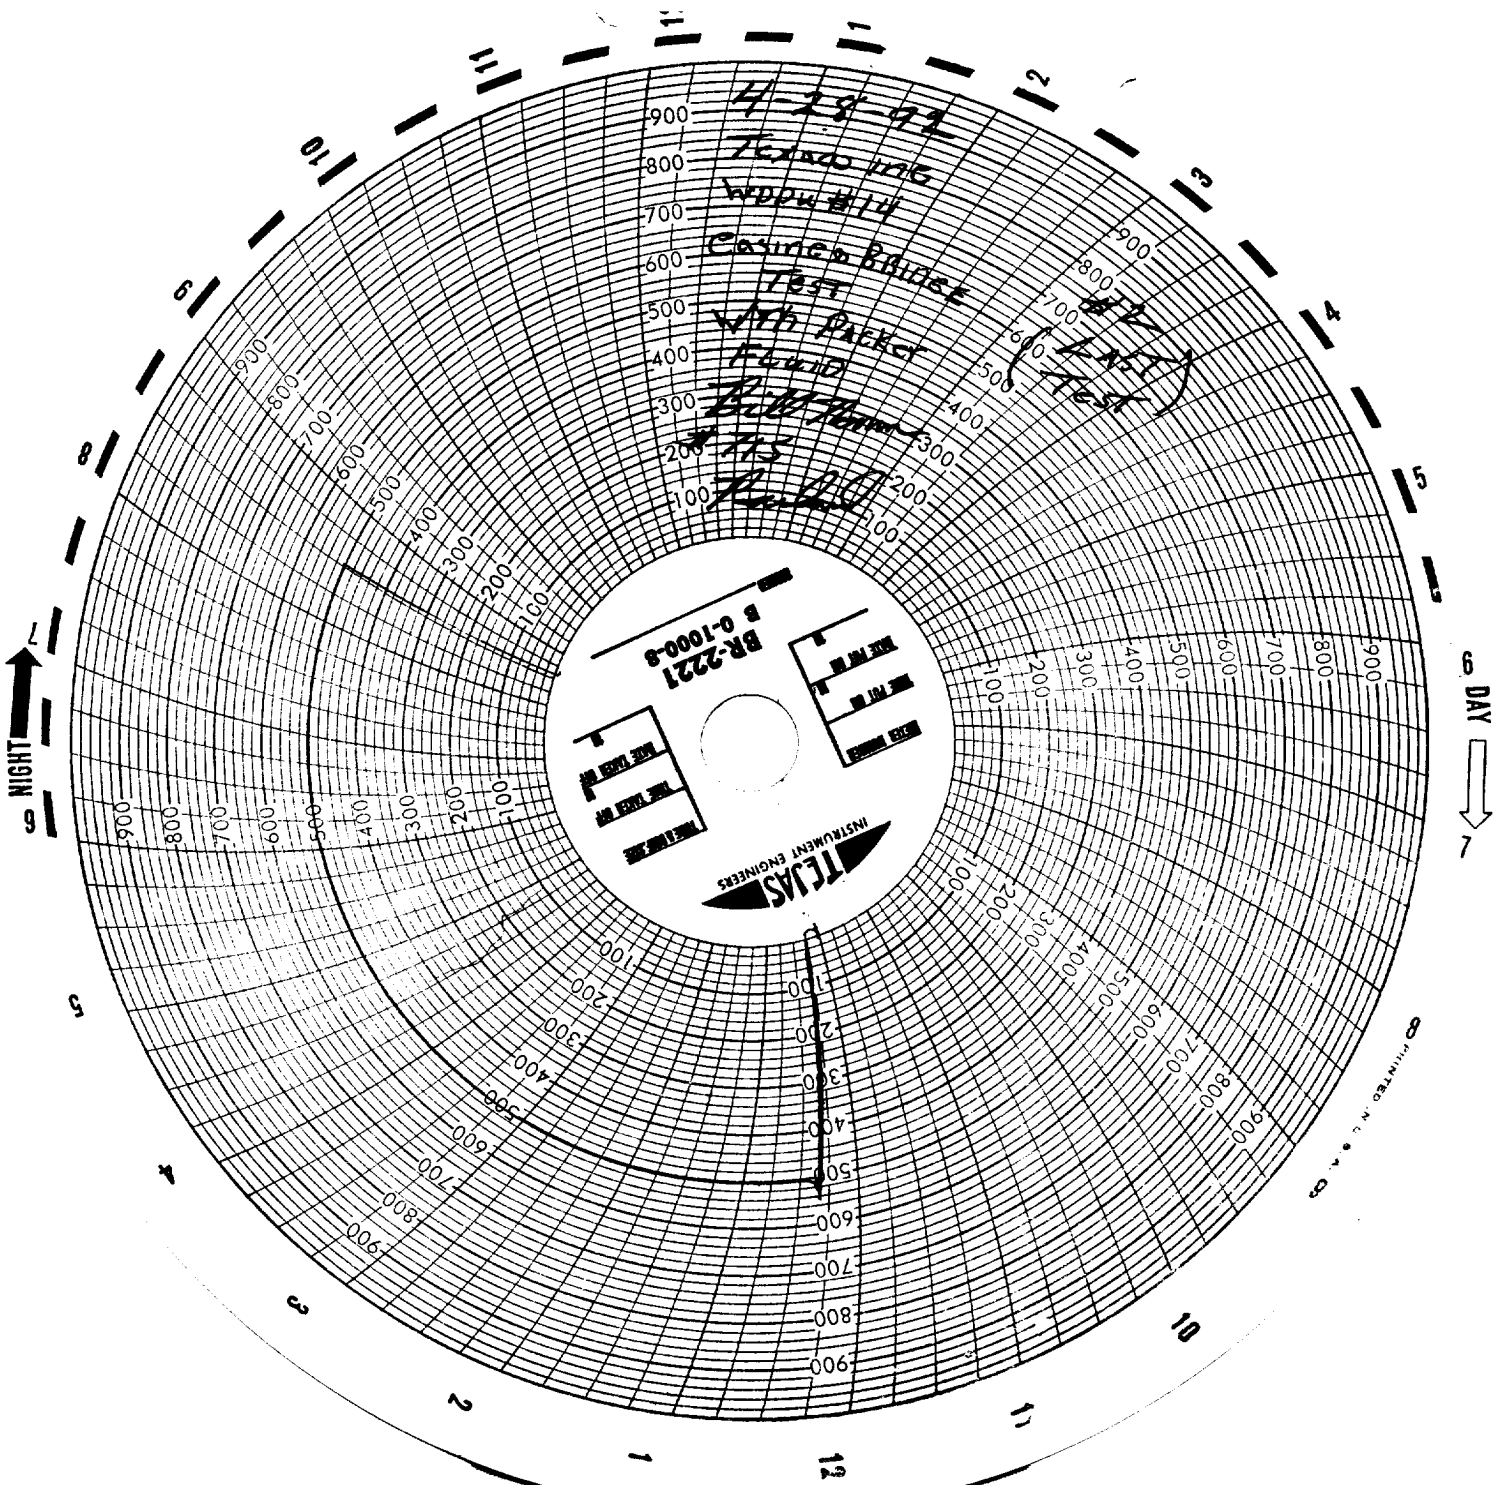

RECEIVED  
MAY 19 1992  
OCD HOBBS OFFICE