

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT  
SUNDRY NOTICES AND REPORTS ON WELLS

SUBMIT IN TRIPLICATE  
(Other instructions on back of form)

Budget Bureau No. 1004-0-10  
Expires August 31, 1985

5. LEASE DESIGNATION AND SERIAL NO.

LC-069052

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL  GAS WELL  OTHER  Water injection well

7. UNIT AGREEMENT NAME  
*West Dollarhide Queen*  
WDQSU *Sand unit*

2. NAME OF OPERATOR  
Sirgo-Collier, Inc.

8. FARM OR LEASE NAME

3. ADDRESS OF OPERATOR  
P. O. Box 3531, Midland, Texas 79702

9. WELL NO.  
23

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface

10. FIELD AND POOL, OR WILDCAT  
Dollarhide Queen

Unit C, 330' FNL 2310' FWL, Sec. 31, T24S, R38E

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
Sec. 31, T24S, R38E

14. PERMIT NO. 15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
3115' KB

12. COUNTY OR PARISH  
Lea  
13. STATE  
NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF   
FRACTURE TREAT   
SHOOT OR ACIDIZE   
REPAIR WELL   
(Other)   
PULL OR ALTER CASING   
MULTIPLE COMPLETE   
ABANDON\*   
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF   
FRACTURE TREATMENT   
SHOOTING OR ACIDIZING   
(Other)   
REPAIRING WELL   
ALTERING CASING   
ABANDONMENT\*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

2-11-88 Move in and rig up Baber Well Servicing Co. Unset packer and pull tubing. Pick up 5-1/2" cement retainer and run to 3600'. Squeeze 25 sx with 5 sx on top of retainer.

2-12-88 Rig up wireline and perforate @ 1200'. Run 5-1/2" cement retainer to 1000' and squeeze with 65 sx, with 5 sx on top of retainer. Rig up wireline and perforate 5-1/2" casing @ 280'. Bullhead squeeze with 70 sx cement between 5-1/2" and 8-5/8" to surface. Cut wellhead. Install P&A marker and rig down.

18. I hereby certify that the foregoing is true and correct

SIGNED Ames L. Whitley TITLE Agent DATE March 1, 1988

(This space for Federal or State office use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

ACCEPTED FOR RECORD

MAR 14 1988

\*See Instructions on Reverse Side

SJS  
CARLSBAD, NEW MEXICO



**RECEIVED**  
**MAR 21 1988**  
**OCD**  
**HOBBS OFFICE**