


AKM MEASUREMENT SERVICES,LLC. Natural Gas Analysis Report
 GPA 2172-09/API 14.5 Report with GPA 2145-16 Physical Properties

	Sample Information
Sample Name	LOST TANK 5 CPF PRODUCTION 1
Technician	ANTHONY DOMINGUEZ
Analyzer Make & Model	INFICON MICRO GC
Last Calibration/Validation Date	05-14-2024
Meter Number	118610
Air temperature	86
Flow Rate (MCF/Day)	18398
Heat Tracing	HEATED HOSE & GASIFIER
Sample description/mtr name	LOST TANK 5 CPF PRODUCTION 1
Sampling Method	FILL & EMPTY
Operator	OCCIDENTAL PETROLEUM, OXY USA INC
State	NEW MEXICO
Region Name	PERMIAN_RESOURCES
Asset	NEW MEXICO
System	GOLD LOG
FLOC	OP-DELNE-BT011
Sample Sub Type	CTB
Sample Name Type	METER
Vendor	AKM MEASUREMENT
Cylinder #	005153
Sampled by	SCOTT
Sample date	5-8-2024
Analyzed date	5-16-2024
Method Name	C9
Injection Date	2024-05-16 09:30:10
Report Date	2024-05-16 09:48:43
EZReporter Configuration File	1-16-2023 OXY GPA C9+ H2S #2.cfgx
Source Data File	e393afe2-09b5-4406-a3d0-061d007a58c6
NGA Phys. Property Data Source	GPA Standard 2145-16 (FPS)
Data Source	INFICON Fusion Connector

Component Results

Component Name	Peak Area	Raw Amount	Response Factor	Norm Mole%	Gross HV (Dry) (BTU / Ideal cu.ft.)	Relative Gas Density (Dry)	GPM (Dry) (Gal. / 1000 cu.ft.)
Nitrogen	31553.6	1.8134	0.00005747	1.8077	0.0	0.01748	0.200
Methane	946787.9	68.7129	0.00007257	68.4947	693.4	0.37939	11.668
CO2	3918.6	0.1863	0.00004754	0.1857	0.0	0.00282	0.032
Ethane	310560.6	14.3199	0.00004611	14.2745	253.2	0.14820	3.836
H2S	0.0	0.0000	0.00000000	0.0000	0.0	0.00000	0.000
Propane	237031.2	7.7279	0.00003260	7.7034	194.3	0.11728	2.133
iso-butane	90753.1	1.0103	0.00001113	1.0071	32.8	0.02021	0.331
n-Butane	253628.9	2.8085	0.00001107	2.7996	91.5	0.05618	0.887
iso-pentane	85196.1	0.8413	0.00000987	0.8386	33.6	0.02089	0.308
n-Pentane	113493.3	1.0762	0.00000948	1.0728	43.1	0.02672	0.391
hexanes	115435.0	1.1481	0.00000995	1.1445	54.6	0.03405	0.473
heptanes	92413.0	0.5631	0.00000609	0.5613	31.0	0.01942	0.260
octanes	20131.0	0.1083	0.00000538	0.1080	6.8	0.00426	0.056
nonanes+	724.0	0.0021	0.00000291	0.0021	0.1	0.00009	0.001
Total:		100.3183		100.0000	1434.4	0.84701	20.576

Results Summary

Result	Dry	Sat.
Total Un-Normalized Mole%	100.3183	
Pressure Base (psia)	14.730	
Temperature Base (Deg. F)	60.00	
Flowing Temperature (Deg. F)	115.0	

Result	Dry	Sat.	
Flowing Pressure (psia)	95.6		
Gross Heating Value (BTU / Ideal cu.ft.)	1434.4	1409.4	
Gross Heating Value (BTU / Real cu.ft.)	1441.7	1417.3	
Relative Density (G), Real	0.8510	0.8474	

Monitored Parameter Report

Parameter	Value	Lower Limit	Upper Limit	Status	
Total un-normalized amount	100.3183	97.0000	103.0000	Pass	

UPSET FLARING EVENT SPECIFIC JUSTIFICATIONS FORM**Facility:** Lost Tank 5 CPF**Flare Date:** 04/17/2024**Duration of Event:** 2 Hours 5 Minutes**MCF Flared:** 640**Start Time:** 04:21 AM**End Time:** 06:26 AM**Cause:** Emergency Flare > Multiple Compression Equipment Issues > Units # 1& #2**Method of Flared Gas Measurement:** Gas Flare Meter

1. Reason why this event was beyond Operator's control:

This emissions event was caused by the unforeseen, unexpected, sudden, and unavoidable breakdown of equipment or process that was beyond the owner/operator's control and did not stem from activity that could have been foreseen and avoided, and could not have been avoided by good design, operation, and preventative maintenance practices. Oxy engages in respectable and good facility operation practices while also maintaining its continuous facility equipment preventative maintenance program. In this case, there were multiple sudden and unexpected compression equipment malfunctions, within a 24-hour period, at the Lost Tank 5 CGL, which in turn, then prompted high field pressure to occur several times, which then triggered brief intermittent flaring instances to occur at the Lost Tank 5 CPF. Compressor units 1 & 2, without warning, malfunctioned on HIHI second stage discharge, then again on first stage scrubber level and then again on suction control valve issues, which prompted hi suction psi. Monarch compression mechanics were requested to come out and trouble shoot the units and their alarms, which took time to do. Once Monarch mechanics arrived on scene, they were able to bring the gas compression units back online. This event is out of OXY's control yet OXY made every effort to control and minimize emissions as much as possible.

2. Steps Taken to limit duration and magnitude of venting or flaring:

It is OXY's policy to route its stranded gas to a flare during an unforeseen and unavoidable emergency or malfunction, that is beyond Oxy's control to avoid, prevent or foresee, to minimize emissions as much as possible as part of the overall steps taken to limit duration and magnitude of flaring. In this case, there were multiple sudden and unexpected compression equipment malfunctions, within a 24-hour period, at the Lost Tank 5 CGL, which in turn, then prompted high field pressure to occur several times, which then triggered brief intermittent flaring instances to occur at the Lost Tank 5 CPF. Compressor units 1 & 2, without warning, malfunctioned on HIHI second stage discharge, then again on first stage scrubber level and then again on suction control valve issues, which prompted hi suction psi. In each instance of intermittent flaring, Oxy field personnel took immediate action to manually choke back high GOR wells so that field pressure would stay below the flare trigger setpoints of the facility to cease flaring. Monarch compression mechanics were repeatedly requested to come out and trouble shoot the units and their alarms, which took time to do. Once Monarch mechanics arrived on scene, they were able to bring the gas compression units back online. Notwithstanding proper gas compressor design and operation, various forms of mechanical or technical issues can be sudden, reasonably unforeseeable, and unexpected which can cause compressor unit malfunctions to occur without warning or advance notice. Compressor engines are designed to operate in a precise manner and when malfunctions occur, it disrupts the compression unit's operating manner and robs the compression engine of power, thus, causing an automatic shutdown of the unit. This event is out of OXY's control yet OXY made every effort to control and minimize emissions as much as possible.

3. Corrective Actions taken to eliminate the cause and reoccurrence of venting or flaring:

Oxy is limited in the corrective actions available to them to eliminate the cause and potential reoccurrence of compressor malfunctions as notwithstanding compressor engine design and operation, compressors are inherently dynamic and even the smallest alarms, false or true, can be sudden, reasonably unforeseeable and unexpected which can cause compression malfunctions to occur, thereby, triggering the unit's sensors to automatically shut down the unit to avoid catastrophic damage to the internal engine components. Oxy continually strives to maintain and operate all its equipment in a manner consistent with good practices for minimizing emissions and reducing the number of emission events through daily equipment inspections. Oxy has a strong and positive equipment preventative maintenance program in place.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

DEFINITIONS

Action 352678

DEFINITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 352678
	Action Type: [C-129] Venting and/or Flaring (C-129)

DEFINITIONS

For the sake of brevity and completeness, please allow for the following in all groups of questions and for the rest of this application: • this application's operator, hereinafter "this operator"; • venting and/or flaring, hereinafter "vent or flare"; • any notification or report(s) of the C-129 form family, hereinafter "any C-129 forms"; • the statements in (and/or attached to) this, hereinafter "the statements in this"; • and the past tense will be used in lieu of mixed past/present tense questions and statements.
--

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 352678

QUESTIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID:	16696
	Action Number:	352678
	Action Type:	[C-129] Venting and/or Flaring (C-129)

QUESTIONS

Prerequisites Any messages presented in this section, will prevent submission of this application. Please resolve these issues before continuing with the rest of the questions.	
Incident Well	Unavailable.
Incident Facility	[fAPP2410600153] Lost Tank 5 Tankless CPF

Determination of Reporting Requirements Answer all questions that apply. The Reason(s) statements are calculated based on your answers and may provide additional guidance.	
Was this vent or flare caused by an emergency or malfunction	Yes
Did this vent or flare last eight hours or more cumulatively within any 24-hour period from a single event	No
Is this considered a submission for a vent or flare event	Yes, major venting and/or flaring of natural gas.
An operator shall file a form C-141 instead of a form C-129 for a release that, includes liquid during venting and/or flaring that is or may be a major or minor release under 19.15.29.7 NMAC.	
Was there at least 50 MCF of natural gas vented and/or flared during this event	Yes
Did this vent or flare result in the release of ANY liquids (not fully and/or completely flared) that reached (or has a chance of reaching) the ground, a surface, a watercourse, or otherwise, with reasonable probability, endanger public health, the environment or fresh water	No
Was the vent or flare within an incorporated municipal boundary or withing 300 feet from an occupied permanent residence, school, hospital, institution or church in existence	No

Equipment Involved	
Primary Equipment Involved	Other (Specify)
Additional details for Equipment Involved. Please specify	Emergency Flare > Multiple Compression Equipment Issues > Units # 1& #2

Representative Compositional Analysis of Vented or Flared Natural Gas Please provide the mole percent for the percentage questions in this group.	
Methane (CH4) percentage	68
Nitrogen (N2) percentage, if greater than one percent	2
Hydrogen Sulfide (H2S) PPM, rounded up	0
Carbon Dioxide (C02) percentage, if greater than one percent	0
Oxygen (O2) percentage, if greater than one percent	0
If you are venting and/or flaring because of Pipeline Specification, please provide the required specifications for each gas.	
Methane (CH4) percentage quality requirement	Not answered.
Nitrogen (N2) percentage quality requirement	Not answered.
Hydrogen Sufide (H2S) PPM quality requirement	Not answered.
Carbon Dioxide (C02) percentage quality requirement	Not answered.
Oxygen (O2) percentage quality requirement	Not answered.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 352678

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 352678
	Action Type: [C-129] Venting and/or Flaring (C-129)

QUESTIONS

Date(s) and Time(s)	
Date vent or flare was discovered or commenced	04/17/2024
Time vent or flare was discovered or commenced	04:21 AM
Time vent or flare was terminated	06:26 AM
Cumulative hours during this event	2

Measured or Estimated Volume of Vented or Flared Natural Gas	
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Cause: Other Other (Specify) Natural Gas Flared Released: 640 Mcf Recovered: 0 Mcf Lost: 640 Mcf.
Other Released Details	Not answered.
Additional details for Measured or Estimated Volume(s). Please specify	Gas Flare Meter
Is this a gas only submission (i.e. only significant Mcf values reported)	Yes, according to supplied volumes this appears to be a "gas only" report.

Venting or Flaring Resulting from Downstream Activity	
Was this vent or flare a result of downstream activity	No
Was notification of downstream activity received by this operator	Not answered.
Downstream OGRID that should have notified this operator	Not answered.
Date notified of downstream activity requiring this vent or flare	Not answered.
Time notified of downstream activity requiring this vent or flare	Not answered.

Steps and Actions to Prevent Waste	
For this event, this operator could not have reasonably anticipated the current event and it was beyond this operator's control.	True
Please explain reason for why this event was beyond this operator's control	This emissions event was caused by the unforeseen, unexpected, sudden, and unavoidable breakdown of equipment or process that was beyond the owner/operator's control and did not stem from activity that could have been foreseen and avoided, and could not have been avoided by good design, operation, and preventative maintenance practices. Oxy engages in respectable and good facility operation practices while also maintaining its continuous facility equipment preventative maintenance program. In this case, there were multiple sudden and unexpected compression equipment malfunctions, within a 24-hour period, at the Lost Tank 5 CGL, which in turn, then prompted high field pressure to occur several times, which then triggered brief intermittent flaring instances to occur at the Lost Tank 5 CPF. Compressor units 1 & 2, without warning, malfunctioned on H1H1 second stage discharge, then again on first stage scrubber level and then again on suction control valve issues, which prompted hi suction psi. Monarch compression mechanics were requested to come out and trouble shoot the units and their alarms, which took time to do. Once Monarch mechanics arrived on scene, they were able to bring the gas compression units back online. This event is out of OXY's control yet OXY made every effort to control and minimize emissions as much as possible. It is OXY's policy to route its stranded gas to a flare during an unforeseen and unavoidable emergency or malfunction, that is beyond Oxy's control to avoid, prevent or foresee, to minimize emissions as much as possible as part of the overall steps taken to limit duration and magnitude of flaring. In this case, there were multiple sudden and unexpected

Steps taken to limit the duration and magnitude of vent or flare	compression equipment malfunctions, within a 24-hour period, at the Lost Tank 5 CGL, which in turn, then prompted high field pressure to occur several times, which then triggered brief intermittent flaring instances to occur at the Lost Tank 5 CPF. Compressor units 1 & 2, without warning, malfunctioned on HHH second stage discharge, then again on first stage scrubber level and then again on suction control valve issues, which prompted hi suction psi. In each instance of intermittent flaring, Oxy field personnel took immediate action to manually choke back high GOR wells so that field pressure would stay below the flare trigger setpoints of the facility to cease flaring. Monarch compression mechanics were repeatedly requested to come out and trouble shoot the units and their alarms, which took time to do. Once Monarch mechanics arrived on scene, they were able to bring the gas compression units back online. Notwithstanding proper gas compressor design and operation, various forms of mechanical or technical issues can be sudden, reasonably unforeseeable, and unexpected which can cause compressor unit malfunctions to occur without warning or advance notice. Compressor engines are designed to operate in a precise manner and when malfunctions occur, it disrupts the compression unit's operating manner and robs the compression engine of power, thus, causing an automatic shutdown of the unit. This event is out of OXY's control yet OXY made every effort to control and minimize emissions as much as possible.
Corrective actions taken to eliminate the cause and reoccurrence of vent or flare	Oxy is limited in the corrective actions available to them to eliminate the cause and potential reoccurrence of compressor malfunctions as notwithstanding compressor engine design and operation, compressors are inherently dynamic and even the smallest alarms, false or true, can be sudden, reasonably unforeseeable and unexpected which can cause compression malfunctions to occur, thereby, triggering the unit's sensors to automatically shut down the unit to avoid catastrophic damage to the internal engine components. Oxy continually strives to maintain and operate all its equipment in a manner consistent with good practices for minimizing emissions and reducing the number of emission events through daily equipment inspections. Oxy has a strong and positive equipment preventative maintenance program in place.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

ACKNOWLEDGMENTS

Action 352678

ACKNOWLEDGMENTS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID:
	16696
	Action Number:
	352678
Action Type:	
[C-129] Venting and/or Flaring (C-129)	

ACKNOWLEDGMENTS

☒	I acknowledge that I am authorized to submit a <i>Venting and/or Flaring</i> (C-129) report on behalf of this operator and understand that this report can be a complete C-129 submission per 19.15.27.8 and 19.15.28.8 NMAC.
☒	I acknowledge that upon submitting this application, I will be creating a new incident file (assigned to this operator) to track any C-129 forms, pursuant to 19.15.27.7 and 19.15.28.8 NMAC and understand that this submission meets the notification requirements of Paragraph (1) of Subsection G and F respectively.
☒	I hereby certify the statements in this report are true and correct to the best of my knowledge and acknowledge that any false statement may be subject to civil and criminal penalties under the Oil and Gas Act.
☒	I acknowledge that the acceptance of any C-129 forms by the OCD does not relieve this operator of liability should their operations have failed to adequately investigate, report, and remediate contamination that poses a threat to groundwater, surface water, human health, or the environment.
☒	I acknowledge that OCD acceptance of any C-129 forms does not relieve this operator of responsibility for compliance with any other applicable federal, state, or local laws and/or regulations.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 352678

CONDITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 352678
	Action Type: [C-129] Venting and/or Flaring (C-129)

CONDITIONS

Created By	Condition	Condition Date
marialuna2	If the information provided in this report requires an amendment, submit a [C-129] Amend Venting and/or Flaring Incident (C-129A), utilizing your incident number from this event.	6/10/2024