Received by OCD: 12/21/2020 5:13:46 AM

DOWNHOLE COMMINGLE

CLOSED-LOOP SYSTEM

Submit 1 Copy To Appropriate District Office		State of New	w Mexi	со				For	m C-103
<u>District I</u> - (575) 393-6161	Energy	Minerals and	Natura	1 Resources			R		ily 18,2013
1625 N. French Dr., Hobbs, NM 88240	Lifergy,	und und	. I (uturu	i itesources	WELL A				
<u>District II</u> - (575) 748-1283		ONSERVAT		IVISION).015.220	11	
811 S. First St., Artesia, NM 88210	ULC	OIL CONSERVATION DIVISION			5. Indicate Type of Lease				
<u>Disrtict III - (</u> 505) 334-6178 1000 Rio Brazos Rd. Aztec, NM 87410		220 South St.	. Francis	Dr.	ST	ATE	\checkmark	FEI	Ξ
District IV - (505) 476-3460		Sonto Eo. N	M 8750	5	6. State O	il & Ga	s Lease N	0.	
<u>istrict IV - (</u> 505) 476-3460 Santa Fe, NM 87505			BO-3823-0010						
SUNDRY NOTICES AND REPORTS ON WELLS					7. Lease Name or Unit Agreement Name				
					7. Lease f	Name of	r Unit Agr	eement	Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR DEEPEN OR PLUG BACK TO A DIFFERENT RESERVIOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			Empire Abo Unit (309164)						
RESERVIOR. USE ATTEICATION FOR TE	KWIII (POKWIC-101)1	OK SUCHTKUIC	JSALS.)		8. Well N	umber			
1. Type of Well: Oil Well 🔽 Gas	Well Other						#281A		
2. Name of Operator					9. OGRII) Nume	r		
Apache Corporation				873					
3. Address of Operator					10. Pool 1	Name or	r Wildcat		
303 Veterans Airpark Lane, Ste. 3000, Midland, TX 79705				Empire: Abo (22040)					
4. Well Location									
Unit Letter A	: 700	feet from the	Ν	line and	450	feet fro	om t 🛛 🛛	E li	ine
Section 5	Township	18S F	Range	28E	NMPM		Coun	ty	EDDY
	11. Elevation (S	ow whether Dl	R, <i>RKB</i> , <i>R</i>	<i>T</i> , <i>GR</i> , <i>etc</i> .)					
		366	60' GR						
12. Che	ck Appropriate Bo	ox To Indicate	Nature	of Notice, Re	eport, or O	ther Da	ata		
NOTICE OF INT	ENTION TO:	1		SUB	SEQUEN		ORT OF:		
PERFORM REMEDIAL WORK	PLUG AND ABA	NDON 🗔 F	REMEDIA	LWORK		_	ERING CA	SING	
TEMPORARILY ABANDON	CHANGE PLAN	s 🗌 🗌		ICE DRILLING	OPNS.	PAN	ND A		
PULL OR ALTER CASING	MULTIPLE CON	PL 🗌	CASING/0		[]			

OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram or proposed completion or recompletion.

OTHER:

Notify OCD 24 hrs. prior to any work


done

Apache Corporation proposes to P&A the above mentioned well by the attached procedure. A closed loop system will be used for all fluids from this wellbore and disposed of required by OCD Rule 19.15.17.14 NMAC.

SEE CHANGES TO PROCEDURE


 \square

Spud Date:			Rig Release Date:		
****SEE ATTACHED COA's**** MUST BE PLUGGED BY 12/29/2021					
I hereby certify that the information above is true and complete to the best of my knowledge and belief.					
SIGNATURE	Guínn Burks	TITLE	Sr. Reclamation Foreman	DATE	12/20/20
Type or print name	Guinn Burks	E-mail add.	guinn.burks@apachecorp.com	PHONE:	432-556-9143
For State Use Only APPROVED BY:	hft Olmo	TITLE	Staff Manager	DATE	12/29/2020
Conditions of Approval (if	any):		ω σ		

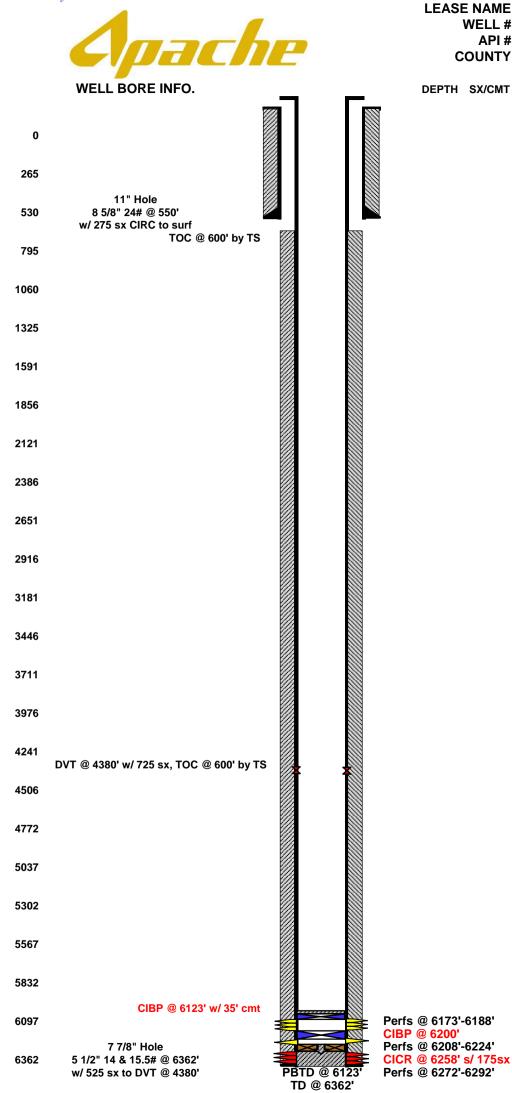


		Page 2 of 6
ASE NAME	Empire Abo Unit	8 9
WELL #	#281A	
API #	30.015.22011	
COUNTY	EDDY, NM	

 DEPTH SX/CMT



11" Hole

8 5/8" 24# @ 550'

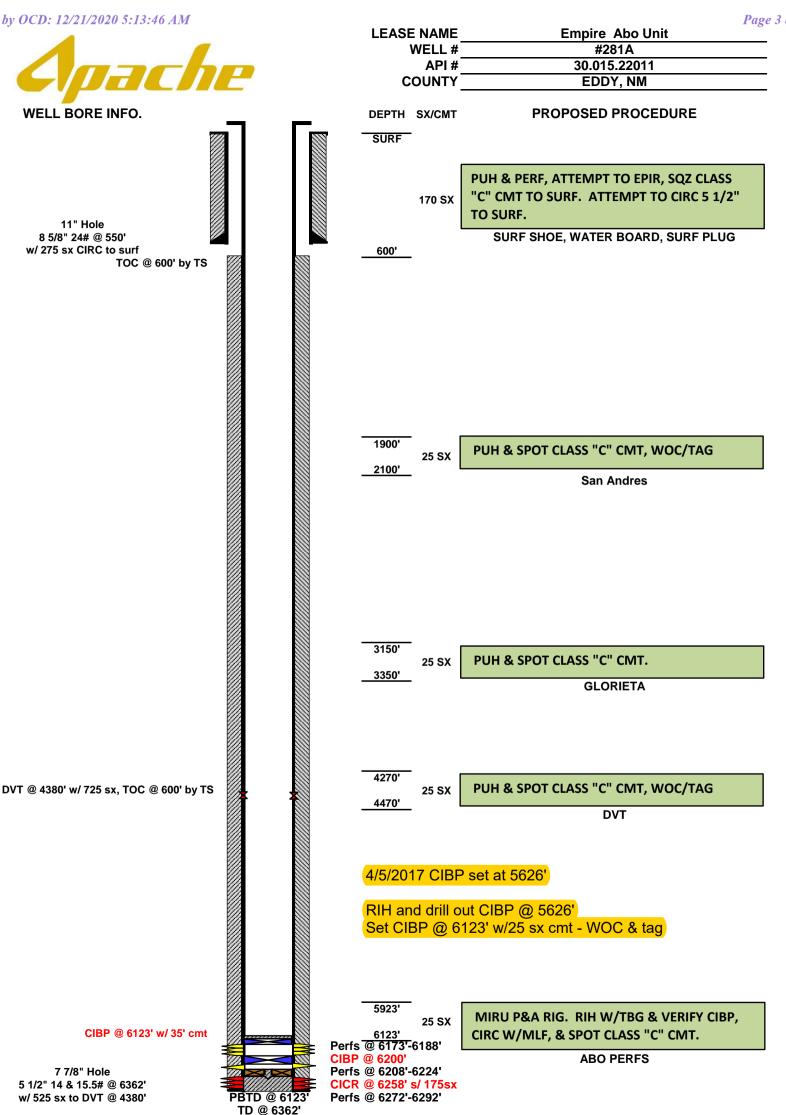

7 7/8" Hole

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name2. Lease and Well Number3. API Number4. Unit Letter5. QuarterSection (feet from the North, South, East or West)6. Section, Township and Range7. Plugging Date8. County(SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

CONDITIONS

Action 12761

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS OF APPROVAL

Operator: APACHE CORPORATION 303 Veter #1000 Midland, TX79705	rans Airpark Ln	OGRID: 873	Action Number: 12761	Action Type: C-103P
OCD Reviewer	Condition			
gcordero	COA's attached to file			