
eceined by Och; Appropriate Tsi14:	State of New Mexico			Form C-103 of 5			
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240				Revised July 18, 2013 WELL API NO.			
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION			30-015-24810			
<u>District III</u> – (505) 334-6178	1220 Sout	h St. Francis	s Dr.	5. Indicate Type of Lease STATE ☐ FEE ✓			
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa F	e, NM 8750)5	6. State Oil & Gas Lease No.			
1220 S. St. Francis Dr., Santa Fe, NM 87505							
SUNDRY NO	7. Lease Name or Unit Agreement Name						
(DO NOT USE THIS FORM FOR PROP DIFFERENT RESERVOIR. USE "APPI	Otis 33						
PROPOSALS.) 1. Type of Well: Oil Well	8. Well Number 2						
2. Name of Operator		9. OGRID Number					
Marathon Oil Permian LLC		372098					
 Address of Operator 5555 San Felipe St., Houston, TX 		10. Pool name or Wildcat East Carlsbad Wolfcamp					
4 Well Location					•		
Unit LetterC	990 :feet from the	N	line and	2130 feet	from theV	V line	
Section 33	Township	22S Range		NMPM	County	Eddy	
	11. Elevation (Show w						
		3136' GR	<u> </u>				
12. Check	Appropriate Box to In	ndicate Natu	re of Notice,	Report or Otl	her Data		
	11 1	1		•			
PERFORM REMEDIAL WORK	NTENTION TO: PLUG AND ABANDON	N 🗹 R	SUB: EMEDIAL WORK		REPORT OF ALTERING (
TEMPORARILY ABANDON	OMMENCE DRII						
TEMPORARILY ABANDON							
DOWNHOLE COMMINGLE	_		Notify (OCD 24 hre ha	fore any work do	one	
CLOSED-LOOP SYSTEM OTHER:	J	ПО	THER:	20D 24 1113 DC	nore arry work de		
13. Describe proposed or con		ly state all pert	inent details, and				
of starting any proposed very proposed completion or re-	work). SEE RULE 19.15.7	'.14 NMAC. I	For Multiple Con	npletions: Atta	ch wellbore diagr	ram of	
1. MIRU, NDWH NU BOP	completion.						
2. LD tbg Set CIBP @ 8958' tag.	Circ well w/ MLF.						
3. Spot 25 sxs from 8958'- 8758' t 4. Perf/Sqz 45 sxs from 5512' – 5							
5. Perf/Sqz 45 sxs from 2125' – 2							
6. Perf/Sqz 45 sxs from 475' – 300' tag. 7. Perf/Sqz 25 sxs from 60' – surface. Verify							
8. Cut off WH & install marker.							
Spud Date: 3/30/19	984 Rig	Release Date:					
****SEE ATTACHED COA's**** MUST BE PLUGGED BY 2/3/2022 I hereby certify that the information above is true and complete to the best of my knowledge and belief.							
Thereby certify that the informatio	if above is true and compre	ne to the best (of my knowledge	and benen.			
SIGNATURE	TIT	LE Regulatory	/ Professional		DATE 1/19/202	1	
Adrian Covarr	ubias		acovarrubias@m	arathonoil.com	713-29	96-3368	
Type or print name E-mail address: PHONE: For State Use Only							
APPROVED BY: Conditions of Approval (if any):	TIT	LE <u> </u>	aff Mana	iger	DATE <u>2/3/2</u>	2021	



Wellbore Schematic Well Name: OTIS 33 2

State/Province NEW MEXICO North/South Distance (ft) UNITED STATES -104.19579770 CARLSBAD SOUTH 32.35337620 990.0 **FNL** API/ IPO LIWI KB-Mud Line Distance (ft) Well First Production Date KB-Ground Distance (ft) Ground Elevation (ft) Drilling Rig Spud Date Well Original Completion Date 5/4/1995 3001524810 18.00 5/4/2012 3,136.00

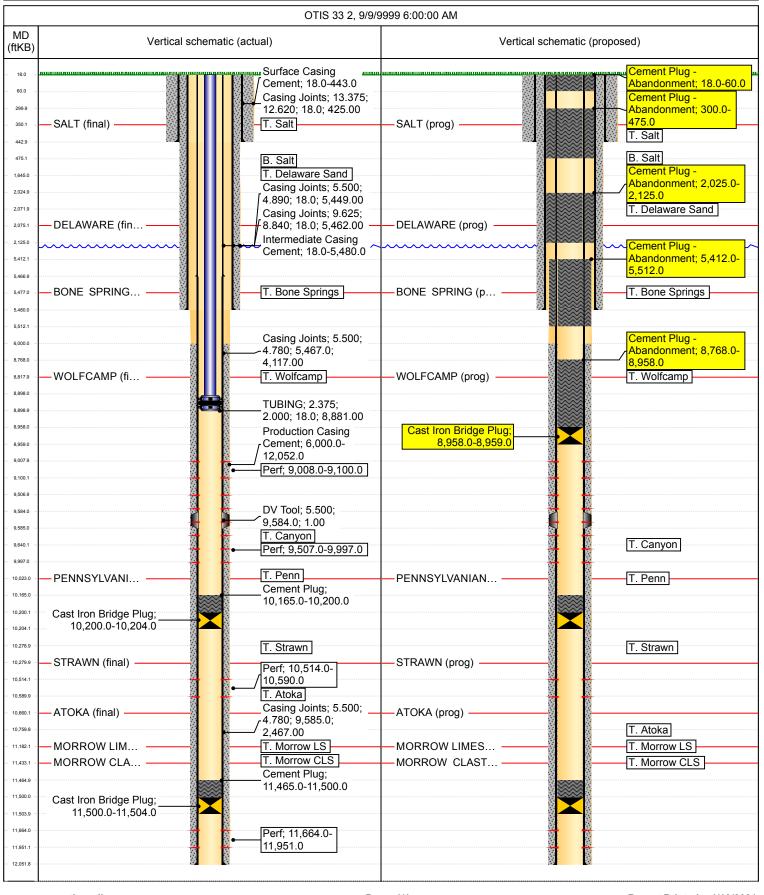

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 14950

CONDITIONS OF APPROVAL

Operator:	OGRID:	Action Number:	Action Type:
MARATHON OIL PERMIAN LLC 5555 San Felipe St.	372098	14950	C-103F
Permian Regulatory Team Houston, TX77056			

OCD Reviewer	Condition
gcordero	None