

Submit a Copy To Appropriate District Office
 District I – (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II – (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III – (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV – (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-29135
1. Type of Well: Oil Well ☐ Gas Well ☒ Other		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator EOG RESOURCES INC		6. State Oil & Gas Lease No.
3. Address of Operator PO BOX 2267 MIDLAND, TX 79702		7. Lease Name or Unit Agreement Name MADERA RIDGE 27 STATE COM
4. Well Location Unit Letter <u>B</u> : <u>660'</u> feet from the <u>NORTH</u> line and <u>1980'</u> feet from the <u>EAST</u> line Section <u>27</u> Township <u>24S</u> Range <u>33E</u> NMPM County <u>LEA</u>		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3522' GR		9. OGRID Number 7377
		10. Pool name or Wildcat JOHNSON RANCH; WOLFCAMP (GAS)

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
CLOSED-LOOP SYSTEM ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

EOG PROPOSES TO PLUG THIS WELL USING THE ATTACHED PROCEDURE.

4" diameter 4' tall Above Ground Marker

SEE ATTACHED CONDITIONS
OF APPROVAL

Spud Date:

02/28/1985

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Kay Maddox TITLE Senior Regulatory Specialist DATE 03/02/2021

Type or print name Kay Maddox E-mail address: kay_maddox@eogresources.com PHONE: 432-638-8475

For State Use Only

APPROVED BY: Kerry Fortner TITLE Compliance Officer A DATE 3/2/21

Conditions of Approval (if any):



Madera Ridge 27 State Com #1 – P&A

SEC 27, T24S, R33E

API # 30-025-29135

1. Notify Regulatory Agency 24 hours prior to commencing work. MIRU well service unit and all necessary safety equipment.
2. ND WH, NU BOP, TOH laying down 2 7/8" production string & seal assembly.
3. Set 4.5" CIBP at 13,180'.
4. Circulate plugging mud and spot 25 sx Class H on top of CIBP.
5. Pick up, spot a 45 sx class H cement plug from 12,380' – 12,150'.
6. Pick up, spot a 35 sx class H cement plug from 9,050' – 8,950'.
7. Pick up, spot a 30 sx class C cement plug from 6,500' – 6,330'.
8. Pick up, perf @ 5,250' and sqz a 105 sx class C cement plug to 4,900'.
9. Pick up, perf @ 1,900' and sqz a 45 sx class C cement plug to 1,750'.
10. Pick up, perf @ 850' and sqz a 30 sx class C cement plug to 750'.
11. Pick up, perf @ 100' and sqz a 30 sx class C cement plug to surface.
12. Cut off WH 3' below surface; verify cement to surface & weld on P&A marker.
13. Cut off anchors 3' below surface and clean location.

Well Name: Madera Ridge 27 State Com #1
 Location: 660' FNL & 1980' FEL Sec. 27-24S-33E
 County: Lea, NM
 Lat/Long: 32.194046, -103.5580444 NAD83
 API #: 30-025-29135
 Spud Date: 2/28/85
 Compl. Date: 5/29/85



Current Wellbore Diagram:

KB:
 GL: 3,522'

17-1/2" Hole
 13-3/8" 54.5 & 61# K55/S80 @ 800'
 Cmt w/ 850 sx (circ)

12-1/4" Hole


9-5/8" 36# K55/S80 @ 5,055'
 Cmt w/ 2,150 sx (circ)

8-3/4" Hole

7" 26# S95/P-110 @ 13,130'
 Cmt w/ 1,625 sx; TOC @ 6,230' (TS)

6-1/8" Hole

4-1/2" Liner 15.1# S90 @ 12,710 - 15,694'
 Cmt w/ 400 sx

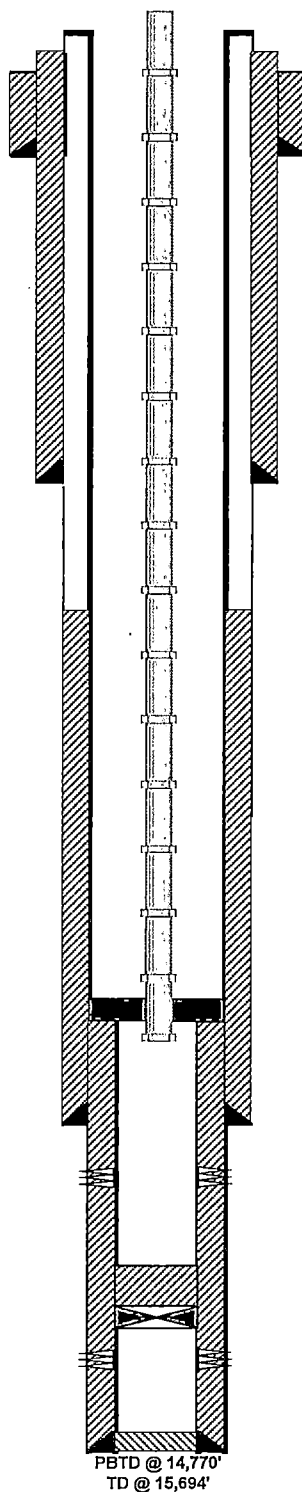

Formation Tops

I of Salt	1,800
B of Salt	4,950
Delaware	5,200
Bone Spring	9,000
Wolfcamp	12,330
Strawn	13,870
Atoka	14,312
Morrow	14,980

2-7/8" 6.5# N-80 DSS TBG w/ seal assembly
 NOTE: There has been a lot of problems with
 wireline tools hanging up in TBG

Wolfcamp perms: 13,266 - 13,532'

CIBP @ 14,800' w/ 30' CMT

Atoka perms: 14,878 - 14,896'

Not to Scale

By: HJG 2/19/21

Well Name: Madera Ridge 27 State Corn #1
 Location: 660' FNL & 1980' FEL Sec. 27-24S-33E
 County: Lea, NM
 Lat/Long: 32.194046, -103.5580444 NAD83
 API #: 30-025-29135
 Spud Date: 2/28/85
 Compl. Date: 5/29/85



Proposed Wellbore Diagram:


KB:
 GL: 3,522'

17-1/2" Hole
 13-3/8" 54.5 & 61# K55/S80 @ 800'
 Cmt w/ 850 sx (circ)
 12-1/4" Hole

9-5/8" 36# K55/S80 @ 5,055'
 Cmt w/ 2,150 sx (circ)
 8-3/4" Hole

7" 26# S95/P-110 @ 13,130'
 Cmt w/ 1,625 sx; TOC @ 6,230' (TS)
 6-1/8" Hole

4-1/2" Liner 15.1# S90 @ 12,710 - 15,694'
 Cmt w/ 400 sx

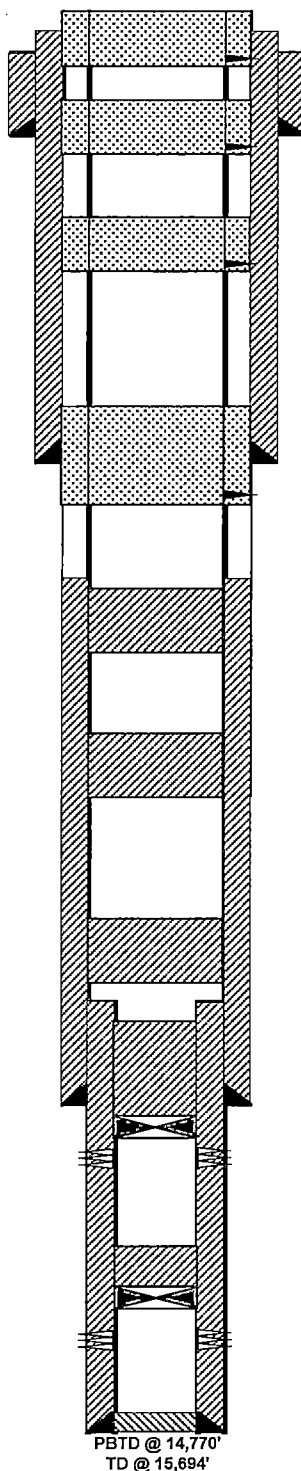

Perf @ 100' & sqz 30 sx to surf

Perf @ 850' & sqz 30 sx
class C cmt to 750'

Perf @ 1,900' & sqz 45 sx class C cmt to 1,750'

Perf @ 5,250' & sqz 105 sx class C cmt to 4,900'
WOC & Tag

Spot 30 sx class C cmt plug @ 6,500 - 6,330'

Spot 35 sx class H cmt plug @ 9,050 - 8,950'

Spot 45 sx class H cmt plug @ 12,380 - 12,150'

Set CIBP w/ 25 sx class H cmt @ 13,180'

Wolfcamp perms: 13,266 - 13,532'

CIBP @ 14,800' w/ 30' CMT

Atoka perms: 14,878 - 14,896'

Formation Tops

I of Salt	1,800
B of Salt	4,950
Delaware	5,200
Bone Spring	9,000
Wolfcamp	12,330
Strawn	13,870
Atoka	14,312
Morrow	14,980

Not to Scale

By: HJG 2/19/21

**CONDITIONS OF APPROVAL
FOR PLUGGING AND ABANDONMENT
OCD - Southern District**

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at **(575)-263-6633** at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water will not be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least 1/4" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name
2. Lease and Well Number
3. API Number
4. Unit letter
5. Quarter Section (feet from the North, South, East or West)
6. Section, Township and Range
7. Plugging Date
8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION



Madera Ridge 27 State Com #1 – P&A

SEC 27, T24S, R33E

API # 30-025-29135

1. Notify Regulatory Agency 24 hours prior to commencing work. MIRU well service unit and all necessary safety equipment.
2. ND WH, NU BOP, TOH laying down 2 7/8" production string & seal assembly.
3. Set 4.5" CIBP at 13,180'.
4. Circulate plugging mud and spot 25 sx Class H on top of CIBP.
5. Pick up, spot a 45 sx class H cement plug from 12,380' – 12,150'.
6. Pick up, spot a 35 sx class H cement plug from 9,050' – 8,950'.
7. Pick up, spot a 30 sx class C cement plug from 6,500' – 6,330'.
8. Pick up, perf @ 5,250' and sqz a 105 sx class C cement plug to 4,900'.
9. Pick up, perf @ 1,900' and sqz a 45 sx class C cement plug to 1,750'.
10. Pick up, perf @ 850' and sqz a 30 sx class C cement plug to 750'.
11. Pick up, perf @ 100' and sqz a 30 sx class C cement plug to surface.
12. Cut off WH 3' below surface; verify cement to surface & weld on P&A marker.
13. Cut off anchors 3' below surface and clean location.

Well Name: Madera Ridge 27 State Com #1
 Location: 660' FNL & 1980' FEL Sec. 27-24S-33E
 County: Lea, NM
 Lat/Long: 32.194046, -103.5580444 NAD83
 API #: 30-025-29135
 Spud Date: 2/28/85
 Compl. Date: 5/29/85



Current Wellbore Diagram:

KB:
 GL: 3,522'

17-1/2" Hole
 13-3/8" 54.5 & 61# K55/S80 @ 800'
 Cmt w/ 850 sx (circ)

12-1/4" Hole


9-5/8" 36# K55/S80 @ 5,055'
 Cmt w/ 2,150 sx (circ)

8-3/4" Hole

7" 26# S95/P-110 @ 13,130'
 Cmt w/ 1,625 sx; TOC @ 6,230' (TS)

6-1/8" Hole

4-1/2" Liner 15.1# S90 @ 12,710 - 15,694'
 Cmt w/ 400 sx

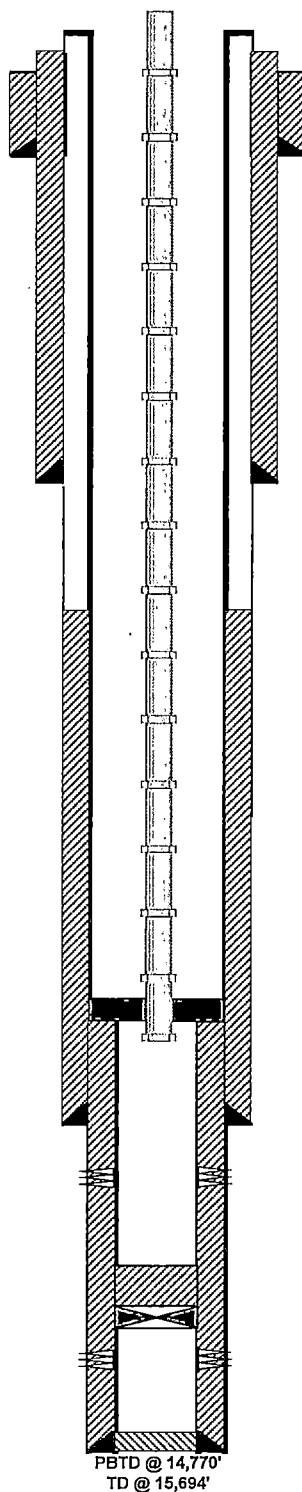

Formation Tops

I of Salt	1,800
B of Salt	4,950
Delaware	5,200
Bone Spring	9,000
Wolfcamp	12,330
Strawn	13,870
Atoka	14,312
Morrow	14,980

2-7/8" 6.5# N-80 DSS TBG w/ seal assembly
 NOTE: There has been a lot of problems with
 wireline tools hanging up in TBG

Wolfcamp perms: 13,266 - 13,532'

CIBP @ 14,800' w/ 30' CMT

Atoka perms: 14,878 - 14,896'

PBTD @ 14,770'
 TD @ 15,694'

Not to Scale
 By: HJG 2/19/21

Well Name: Madera Ridge 27 State Corn #1
 Location: 660' FNL & 1980' FEL Sec. 27-24S-33E
 County: Lea, NM
 Lat/Long: 32.194046, -103.5580444 NAD83
 API #: 30-025-29135
 Spud Date: 2/28/85
 Compl. Date: 5/29/85



Proposed Wellbore Diagram:


KB:
GL: 3,522'

17-1/2" Hole
 13-3/8" 54.5 & 61# K55/S80 @ 800'
 Cmt w/ 850 sx (circ)
 12-1/4" Hole

9-5/8" 36# K55/S80 @ 5,055'
 Cmt w/ 2,150 sx (circ)
 8-3/4" Hole

7" 26# S95/P-110 @ 13,130'
 Cmt w/ 1,625 sx; TOC @ 6,230' (TS)
 6-1/8" Hole

4-1/2" Liner 15.1# S90 @ 12,710 - 15,694'
 Cmt w/ 400 sx

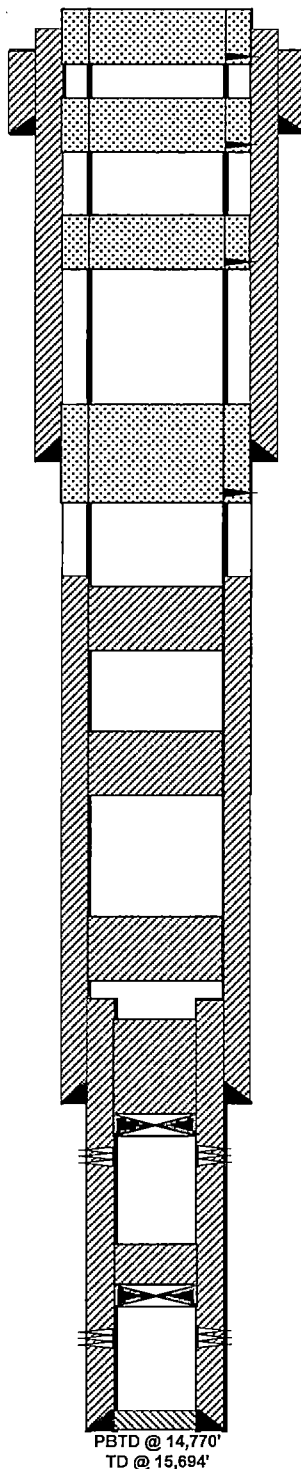

Perf @ 100' & sqz 30 sx to surf

Perf @ 850' & sqz 30 sx
class C cmt to 750'

Perf @ 1,900' & sqz 45 sx class C cmt to 1,750'

Perf @ 5,250' & sqz 105 sx class C cmt to 4,900'
WOC & Tag

Spot 30 sx class C cmt plug @ 6,500 - 6,330'

Spot 35 sx class H cmt plug @ 9,050 - 8,950'

Spot 45 sx class H cmt plug @ 12,380 - 12,150'

Set CIBP w/ 25 sx class H cmt @ 13,180'

Wolfcamp perms: 13,266 - 13,532'

CIBP @ 14,800' w/ 30' CMT

Atoka perms: 14,878 - 14,896'

PBDT @ 14,770'
TD @ 15,694'

Formation Tops

I of Salt	1,800
B of Salt	4,950
Delaware	5,200
Bone Spring	9,000
Wolfcamp	12,330
Strawn	13,870
Atoka	14,312
Morrow	14,980

Not to Scale
By: HJG 2/19/21

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

COMMENTS

Action 19426

COMMENTS

Operator:	EOG RESOURCES INC	P.O. Box 2267	Midland, TX79702	OGRID:	7377	Action Number:	19426	Action Type:	C-103F
Created By	Comment			Comment Date					
plmartinez	DATA ENTRY PM			03/02/2021					

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 19426

CONDITIONS OF APPROVAL

Operator:	EOG RESOURCES INC	P.O. Box 2267	Midland, TX79702	OGRID:	7377	Action Number:	19426	Action Type:	C-103F
OCD Reviewer	Condition								
kfortner	See attached conditions of approval								