

State of New Mexico
Energy, Minerals and Natural ResourcesForm Page 1 of 6
Revised July 18, 2013

Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-015-23033
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name PARKWAY WEST UNIT
8. Well Number 8
9. OGRID Number 6137
10. Pool name or Wildcat UND. PARKWAY WEST (MORROW)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☒ Other

2. Name of Operator
Devon Energy Production Company, LP

3. Address of Operator
333 W. Sheridan Avenue, Oklahoma City, OK 73102

4. Well Location

Unit Letter K: 1980 feet from the South line and 1980 feet from the West line
Section 22 Township 19S Range 29E NMPM Eddy County, NM

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3292' GR

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐
CLOSED-LOOP SYSTEM ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

Notify OCD 24 hrs. prior to any work done

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Reported Perforations - 11240' - 11324'

- MIRU P&A Unit. TOOH tubing string. CIBP @ 11190' - test csg - spot 25 sx cl H cmt. woc & tag
- Set CIBP @ 10910'. Tag. Circ 10# salt gel. Spot 60 sx Cl H from 10910'-10180'. Leak test. (Perfs @ 10960'; T. Morrow @ 10794'; T. Atoka @ 10540'; T. Strawn 10258')
- Perf @ 9125'. Sqz 40 sx Cl H in/out from 9125'-9000'. (T. Wolfcamp @ 9067') WOC & tag
- Spot 30 sx Cl C in/out from 6600'-6225'. WOC & tag. (DV tool @ 6480') WOC & tag
- Perf @ 5145'. Sqz 30 sx Cl C in/out from 5145'-5030'. (T. Bone Spring @ 5090') WOC & tag
- Perf @ 3450'. Sqz 110 sx Cl C in/out from 3450'-3025'. WOC & tag. (T. Delaware @ 3378'; Shoe @ 3096') Perf 3146' - 50' below shoe
- Perf @ 1500'. Sqz 40 sx Cl C in/out from 1500'-1350'. WOC & tag. (B. Salt @ 1420')
- Perf @ 500'. Sqz 130 sx Cl C in/out from 500' to surface. (Shoe @ 365') Perf @ 415' - 50' below shoe
- Cut wellhead off 3' BGL, set dry hole marker.

Spud Date:

****SEE ATTACHED COA's****

Must be plugged by 6/14/2022

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Armon Radfar TITLE Production Engineer DATE 6-1-21

Type or print name Armon Radfar E-mail address: armon.radfar@dv.com PHONE: 405-552-5014

For State Use Only

APPROVED BY: Staff Manager TITLE Staff Manager DATE 6/14/2021

Conditions of Approval (if any):

[Type here]

DEVON ENERGY PRODUCTION COMPANY LP			
Well Name: PARKWAY WEST UNIT 8		Field: UNDESIGNATED PARKWAY WEST	
Location: 1980' FSL & 1980' FWL; SEC 22-T19S-R29E		County: EDDY	State: NM
Elevation: 3292' GL		Spud Date: 11/11/79	Compl Date: 4/21/80
API#: 30-015-23033	Prepared by: Ronnie Slack	Date: 2/16/10	Rev: Armon Radfar 5/31/21

● Current Wellbore

17-1/2" hole
13-3/8", 48#, H40, STC, @ 365'
 Cmt'd w/575 sx + topped out w/4 yds redi mix

12-1/4" hole
8-5/8", 24# & 32#, @ 3,096'
 27 jts 1040', 32#, K55
 51 JTS 2032, 24#, K55
 Cmt'd w/1550 sx, circ 200 sx

TOC @ 5930' (CBL) (per sundry)

DV @ 6480'

TOC @ 9764' (CBL) (per sundry)

MORROW
10960'-10966' (add 12/16/99)
11065'-11073' (add 12/16/99)
11199'-11209' (add 12/16/99)
11240'-11244' (1/5/80)
11264'-11272' (1/5/80) reperf 12/99
11298'-11310' (1/5/80) reperf 12/99
11312'-11324' (1/5/80) reperf 12/99
11472'-11476' 12/16/99

1/5/80: acidized 11298-11324 w/6500 gals 7.5%
 1/5/80: acidized 11240-11324 w/3750 gals 7.5%
 1/24/00: frac 10960-11476 w/48K# 20/40, 1K gal 7.5% HCl

7-7/8" Hole
4-1/2", 11.6# & 13.5#, @ 11,675'
 Cmt'd w/1200 sx
 287 jts total
 1920' of 4-1/2", 13.5#, N80, LTC (49 jts)
 7551', 4-1/2", 11.6#, N80, LTC (186 jts)
 2205', 4-1/2", 11.6#, N80, BTC (52 jts)

work notes:

12/10/99: pooh w/356 jts 2-3/8 tbg & baker seal assembly
 12/15/99: milled & pushed db pkr to 11550

12/16/99: PERF 11472-11476; PERF 11298-11310; 11312-11324; 11264-11272; 11199-11209; 11065-11073; 10960-10966.
 1/24/00: FRAC MORROW PERF W/48K# 20/40, 1000 GALS 7.5% HCL.
 2/9/00: SET AROWSET PKR 10860
 2/10/00: RAN 2-3/8" TBG
 12/1/00: TOH W/PKR, TIH W/2-3/8 W/SN. DEPTH NOT REPORTED.
 7/1/03: OPER CHANGE FROM OCEAN TO DEVON
 1/6/04: RAN BROACH TO SN
 5/15/08: SWAB, TTS.
 2/12/10: SWAB DRY, RDMO.

DB packer milled & pushed to 11550'. (12/15/99)

11635' PBTD

11,675' TD

DEVON ENERGY PRODUCTION COMPANY LP			
Well Name: PARKWAY WEST UNIT 8		Field: UNDESIGNATED PARKWAY WEST	
Location: 1980' FSL & 1980' FWL; SEC 22-T19S-R29E		County: EDDY	State: NM
Elevation: 3292' GL		Spud Date: 11/11/79	Compl Date: 4/21/80
API#: 30-015-23033	Prepared by: Armon Radfar	Date: 5/31/21	Rev:

● Proposed Wellbore

17-1/2" hole
13-3/8", 48#, H40, STC, @ 365'
 Cmt'd w/575 sx + topped out w/4 yds redi mix

12-1/4" hole
8-5/8", 24# & 32#, @ 3,096'
 27 jts 1040', 32#, K55
 51 JTS 2032, 24#, K55
 Cmt'd w/1550 sx, circ 200 sx

TOC @ 5930' (CBL) (per sundry)

DV @ 6480'

TOC @ 9764' (CBL) (per sundry)

MORROW
10960'-10966' (add 12/16/99)
11065'-11073' (add 12/16/99)
11199'-11209' (add 12/16/99)
11240'-11244' (1/5/80)
11264'-11272' (1/5/80) reperf 12/99
11298'-11310' (1/5/80) reperf 12/99
11312'-11324' (1/5/80) reperf 12/99
11472'-11476' 12/16/99
 1/5/80: acidized 11298-11324 w/6500 gals 7.5%
 1/5/80: acidized 11240-11324 w/3750 gals 7.5%
 1/24/00: frac 10960-11476 w/48K# 20/40, 1K gal 7.5% HCl

7-7/8" Hole
4-1/2", 11.6# & 13.5#, @ 11,675'
 Cmt'd w/1200 sx
 287 jts total
 1920' of 4-1/2", 13.5#, N80, LTC (49 jts)
 7551', 4-1/2", 11.6#, N80, LTC (186 jts)
 2205', 4-1/2", 11.6#, N80, BTC (52 jts)

Proposed:
 1. Perf @ 500'.
 2. Sqz 130 sx Cl C in/out from 500' to surface.
 3. Cut WH off 3' BGL, set dry hole marker.
 (Shoe @ 365')

Proposed:
 1. Perf @ 1500'.
 2. Sqz 40 sx Cl C in/out from 1500'-1350'. WOC & tag.
 (B. Salt @ 1420')

Proposed:
 1. Perf @ 3450'.
 2. Sqz 110 sx Cl C in/out from 3450'-3025'. WOC & tag.
 (T. Delaware @ 3378'; Shoe @ 3096')

Proposed:
 1. Perf @ 5145'.
 2. Sqz 30 sx Cl C in/out from 5145'-5030'.
 (T. Bone Spring @ 5090')

Proposed:
 Spot 30 sx Cl C in/out from 6600'-6225'. WOC & tag.
 (DV tool @ 6480')

Proposed:
 1. Perf @ 9125'.
 2. Sqz 40 sx Cl H in/out from 9125'-9000'.
 (T. Wolfcamp @ 9067')

Proposed:
 1. Set CIBP @ 10910'. Tag. Circ 10# salt gel.
 2. Spot 60 sx Cl H from 10910'-10180'. Leak test.
 (Perfs @ 10960'; T. Morrow @ 10794'; T. Atoka @ 10540'; T. Strawn 10258')

DB packer milled & pushed to 11550'. (12/15/99)

11635' PBTD

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, **Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.**

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water **will not** be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) **Potash---** (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIREMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3. API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)-----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 30431

CONDITIONS

Operator: DEVON ENERGY PRODUCTION COMPANY, LP 333 West Sheridan Ave. Oklahoma City, OK 73102	OGRID: 6137
	Action Number: 30431
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	6/14/2021