State of New Mexico Form			Form C-103			
Office <u>District I</u> – (575) 393-6161	Energy, Minerals and Natural Resources			Revised July 18, 2013		
1625 N. French Dr., Hobbs, NM 88240		WELL API NO.				
District II – (575) 748-1283			30-015-28777			
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178			5. Indicate Type of Le			
1000 Rio Brazos Rd., Aztec, NM 87410	District III – (505) 334-6178 1220 South St. Francis Dr. 1000 Rio Brazos Rd., Aztec, NM 87410		STATE	FEE 🛚		
<u>District IV</u> – (505) 476-3460	Santa Fe, NM 87	/505	6. State Oil & Gas Lea	ase No.		
1220 S. St. Francis Dr., Santa Fe, NM 87505						
	AND REPORTS ON WELLS		7. Lease Name or Unit	t Agreement Name		
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			Mojave AJY Com	78		
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			8. Well Number			
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other			4			
 Type of Well: Oil Well ☐ Gas Well ☒ Other Name of Operator 			9. OGRID Number			
EOG Resources, Inc.			7377			
3. Address of Operator			10. Pool name or Wildcat			
104 South Fourth Street, Artesia, NM 88210			Dagger Draw; Upper P			
4. Well Location						
Unit Letter M : 660	feet from the South	line and	660 feet from the	West line		
Section 35	Township 20.5S Ra		NMPM Eddy	County		
	Elevation (Show whether DR)		2	County		
	3700					
	2,00					
12 Check App	ropriate Box to Indicate N	ature of Notice	Report or Other Date	a		
12. Check App.	Topriate Box to maleate in	ature of Notice,	Report of Other Date	u		
NOTICE OF INTE	NTION TO:	SUB	SEQUENT REPOR	RT OF:		
PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ REMEDIAL WOR				ERING CASING		
TEMPORARILY ABANDON C			LLING OPNS.□ P AN	ND A		
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ CASING/CEMENT JOB ☐						
DOWNHOLE COMMINGLE						
CLOSED-LOOP SYSTEM			Notify OCD 24 hrs. prior	to any work		
OTHER:		OTHER:	done			
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date						
of starting any proposed work).		C. For Multiple Cor	npletions: Attach wellbo	ore diagram of		
proposed completion or recomp						
EOG Resources, Inc. plans to plug and aba	ndon this well as follows:					
1 147514 11 6	AMARON POOM SILVER					
1. MIRU all safety equipment as needed						
 Spot a 29 sx Class "C" cement plug f Spot a 27 sx Class "C" cement plug f 			a a			
 Spot a 27 sx Class "C" cement plug from 6021'-5861'. This will cover DV tool. WOC & tag Spot a 26 sx Class "C" cement plug from 5773'-5617'. This will cover Wolfcamp top. 						
5. Spot a 25 sx Class "C" cement plug fr	om 3375'-3221'. This will cover I	Bone Spring top.				
6. Spot a 25 sx Class "C" cement plug fr						
7. Perforate at 1127'. Spot a 25 sx Class "C" cement plug from 1127'-973'. This will cover surface casing shoe. Perf @ 1100' - WOC & tag						
 Spot a 25 sx Class "C" cement plug from 564'-410'. This will cover San Andres top. Perforate at 100'. Spot an 17 sx Class "C" cement plug from 100' up to surface. Back fill as needed. 						
10. Cut off wellhead and install dry hole marker. Clean location as per regulated.						
Wellbore schematics attached.						
Spud Date:	Rig Release Da	ate:				
****SEE ATTACHED COA's**** Must be plugged by 6/11/2022						
I hereby certify that the information above						
•		est of my mis wie ag				
signature Tina Huerta	TITLE Re	gulatory Specialist	DATE <u>June 8, 202</u>	<u>21</u>		
Type or print name Tina Huerta	E-mail address: ti	na_huerta@eogreso	urces.com PHONE	: <u>575-748-4168</u>		
For State Use Only						
APPROVED BY:	TITLE	StallMan	ACAA DATE	6/11/2021		
Conditions of Approval (if any):	TITLE	Staff Man	agerDATE_	U/ 1 1/ ∠U ∠ 1		
Conditions of Approval (II ally):						

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing


DRY HOLE MARKER REQUIRMENTS


The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

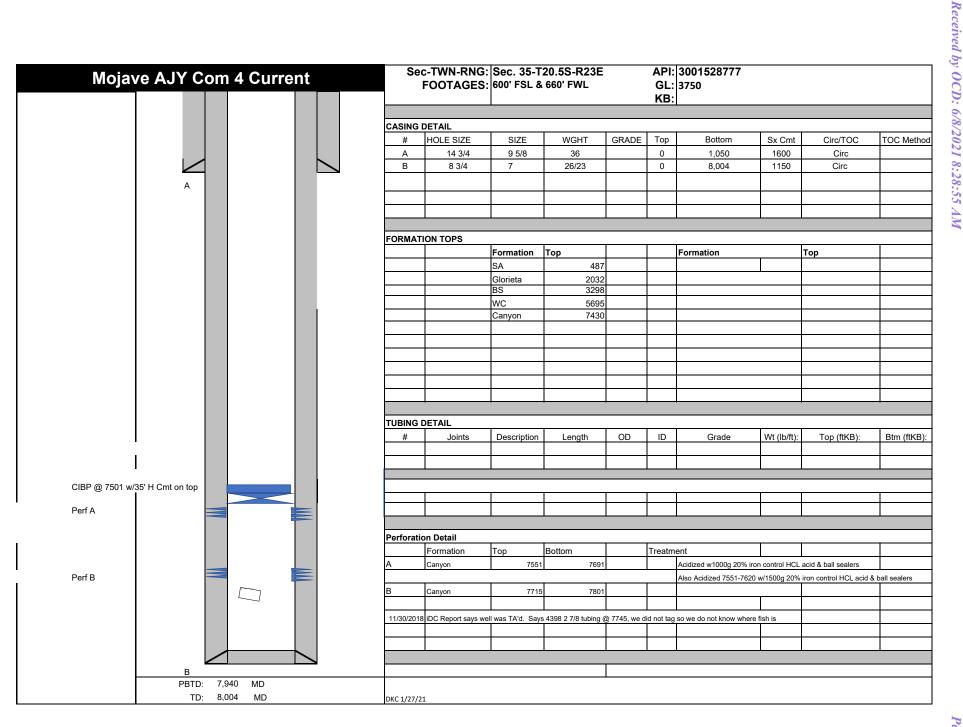

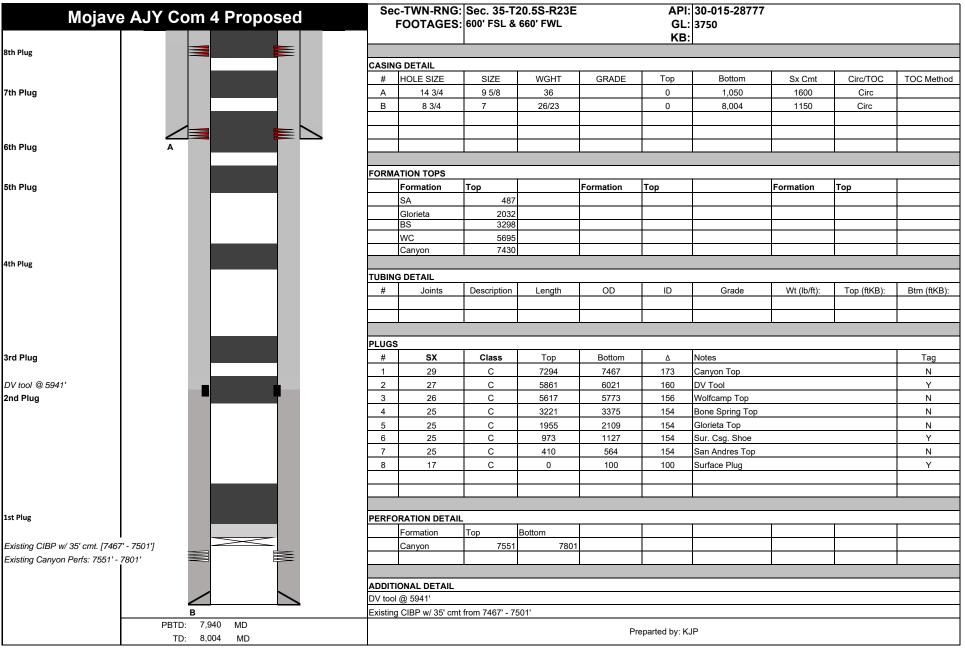

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 30939

CONDITIONS

Operator:	OGRID:
EOG RESOURCES INC	7377
P.O. Box 2267	Action Number:
Midland, TX 79702	30939
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	6/11/2021