
Office State of New		Form C-103				
District I – (575) 393-6161 Energy, Minerals and N	latural Resources	Revised July 18, 2013				
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283		WELL API NO. 30-025-32438				
811 S. First St., Artesia, NM 88210 OIL CONSERVATION		5. Indicate Type of Lease				
District III – (505) 334-6178 1220 South St. F		STATE S FEE				
<u>District IV</u> – (505) 476-3460 Santa Fe, NM	1 87505	6. State Oil & Gas Lease No.				
1220 S. St. Francis Dr., Santa Fe, NM 87505		NM-01521				
SUNDRY NOTICES AND REPORTS ON WEI (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-10	R PLUG BACK TO A	7. Lease Name or Unit Agreement Name Santa Fe				
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Other		8. Well Number				
2. Name of Operator		9. OGRID Number				
Conoco Phillips Company		217817				
3. Address of Operator		10. Pool name or Wildcat				
P.O. Box 2197 Houston TX 77252		Vacuum; Blinbry				
4. Well Location		000 6 6 6 1				
the second secon	outh line and	808feet from theWestline				
Section 31 Township 17S 11. Elevation (Show whether	Range 35E	NMPM County Lea				
	B4' RKB	(3.)				
12. Check Appropriate Box to Indicate	e Nature of Notice	, Report or Other Data				
NOTICE OF INTENTION TO	CUI	DEFOLIENT DEPORT OF				
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒	REMEDIAL WO	BSEQUENT REPORT OF: RK				
TEMPORARILY ABANDON CHANGE PLANS	RILLING OPNS. P AND A					
PULL OR ALTER CASING MULTIPLE COMPL	CASING/CEMEN	and the state of t				
DOWNHOLE COMMINGLE		_				
CLOSED-LOOP SYSTEM						
OTHER:	OTHER:					
13. Describe proposed or completed operations. (Clearly state						
of starting any proposed work). SEE RULE 19.15.7.14 NN proposed completion or recompletion.	AAC. For Multiple Co	ompletions: Attach wellbore diagram of				
proposed completion of recompletion.						
 MIRU. ND WH, NU BOP. POOH Prod Equipment 						
2. Spot 25 sxs cmt @ 6490'-6290'.						
 Spot 25 sxs cmt @ 5997'-5800'. Spot 25 sxs cmt @ 4423'-4223' Tag. 						
5. Spot 40 sxs cmt @ 3989'-3650'.		All diamantan Altall Abaya Chayand Mankan				
5. Spot 40 sxs cmt @ 3989'-3650'. 4" diameter 4' tall Above Ground Marker 6. Spot 60 sxs cmt @ 3153'-2588' Tag.						
P&S. Spot 25 sxs cmt @ 1550'-1430' Tag.						
P&S. Spot 30 sxs cmt @ 250'-3' Verify cmt in all annuli.						
9. Cut off WH & anchors. Install DH marker.	SEE ATTACHED CONDITIONS					
		OF APPROVAL				
Spud Date: Rig Release	Date:					
I hereby certify that the information above is true and complete to th	e hest of my knowled	ge and helief				
Thereby certify that the information above is true and complete to the	ie best of my knowled	ge and bener.				
SIGNATURE TITLE Age						
SIGNATURE TITLE Age	ent_DATE5/2	5/21				
Type or print name _Chris Romero E-mail address: christophe	er.romero@basicene	rgyservices.com PHONE: 432-563-3355				
For State Use Only						
APPROVED BY: Yeary Forther TITLE Co	ampliance Officer A	6/4/194				
APPROVED BY: TITLE Conditions of Approval (if any)	omphance Officel P	DATE 6/14/21				
F/5 01 50 =						

WELLBORE SKETCH ConocoPhillips Company -- Permian Basin Business Unit

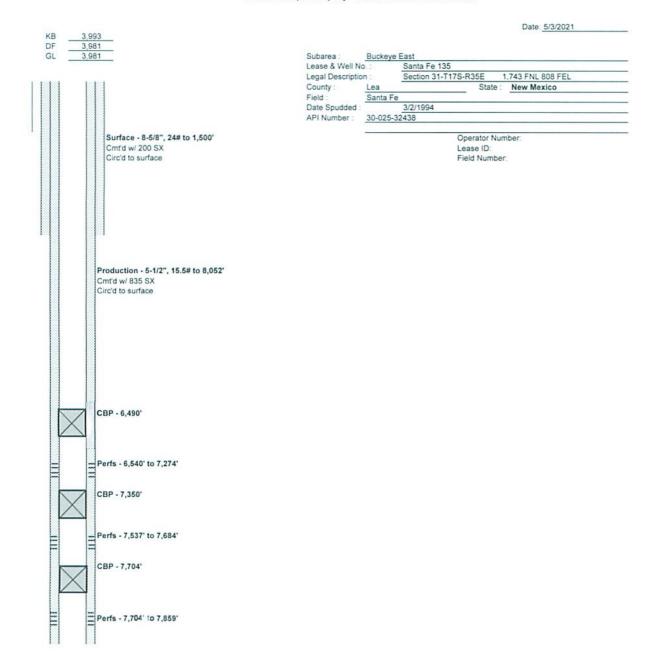

WELLBORE SKETCH ConocoPhillips Company -- Permian Basin Business Unit

NG92										Date:	5/3/2021
DF		981									
GL		981				Subarea:	Buckeye				
						Lease & Well N		Santa Fe 1			
1.1		1.1				Legal Description County:	Lea	Section 31	-T17S-R35E State	1,743 FNL : New Me:	
		Spo	ot 30sx cm	nt @ 250'-3'		Field:	Santa Fe)	State	ivew ivie.	XICO .
						Date Spudded :		3/2/1994			
						API Number :	30-025-3	32438			
		Confe	0 5/0"	24#4- 4 50	01				0		
			w/ 200 SX	, 24# to 1,50	U				Operator N Lease ID:	umber.	
			to surface						Field Numb	per:	
		Spo	ot 25sx cm	nt @ 1550'-14	430' - Tag						
		Spot 6	30sx cmt (@ 3153'-2588	3' - Tag						
		Spot 4	t0sx cmt (@ 3989'-3650	0'						
				", 15.5# to 8,							
		Cmt'd w/									
		Circ'd to	surface								
		Spot 2	25sx cmt (@ 4423'-4223	3' - Tag						
		Spot 2	25sx cmt (@ 5997'-5800	o'						
		Snot '	Sev cmt 6	@ 6490'-6290	n'						
		CBP - 6,		g 0490 -0290							
	X										
		Ž									
-		-Perfs - 6	,540' to 7,	274'							
		CDD 7	2501								
		CBP - 7,	350								
		Perfs - 7									
1		Perfs - 7	,537' to 7,	684'							
F	1 1										
		CBP - 7,	704'								
		Perfs - 7	704' to 7	859'							
100		- 0.10 - 7									

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 30819

CONDITIONS

Operator:	OGRID:
BASIC ENERGY SERVICES, LP	246368
P.O. Box 1375	Action Number:
Artesia, NM 88210	30819
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached conditions of approval Note changes to procedure	6/14/2021