cejued by Och 2/20/2021 4:37:0	State	e of New Mexico	Form C-103 ¹ o
Office <u>District I</u> – (575) 393-6161	Energy, Minerals and Natural Resources		Revised July 18, 2013 WELL API NO.
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONS	ERVATION DIVISION	30-015-21277
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178		outh St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460		ta Fe, NM 87505	STATE X FEE 6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM	S. St. Francis Dr., Santa Fe, NM		K-6600
87505 SUNDRY NO	7. Lease Name or Unit Agreement Name		
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			Nash Unit
			Q W-11 Noveless
1. Type of Well: Oil Well Gas Well Other 2. Name of Operator			9. OGRID Number
2. Name of Operator XTO Energy, Inc.			005380
3. Address of Operator			10. Pool name or Wildcat
64001 Holiday Hill rd BLDG #5, Midland TX 79707			Nash Draw Brushy Canyon
4. Well Location Unit Letter H	: 1980 feet from	the North line and	660 feet from the East line
Section 13			NMPM County Eddy
Section 13		ow whether DR, RKB, RT, GR, et	2 Eddy
	3005 G		
12. Check	Appropriate Box t	to Indicate Nature of Notice	e, Report or Other Data
NOTICE OF I	NTENTION TO:	SU	IBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK		DON 🛭 REMEDIAL WO	DRK ☐ ALTERING CASING ☐
TEMPORARILY ABANDON			PRILLING OPNS. P AND A
PULL OR ALTER CASING DOWNHOLE COMMINGLE		L CASING/CEME	
CLOSED-LOOP SYSTEM			Notify OCD 24 hrs. prior to any work
	_		done
OTHER:		OTHER:	
13. Describe proposed or com		learly state all pertinent details, a	and give pertinent dates, including estimated date
13. Describe proposed or com	work). SEE RULE 19.	learly state all pertinent details, a	and give pertinent dates, including estimated date Completions: Attach wellbore diagram of
13. Describe proposed or come of starting any proposed of proposed completion or re-	work). SEE RULE 19. ecompletion.	learly state all pertinent details, a 15.7.14 NMAC. For Multiple C	
13. Describe proposed or com of starting any proposed v proposed completion or ro XTO Energy, Inc Respectfully submits N	work). SEE RULE 19. ecompletion. OI to PA for the above well	learly state all pertinent details, a 15.7.14 NMAC. For Multiple C	Completions: Attach wellbore diagram of
13. Describe proposed or com of starting any proposed of proposed completion or re XTO Energy, Inc Respectfully submits N 1) POOH laying down rods ar	work). SEE RULE 19. ecompletion. OI to PA for the above well	learly state all pertinent details, a 15.7.14 NMAC. For Multiple C	Completions: Attach wellbore diagram of
13. Describe proposed or come of starting any proposed of proposed of starting any proposed of the proposed completion or research. XTO Energy, Inc Respectfully submits North 1 POOH laying down rods are 2 POOH laying down 2-7/8" PU, RIH 2-3/8" tbg to 6,80	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO and tag PBTD. POOH 2-	learly state all pertinent details, a 15.7.14 NMAC. For Multiple C K manual BOP. Function test BOP. C. 3/8" tbg and notify BLM.	Completions: Attach wellbore diagram of R-111-P Area
13. Describe proposed or comof starting any proposed or proposed of starting any proposed of the proposed completion or result of the proposed	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi.	learly state all pertinent details, a 15.7.14 NMAC. For Multiple C K manual BOP. Function test BOP. C. 3/8" tbg and notify BLM. BP and spot 30 sxs class C cmt on top of	Completions: Attach wellbore diagram of R-111-P Area F bridge plug. WOC and Tag at least 3,650'.
13. Describe proposed or com of starting any proposed of proposed completion or re XTO Energy, Inc Respectfully submits N 1) POOH laying down rods ar 2) POOH laying down 2-7/8" 3) PU, RIH 2-3/8" tbg to 6,80 4) MIRU WL, RIH WL w/ 7-5 Circulate 9.5# salt gel mud and pressur 5) POOH w/tbg. RU WL, and and T' Delaware)	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at	Itearly state all pertinent details, a 15.7.14 NMAC. For Multiple Community of the Communit	Completions: Attach wellbore diagram of R-111-P Area F bridge plug. WOC and Tag at least 3,650°. at. WOC & Tag at least 3,133°. (10-3/4" csg shoe
13. Describe proposed or comof starting any proposed or proposed completion or research to the proposed completion of the proposed completion or research to the proposed complet	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at RIH WL. Perf 7-5/8" csg at	K manual BOP. Function test BOP. C. 3/8" tbg and notify BLM. BP and spot 30 sxs class C cmt on top of 3,375' and squeeze 150 sxs Class C cmt. 350' and squeeze Class C cmt to surface.	Completions: Attach wellbore diagram of R-111-P Area F bridge plug. WOC and Tag at least 3,650'.
13. Describe proposed or comof starting any proposed or proposed of proposed of proposed completion or research to the starting any proposed of the starting any proposed of the starting and proposed completion or research to the starting and proposed of the starting and the starting any proposed or remainded in the starting and starting	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC	K manual BOP. Function test BOP. C. 3/8" tbg and notify BLM. BP and spot 30 sxs class C cmt on top of 3/3,375' and squeeze 150 sxs Class C cmt on top OPU, transport trucks, and pump truck.	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe are. WOC & confirm TOC at Surface. (Surface Plug)
13. Describe proposed or comof starting any proposed or proposed of proposed or completion or research to the proposed of the prop	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC	K manual BOP. Function test BOP. C. 3/8" tbg and notify BLM. BP and spot 30 sxs class C cmt on top of 3,375' and squeeze 150 sxs Class C cmt. 350' and squeeze Class C cmt to surface.	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe se. WOC & confirm TOC at Surface. (Surface Plug)
13. Describe proposed or comof starting any proposed or proposed of proposed of proposed completion or research to the proposed complete to	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC	K manual BOP. Function test BOP. C. 3/8" tbg and notify BLM. BP and spot 30 sxs class C cmt on top of 3/3,375' and squeeze 150 sxs Class C cmt on top OPU, transport trucks, and pump truck.	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe se. WOC & confirm TOC at Surface. (Surface Plug)
of starting any proposed or comproposed completion or respect to the proposed completion of respect to the p	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TA(0' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC	K manual BOP. Function test BOP. 3/8" tbg and notify BLM. BP and spot 30 sxs class C cmt on top of 3,375' and squeeze 150 sxs Class C cmt. 1350' and squeeze Class C cmt to surfact O PU, transport trucks, and pump truck.	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe are. WOC & confirm TOC at Surface. (Surface Plug)
of starting any proposed or comof starting any proposed or proposed completion or respectfully submits North Pooh laying down rods are pooh laying down 2-7/8" and Pu, RiH 2-3/8" the stock of the start	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TA(0' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC	K manual BOP. Function test BOP. C. 3/8" tbg and notify BLM. BP and spot 30 sxs class C cmt on top of 3/3,375' and squeeze 150 sxs Class C cmt on top OPU, transport trucks, and pump truck.	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe are. WOC & confirm TOC at Surface. (Surface Plug)
of starting any proposed or comproposed completion or respect to the proposed of the proposed completion or respect to the proposed of the p	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TA(0' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC	Rig Release Date:	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe are. WOC & confirm TOC at Surface. (Surface Plug)
of starting any proposed or comproposed of starting any proposed of proposed of proposed of proposed completion or research to the starting any proposed of the proposed completion or research to the starting and the starting an	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC Solid cerr	Rig Release Date: Mark Nust be plug Must be plug Must be plug Must be plug	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe be. WOC & confirm TOC at Surface. (Surface Plug) 400' - T/salt @ 300' gged by 9/21/2022
of starting any proposed or comproposed of starting any proposed of proposed of proposed of proposed completion or research to the starting any proposed of the proposed completion or research to the starting and the starting an	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC Solid cerr	Rig Release Date: Mark Nust be plug Must be plug Must be plug Must be plug	Completions: Attach wellbore diagram of R-111-P Area Fbridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe be. WOC & confirm TOC at Surface. (Surface Plug) 400' - T/salt @ 300' gged by 9/21/2022
13. Describe proposed or com of starting any proposed of proposed completion or re XTO Energy, Inc Respectfully submits N 1) POOH laying down rods ar 2) POOH laying down 2-7/8" 3) PU, RIH 2-3/8" tbg to 6,80 4) MIRU WL, RIH WL w/7-5: Circulate 9.5# salt gel mud and pressud and T' Delaware) 6) POOH w/tbg. RU WL, and and T' Delaware) 6) POOH w/tbg. RU WL, and 7) ND BOP and cut off wellhes 8) Set P&A marker. Spud Date: ****SEE ATTAC	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC Solid cem	Rig Release Date: Mach. For Multiple Complete to the best of my knowled.	Completions: Attach wellbore diagram of R-111-P Area F bridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" csg shoe e.e. WOC & confirm TOC at Surface. (Surface Plug) 400' - T/salt @ 300' gged by 9/21/2022 dge and belief.
13. Describe proposed or comof starting any proposed or proposed of starting any proposed or proposed completion or results of the proposed of the pro	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC Solid cem	Rig Release Date: Regulatory Analyst Resulted State all pertinent details, and some services are serviced as a service and services a	Completions: Attach wellbore diagram of R-111-P Area F bridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" esg shoe are. WOC & confirm TOC at Surface. (Surface Plug) 400' - T/salt @ 300' gged by 9/21/2022 dge and belief. DATE09/20/2021
13. Describe proposed or comof starting any proposed or proposed of starting any proposed or proposed completion or research to the proposed of th	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC Solid cem	Rig Release Date: Mach. For Multiple Complete to the best of my knowled.	Completions: Attach wellbore diagram of R-111-P Area F bridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" esg shoe are. WOC & confirm TOC at Surface. (Surface Plug) 400' - T/salt @ 300' gged by 9/21/2022 dge and belief. DATE09/20/2021
13. Describe proposed or comof starting any proposed or proposed of starting any proposed or proposed completion or results of the proposed completion of results of the proposed complete substituting and proposed complete substitution and proposed c	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC Solid cem	Rig Release Date: Regulatory Analyst Resulted State all pertinent details, and some services are serviced as a service and services a	Completions: Attach wellbore diagram of R-111-P Area F bridge plug. WOC and Tag at least 3,650'. at. WOC & Tag at least 3,133'. (10-3/4" esg shoe are. WOC & confirm TOC at Surface. (Surface Plug) 400' - T/salt @ 300' gged by 9/21/2022 dge and belief. DATE09/20/2021
13. Describe proposed or com of starting any proposed or proposed completion or re XTO Energy, Inc Respectfully submits N 1) POOH laying down rods ar 2) POOH laying down 2-7/8" 3) PU, RIH 2-3/8" tbg to 6,80 4) MIRU WL, RIH WL w/ 7-2 Circulate 9.5# salt gel mud and pressur 5) POOH w/tbg. RU WL, and and T' Delaware) 6) POOH w/tbg. RU WL, and 7) ND BOP and cut off wellhe 8) Set P&A marker. Spud Date: ****SEE ATTAC I hereby certify that the information SIGNATURE Cassie Evans	work). SEE RULE 19. ecompletion. OI to PA for the above well ad pump. ND WH and NU 3 tbg and 2-7/8" x 7-5/8" TAGO' and tag PBTD. POOH 2-5/8" CIBP to 3,800'. Set CII re test to 500 psi. RIH WL. Perf 7-5/8" csg at ead 5' below surface. RDMC Solid cerr CHED COA's**** n above is true and con	Rig Release Date: Regulatory Analyst Resulted State all pertinent details, and some services are serviced as a service and services a	Completions: Attach wellbore diagram of R-111-P Area Fibridge plug. WOC and Tag at least 3,650°. at. WOC & Tag at least 3,133°. (10-3/4" csg shoe are. WOC & confirm TOC at Surface. (Surface Plug) 400' - T/salt @ 300' gged by 9/21/2022 dge and belief. DATE

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K)Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 – Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.


T 24S - R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

Nash Unit #001 - Current and Proposed WBD's

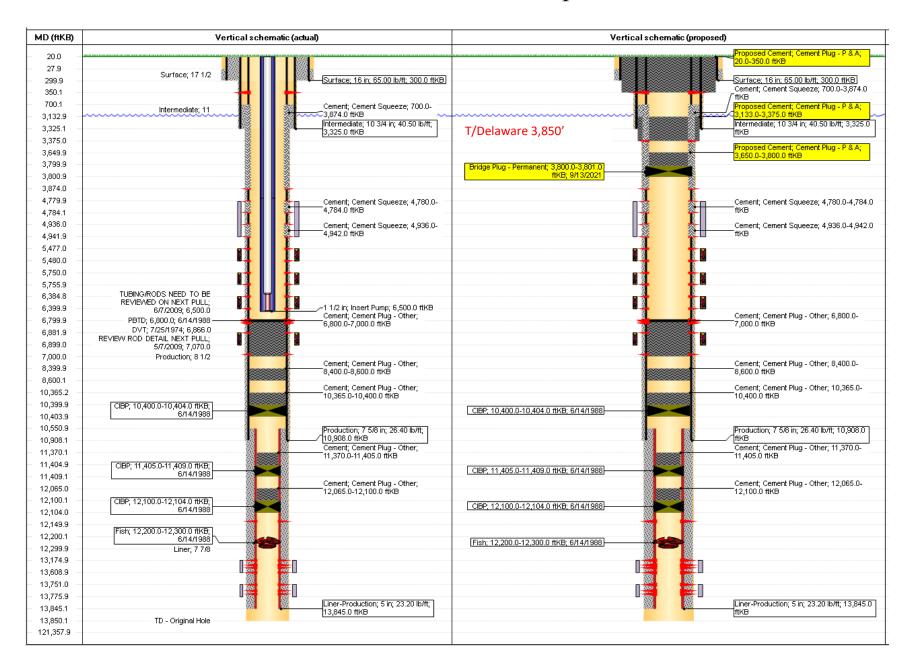

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 50473

CONDITIONS

Operator:	OGRID:
XTO ENERGY, INC	5380
6401 Holiday Hill Road	Action Number:
Midland, TX 79707	50473
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	9/21/2021