1.0	Po Appropriate District 2:5	7 <i>PM</i> S	tate of New Me	exico		Form &	age 1 of 2
Office <u>District I</u> – (57:	5) 393-6161	Energy, M	linerals and Natu	ral Resources		Revised July 18	, 2013
1625 N. French District II – (57	Dr., Hobbs, NM 88240				WELL API	NO. 5-31452	
	Artesia, NM 88210		NSERVATION			Type of Lease	
District III – (5	05) 334-6178 os Rd., Aztec, NM 87410		O South St. Fran		STAT		
District IV – (5		S	anta Fe, NM 87	7505	6. State Oil	& Gas Lease No.	
1220 S. St. Fran 87505	ncis Dr., Santa Fe, NM						
(DO NOT USE	SUNDRY NOTI THIS FORM FOR PROPO ESERVOIR. USE "APPLIC	SALS TO DRILL OR		JG BACK TO A	7. Lease Na	me or Unit Agreement Na	ime
PROPOSALS.)		_	Other		8. Well Nun	nber 87	
2. Name of CHEVRON	Operator MIDCONTINENT, L.	Р.			9. OGRID N 241333	Number	
3. Address	of Operator				10. Pool nar	ne or Wildcat	
6301 Dea	uville BLVD, Midl	and, TX 7970	06		[40990] LOVING	STON;UPPER SAN ANDRES	, WEST
4. Well Loc		1005		4.0	0.5	F01	
Uni	t Letter P :	1305 <sub>feet fi</sub>	rom the FEL	line and 13	05 <sub>fee</sub>	et from the FSL	line
Sec	tion 6			inge 36E	NMPM	County LEA	
		,	Show whether DR,	RKB, RT, GR, etc.	.)		
		3907.7					
TEMPORAR PULL OR AI DOWNHOLI CLOSED-LC OTHER: 13. Desc of st prop		ork). SEE RULE ompletion.	MPL   (Clearly state all plants.7.14 NMAC)  for well aband	C. For Multiple Co	ILLING OPNS.  T JOB [  d give pertinen mpletions: Att	ALTERING CASING P AND A  t dates, including estimate ach wellbore diagram of	
					E ATTACHE F APPROVAI	ED CONDITIONS L	
	Note changes to	orocedure		<u></u>			
Spud Date:			Rig Release Da	ite.			
- F			8				
hereby certi	fy that the information	above is true and	complete to the be	est of my knowledg	ge and belief.		
	Hours This	odoniu.	<sub>TITLE</sub> Engir	neer		<sub>DATE</sub> 11/10/2021	
SIGNATURE	Hayes Thib				@ahayran		
Type or print	<sub>name</sub> Hayes Thibo	odeaux	E-mail address	Hayes.thibodeaux	@cnevron.com	PHONE: 281-726-9	1083
For State Use	e Only	- 12 A					
APPROVED Conditions of	BY: Approval (if any	Fortner	TITLE Comp	oliance Officer A		DATE 11/17/21	

#### Lovington Well P&A Short Procedure for wells with rods and tubing.

# All cement plugs are based on 1.18 yield for Class H and 1.32 yield for Class C

- 1. Install casing Riser on intermediate and surface casing.
  - a. Follow the MCBU Ground Disturbance OE Standard before starting any excavations (One Call, Dig Plan)
  - b. Paint the casing valves as follow

Production: Blue

Intermediate: White

Surface: Yellow

- 2. Call and notify NMOCD 24 hrs. before operations begin.
- 3. MIRU pulling unit.
  - a. Intrinsically safe fans and H2S scavenger required due to known H2S in the field.
- 4. Check well pressures, kill well as necessary following The Chevron Initial Well Kill Operating Guidelines.
  - a. Bubble test should be at least 30 minutes and follow the bubble test SOP. On all casing annuli, if bubble test fails Chevron intends to Zonite, cut, and pull casing, or eliminate SCP with another means after the well is plugged to a certain point agreed upon by the NMOCD and Chevron.
  - b. Bubble tests should occur each morning, critical times are prior to pumping upper hydrocarbon plug or pumping cement to surface.
  - c. Perform a final bubble test after cement has hardened at surface.
- 5. Attempt to pressure test tubing to at least 1,000 psi for 15 minutes or the highest pressure expected while plugging the well.
  - a. If test passes, utilize tubing for work string.
  - b. If test fails, pick up a work string provided by Chevron.
- 6. Install hydraulic rod BOP and function test.
- 7. Pull and lay down rods.
  - a. If paraffin is encountered or rods are stuck contact engineer.
- 8. N/U BOPE using rubber coated hangers provided by Chevron, and pressure test, 250 psi low and 1,000 psi or MASP (per Chevron operating guidelines) for 5 minutes each.
  - a. On a chart, no bleed off allotted.
  - b. Contact engineer if unable to unset TAC, do not shear TAC without the BOP N/U first to mitigate any risks of well control events.
- 9. If tubing pressure tested, stand back pipe. If it failed, lay down and prepare to run a work string.
- 10. MIRU wireline and lubricator.
- 11. Pressure test lubricator to 500 psi or MASP (whichever is larger) for 10 minutes.
  - a. If MASP is greater than 1,000 psi, contact the engineer to discuss running grease injection.
- 12. Run and set CIBP within 100' of top perforation or as per approved C-103.
  - a. Skip gauge run if TAC pulled freely past setting depth.

- 13. Fill well with fresh water and pressure test casing to 500 psi for 15 minutes if no P&S required or 1,000 psi for 15 minutes if P&S required.
  - a. 5% bleed off allotted.
  - b. Contact the engineer if pressure test fails, document test results.
- 14. Perform 30-minute bubble test on surface and production casings. Record results to meet the barrier standard intent. Adjust forward plan as necessary to address SCP.
- 15. TIH and tag CIBP.
- 16. Spot MLF, subtracting cement volumes. Do not place MLF until casing pressure tests or above first Perf and Squeezes. If casing pressure test failed in step 13., Chevron requires all casing holes/damage to be covered with cement.
- 17. Spot minimum 25 sx or 150' of cement, whichever is larger, on top of CIBP (Perfs).
- 18. Spot 94 sacks Class C cement from 4676' to 3728' (San Andres, Grayburg, Queen).
  - a. Discuss with NMOCD on waiving WOC and tag if casing passed a pressure test.
- 19. Spot 25 sacks Class C cement from 3104' to 2854' (Yates). WOC & TAG
- 20. Spot 25 sacks Class C cement from 2089' to 1837' (Salt, Rustler). WOC & TAG
- P&S 50 521. Spot 25 sacks Class C cement from 1585' to 1335' (isolate surface shoe) WOC & TAG
- P&S 50 sx2. Spot 25 sacks Class C cement from 200' to surface (isolate Fresh Water zone at +/- 100')
  - 23. While RDMO, perform 30-minute bubble test on surface and production casings. Record results to meet the barrier standard intent.
  - 24. Cut all casings & anchors & remove 3' below grade. Verify cement to surface & weld on dry hole marker (4" diameter, 4' tall). Clean location.

Note: All cement plugs class "C" (<7,500') or "H" (>7,500') with closed loop system used, and MLF spotted between plugs.

# **WELL HEADER**

Date:	11/04/2021
Well Name:	Well #87 located in Section 6 of the West
ven vane.	Lovington Unit
Objective:	P&A
P&A Job Level:	2
P&A Priority Level:	1
Current Well Status:	Active Injection Well
Failure Date:	n/a
Well Class:	Water Injection Well
Area:	Central Area - Vacuum FOT
Field:	Lovington
County / State:	Lea / New Mexico
API #:	30-025-31452
Chevno:	OS6085
Operator:	Chevron
Spud Date:	
Completion Date:	
Unusual Jewelry (CRA, fiber-line,	
etc.)	
H2S Concentration >100 PPM?	Yes
NORM Present in Area?	No
Governing Authority:	NMOCD
Sec – Twp – Rng:	1305 FSL & 1305 FEL
	Section 6, T17S, R36E
Surface X / Y:	
Survey:	T&PRR Survey
Latitude & Longitude:	
GL / KB:	3908' GL


# **FORMATION TOPS & DEPTHS**

	TD, ft
Formation Name	Тор
Rustler	1,937
Salt Top	2,089
Salt Bottom	3,005
Yates	3,104
Seven Rivers	3,407
Queen	3,828
Grayburg	4,549
San Andres	4,746
TD	5,230

Created:	04/25/19	By:	
Updated:		By:	
Lease:	We	st Lovington U	nit
Field:	We	st Lovington U	nit
Surf. Loc.:	1305	FSL & 1305 F	EL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:			<u> </u>

Well #: API	87	St. Lse: 30-025-31452	
Unit Ltr.:	Р	Section:	6
TSHP/Rng:		17S-36E	
Unit Ltr.:		Section:	
TSHP/Rng:			
Directions:		Lovington, NM	
Chevno:		OS6085	


Surface Casing 8-5/8" Size: 24# Wt., Grd.: Depth: 1535 Sxs Cmt: 600 Circulate: Yes TOC: Surface Hole Size: 12-1/4" **Production Casing** Size: 5-1/2" Wt., Grd.: 15.5# Depth: 5230' Sxs Cmt: 1150 Yes Circulate: TOC: Surface Hole Size: 7-7/8"

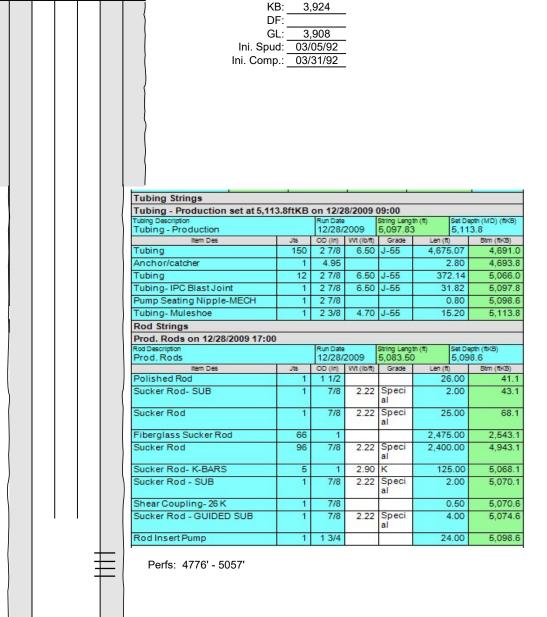

PBTD (est.): 5,183 TD: 5,230 Deepened:

Created:	04/25/19	Ву:	
Updated:		By:	
Lease:		est Lovington	
Field:	We	st Lovington	Unit
Surf. Loc.:	130	5 FSL & 1305	5 FEL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:		_	

Well #:	87	St. Lse:	
API		30-025-31452	
Unit Ltr.:	Р	Section:	6
TSHP/Rng:		17S-36E	
Unit Ltr.:		Section:	
TSHP/Rng:			
Directions:		Lovington, NM	
Chevno:		OS6085	

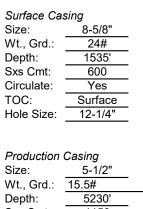

 Wt., Grd.:
 15.5#


 Depth:
 5230'

 Sxs Cmt:
 1150

 Circulate:
 Yes

 TOC:
 Surface

 Hole Size:
 7-7/8"

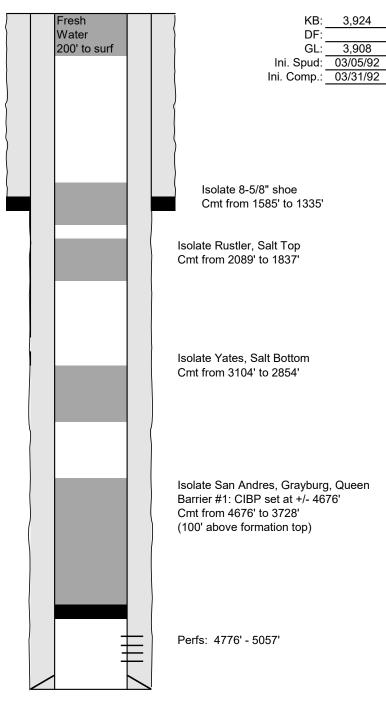

PBTD (est.): 5,183 TD: 5,230

41.1


68.1

#### **Wellbore Diagram**

Created:	04/25/19	Ву:	
Updated:		By:	
Lease:	Wes	st Lovington U	nit
Field:	Wes	t Lovington U	nit
Surf. Loc.:	1305	FSL & 1305 F	EL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:			

Well #: API	87	St. Lse: 30-025-31452	
Unit Ltr.:	Р	Section:	6
TSHP/Rng:		17S-36E	
Unit Ltr.:		Section:	
TSHP/Rng:			
Directions:		_ovington, NM	
Chevno:		OS6085	


Surface Casing 8-5/8" Size: 24# Wt., Grd.: Depth: 1535 Sxs Cmt: 600 Circulate: Yes TOC: Surface Hole Size: 12-1/4" **Production Casing** Size: 5-1/2" Wt., Grd.: 15.5# Depth: 5230' Sxs Cmt: 1150 Yes Circulate: TOC: Surface Hole Size: 7-7/8"

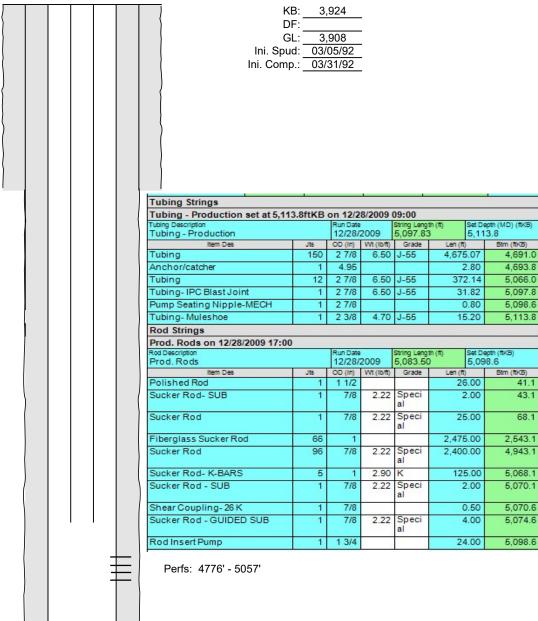

PBTD (est.): 5,183 TD: 5,230 Deepened:

Created: Updated:	04/25/19	By: _ Bv:	
•		· -	
Lease:	We	st Lovington	Unit
Field:	We	st Lovington	Unit
Surf. Loc.:	1305	5 FSL & 1305	FEL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:		_	

Well #:	87	St. Lse:	
API		30-025-31452	
Unit Ltr.:	Р	Section:	6
TSHP/Rng:		17S-36E	
Unit Ltr.:		Section:	
TSHP/Rng:			
Directions:		Lovington, NM	
Chevno:		OS6085	

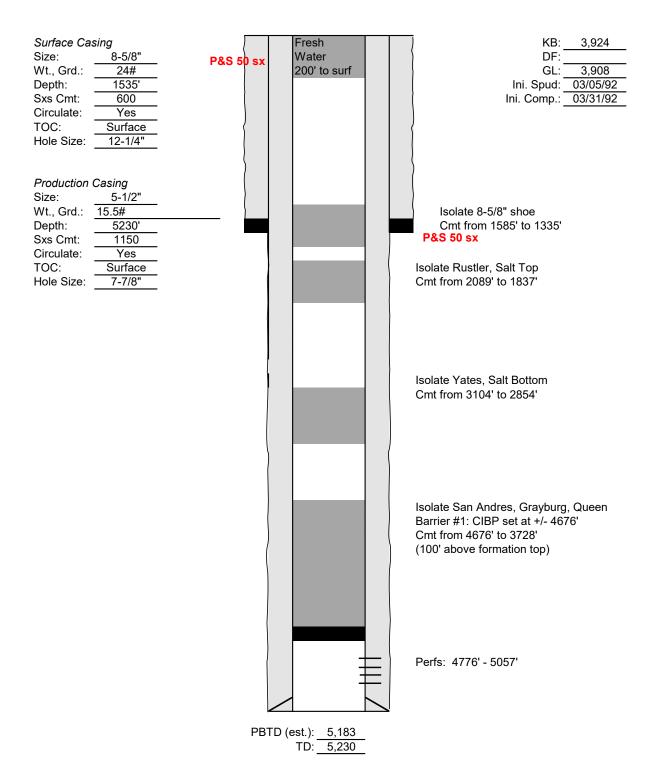

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

### Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

#### SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

#### SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

#### Lovington Well P&A Short Procedure for wells with rods and tubing.

# All cement plugs are based on 1.18 yield for Class H and 1.32 yield for Class C

- 1. Install casing Riser on intermediate and surface casing.
  - a. Follow the MCBU Ground Disturbance OE Standard before starting any excavations (One Call, Dig Plan)
  - b. Paint the casing valves as follow

Production: Blue

Intermediate: White

Surface: Yellow

- 2. Call and notify NMOCD 24 hrs. before operations begin.
- 3. MIRU pulling unit.
  - a. Intrinsically safe fans and H2S scavenger required due to known H2S in the field.
- 4. Check well pressures, kill well as necessary following The Chevron Initial Well Kill Operating Guidelines.
  - a. Bubble test should be at least 30 minutes and follow the bubble test SOP. On all casing annuli, if bubble test fails Chevron intends to Zonite, cut, and pull casing, or eliminate SCP with another means after the well is plugged to a certain point agreed upon by the NMOCD and Chevron.
  - b. Bubble tests should occur each morning, critical times are prior to pumping upper hydrocarbon plug or pumping cement to surface.
  - c. Perform a final bubble test after cement has hardened at surface.
- 5. Attempt to pressure test tubing to at least 1,000 psi for 15 minutes or the highest pressure expected while plugging the well.
  - a. If test passes, utilize tubing for work string.
  - b. If test fails, pick up a work string provided by Chevron.
- 6. Install hydraulic rod BOP and function test.
- 7. Pull and lay down rods.
  - a. If paraffin is encountered or rods are stuck contact engineer.
- 8. N/U BOPE using rubber coated hangers provided by Chevron, and pressure test, 250 psi low and 1,000 psi or MASP (per Chevron operating guidelines) for 5 minutes each.
  - a. On a chart, no bleed off allotted.
  - b. Contact engineer if unable to unset TAC, do not shear TAC without the BOP N/U first to mitigate any risks of well control events.
- 9. If tubing pressure tested, stand back pipe. If it failed, lay down and prepare to run a work string.
- 10. MIRU wireline and lubricator.
- 11. Pressure test lubricator to 500 psi or MASP (whichever is larger) for 10 minutes.
  - a. If MASP is greater than 1,000 psi, contact the engineer to discuss running grease injection.
- 12. Run and set CIBP within 100' of top perforation or as per approved C-103.
  - a. Skip gauge run if TAC pulled freely past setting depth.

- 13. Fill well with fresh water and pressure test casing to 500 psi for 15 minutes if no P&S required or 1,000 psi for 15 minutes if P&S required.
  - a. 5% bleed off allotted.
  - b. Contact the engineer if pressure test fails, document test results.
- 14. Perform 30-minute bubble test on surface and production casings. Record results to meet the barrier standard intent. Adjust forward plan as necessary to address SCP.
- 15. TIH and tag CIBP.
- 16. Spot MLF, subtracting cement volumes. Do not place MLF until casing pressure tests or above first Perf and Squeezes. If casing pressure test failed in step 13., Chevron requires all casing holes/damage to be covered with cement.
- 17. Spot minimum 25 sx or 150' of cement, whichever is larger, on top of CIBP (Perfs).
- 18. Spot 94 sacks Class C cement from 4676' to 3728' (San Andres, Grayburg, Queen).
  - a. Discuss with NMOCD on waiving WOC and tag if casing passed a pressure test.
- 19. Spot 25 sacks Class C cement from 3104' to 2854' (Yates).
- 20. Spot 25 sacks Class C cement from 2089' to 1837' (Salt, Rustler).
- 21. Spot 25 sacks Class C cement from 1585' to 1335' (isolate surface shoe)
- 22. Spot 25 sacks Class C cement from 200' to surface (isolate Fresh Water zone at +/- 100')
- 23. While RDMO, perform 30-minute bubble test on surface and production casings. Record results to meet the barrier standard intent.
- 24. Cut all casings & anchors & remove 3' below grade. Verify cement to surface & weld on dry hole marker (4" diameter, 4' tall). Clean location.

Note: All cement plugs class "C" (<7,500') or "H" (>7,500') with closed loop system used, and MLF spotted between plugs.

# **WELL HEADER**

Date:	11/04/2021
Well Name:	Well #87 located in Section 6 of the West
ven name.	Lovington Unit
Objective:	P&A
P&A Job Level:	2
P&A Priority Level:	1
Current Well Status:	Active Injection Well
Failure Date:	n/a
Well Class:	Water Injection Well
Area:	Central Area - Vacuum FOT
Field:	Lovington
County / State:	Lea / New Mexico
API #:	30-025-31452
Chevno:	OS6085
Operator:	Chevron
Spud Date:	
Completion Date:	
Unusual Jewelry (CRA, fiber-line,	
etc.)	
H2S Concentration >100 PPM?	Yes
NORM Present in Area?	No
Governing Authority:	NMOCD
  Sec - Twp - Rng:	1305 FSL & 1305 FEL
	Section 6, T17S, R36E
Surface X / Y:	
Survey:	T&PRR Survey
Latitude & Longitude:	
GL / KB:	3908' GL

# **FORMATION TOPS & DEPTHS**

	TD, ft
Formation Name	Тор
Rustler	1,937
Salt Top	2,089
Salt Bottom	3,005
Yates	3,104
Seven Rivers	3,407
Queen	3,828
Grayburg	4,549
San Andres	4,746
TD	5,230

Set Depth (MD) (ftKB) 5,113.8

> 4,691.0 4,693.8

5,066.0

5,097.8

5,098.6

5,113.8

41.1

68.1

2.543.1

4,943.1

5,068.1

5,070.1

5,070.6

5,074.6

5,098.6

4,675.07

372.14

31.82

0.80

15.20

26.00

25.00

2.475.00

2,400.00

125.00

2.00

0.50

4.00

24.00


Set Depth (ftKB) 5,098.6

#### **Wellbore Diagram**

Created:	04/25/19	By:	
Updated:		By:	
Lease:	Wes	st Lovington U	nit
Field:	Wes	st Lovington U	nit
Surf. Loc.:	1305	FSL & 1305 F	EL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:			

Well #: API Unit Ltr.: TSHP/Rng: Unit Ltr.: TSHP/Rng:	P	St. Lse: 30-025-31452 Section: 17S-36E Section:	6	_
TSHP/Rng: Directions: Chevno:	I	Lovington, NM OS6085		

Surface Casing 8-5/8" Size: 24# Wt., Grd.: Depth: 1535 Sxs Cmt: 600 Circulate: Yes TOC: Surface Hole Size: 12-1/4" **Production Casing** Size: 5-1/2" Wt., Grd.: 15.5# Depth: 5230' Sxs Cmt: 1150 Yes Circulate: TOC: Surface Hole Size: 7-7/8"

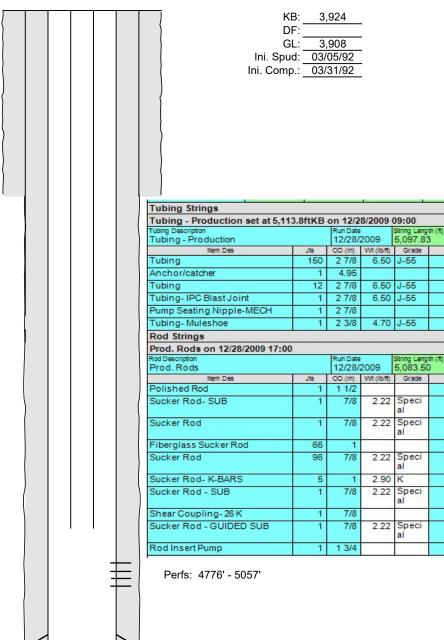


PBTD (est.): 5,183 TD: 5,230

Deepened:

Created:	04/25/19	Ву:	
Updated:		By:	
Lease:		est Lovington	
Field:	We	st Lovington	Unit
Surf. Loc.:	130	5 FSL & 1305	5 FEL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:		_	

Well #:	87	St. Lse:	
API		30-025-31452	
Unit Ltr.:	Р	Section:	6
TSHP/Rng:		17S-36E	
Unit Ltr.:		Section:	
TSHP/Rng:			
Directions:		Lovington, NM	
Chevno:		OS6085	

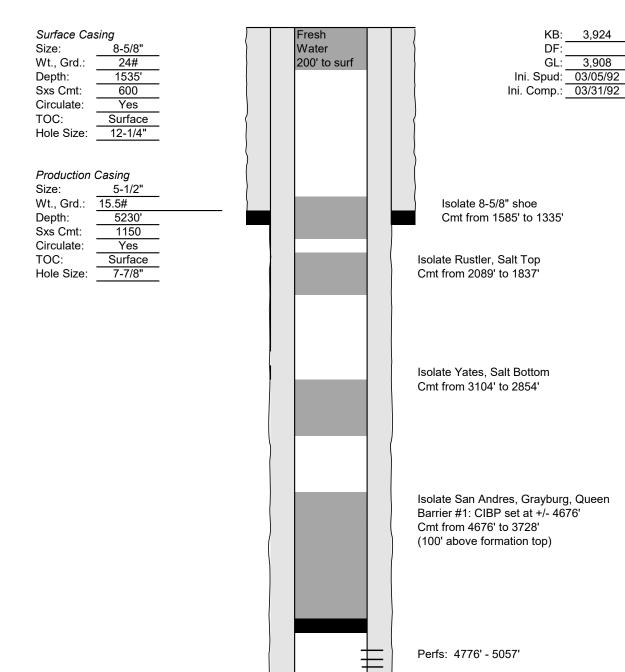


PBTD (est.): 5,183 TD: 5,230

Created:	04/25/19	Ву:	
Updated:		By:	
Lease:	We	st Lovington U	nit
Field:	West Lovington Unit		
Surf. Loc.:	1305	FSL & 1305 F	EL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:			

Well #: API	87	St. Lse: 30-025-31452	
Unit Ltr.:	Р	Section:	6
TSHP/Rng:		17S-36E	
Unit Ltr.:		Section:	
TSHP/Rng:			
Directions:	l	_ovington, NM	
Chevno:		OS6085	


Surface Casing 8-5/8" Size: 24# Wt., Grd.: Depth: 1535 Sxs Cmt: 600 Circulate: Yes TOC: Surface Hole Size: 12-1/4" **Production Casing** Size: 5-1/2" Wt., Grd.: 15.5# Depth: 5230' Sxs Cmt: 1150 Yes Circulate: TOC: Surface Hole Size: 7-7/8"

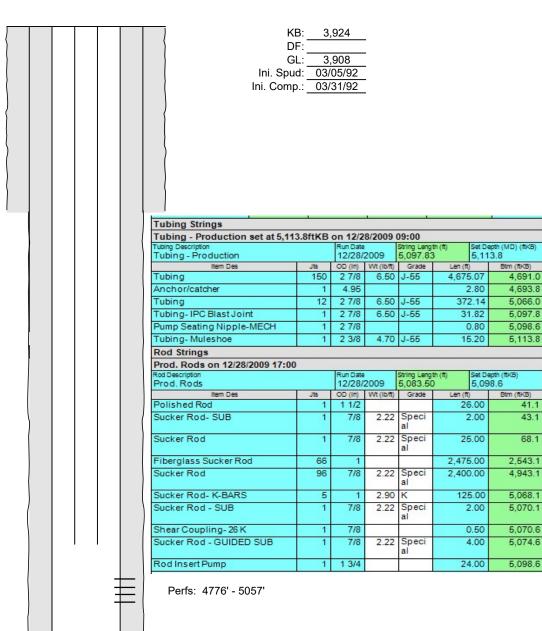

PBTD (est.): 5,183 TD: 5,230 Deepened:

Created:	04/25/19	Ву:	
Updated:		By:	
Lease:		est Lovington	
Field:	We	st Lovington	Unit
Surf. Loc.:	130	5 FSL & 1305	5 FEL
Bot. Loc.:			
County:	Lea	St.:	NM
Status:		_	

Well #:	87	St. Lse:	
API		30-025-31452	
Unit Ltr.:	Р	Section:	6
TSHP/Rng:		17S-36E	
Unit Ltr.:		Section:	
TSHP/Rng:			
Directions:		Lovington, NM	
Chevno:		OS6085	

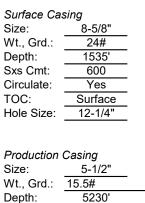



Sxs Cmt:

Circulate:

Hole Size:

TOC:

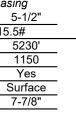

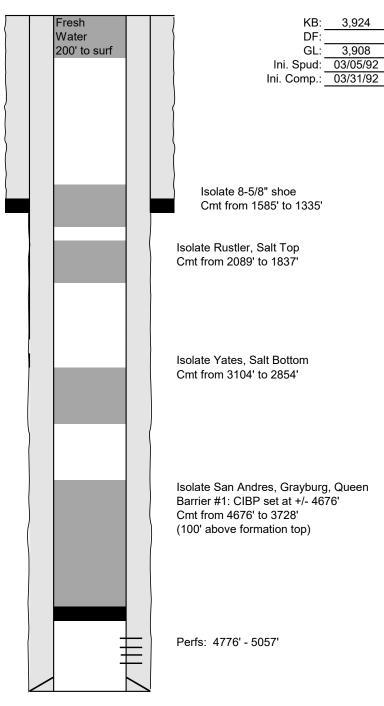

PBTD (est.): 5,183 TD: 5,230

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 61230

#### **CONDITIONS**

Operator:	OGRID:	
CHEVRON U S A INC	4323	
6301 Deauville Blvd	Action Number:	
Midland, TX 79706	61230	
	Action Type:	
	[C-103] NOI Plug & Abandon (C-103F)	

#### CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached conditions of approval Note changes to procedure	11/17/2021