

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Reports

Well Name: FEDERAL C Well Location: T30N / R13W / SEC 30 / County or Parish/State: SAN

Well Number: 4 Type of Well: OTHER Allottee or Tribe Name:

Lease Number: NMSF078977 Unit or CA Name: Unit or CA Number:

US Well Number: 3004533692 Well Status: Gas Well Shut In Operator: HILCORP ENERGY

COMPANY

Notice of Intent

Sundry ID: 2653720

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/21/2022 Time Sundry Submitted: 01:32

Date proposed operation will begin: 02/01/2022

Procedure Description: Hilcorp Energy Company requests permission to P&A the subject well per the attached procedures, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 01/06/2022 with Bob Switzer/BLM. The Re-Vegetation Plan is attached. A closed loop system will be used.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Federal_C_4_P_A_NOI_20220121133231.pdf

Page 1 of 2

well Name: FEDERAL C Well Location: T30N / R13W / SEC 30 / County or Parish/State: SAN

SWNW / 36.786095 / -108.249268

Lease Number: NMSF078977 Unit or CA Name: Unit or CA Number:

Type of Well: OTHER

US Well Number: 3004533692 **Well Status:** Gas Well Shut In **Operator:** HILCORP ENERGY

COMPANY

JUAN / NM

Allottee or Tribe Name:

Conditions of Approval

Additional Reviews

Well Number: 4

General_Requirement_PxA_20220214165730.pdf

2653720_NOIA_C_4_3004533692_KR_02142022_20220214165717.pdf

30N13W30FKIs_Federal_C_4_20220214131419.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: AMANDA WALKER Signed on: JAN 21, 2022 01:32 PM

Name: HILCORP ENERGY COMPANY

Title: Operations/Regulatory Technician

Street Address: 1111 TRAVIS ST.

City: HOUSTON State: TX

Phone: (346) 237-2177

Email address: mwalker@hilcorp.com

Field Representative

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

Signature: Kenneth Rennick

BLM POC Name: KENNETH G RENNICK BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742 BLM POC Email Address: krennick@blm.gov

Disposition: Approved **Disposition Date:** 02/14/2022

Page 2 of 2



P&A Procedure

General Information					
Well Name	Federal C #4	Date:	1-21-22		
API:	30-045-33692	AFE#			
Field:	San Juan North	County	San Juan		
Status:	Well is ACOI				
Subject:	Permanently P&A wellbore				
By:	J. Picou				

Well Data

Surface Casing: 8-5/8" 24# J-55 at 227'

Production Casing: 5-1/2" 15.5 #; J-55 at 1,370'

Production Tubing: 2-3/8" 4.7#; J-55 at 1,123'

Rod String: 3/4" Sucker Rods

Current Perforations: 1,042' - 1,189'

Current PBTD: 1,323' (cement plug)

KB: 6'


Hold PJSM prior to begin all operations. Properly document all operations via the JSA process. Ensure that all personnel onsite abide by HEC safety protocol, including PPE, housekeeping, and standard guidelines. Verify cathodic protection is off and wellhead instrumentation is properly disconnected from the wellhead. Comply with all NMOCD and HEC safety and environmental regulations. Verify there is no H2S present prior to beginning operations. If any H2S is present, take the necessary actions to ensure that the location is safe prior to beginning operations. Observe and record pressures across all strings daily, prior to beginning operations.

Remember to notify NMOCD and BLM 24 hours prior to starting operations on location. This procedure is contingent upon P&A sundry approval by the NMOCD and BLM.


Rig Procedure

- 1. MIRU P&A rig and equipment. Record pressures on all strings.
- 2. Unseat rods from ESP and POOH with rod string. NU BOP & test. Release ESP pump and TOOH with production tbg and pump.
- 3. RIH with 5.5" casing scraper to +/- 1,010'.
- 4. MU 5.5" CICR and RIH. Set CICR at 1,000'.
- 5. Load wellbore with KCl water and circulate wellbore clean. Pressure test the casing to 500 psi to verify wellbore integrity and plug set.
- 6. Plug #1 (Fruitland Coal Top at 902'): RU cementers and pump a 200' balanced cmt plug inside the 5-1/2" from 800' 1,000', using 6.1 bbls (30 sx) of 15.8+ ppg Class G cmt.
- 7. TOOH with tbg to 300'.
- 8. Plug #2 (Surf. Casing Shoe at 227'): RU cementers and pump a 300' balanced cmt plug from Surface 300' inside the 5-1/2" using 8.4 bbls (41 sx) of 15.8 ppg Class G cmt.
- 9. WOC 4 hrs. Verify all pressures on all strings are at 0 psi.
- 10. ND BOP. Tag cmt and top off wellbore as needed. Cutoff wellhead at surface and weld P&A marker.
- 11. RDMO P&A rig.

CURRENT WELLBORE SCHEMATIC

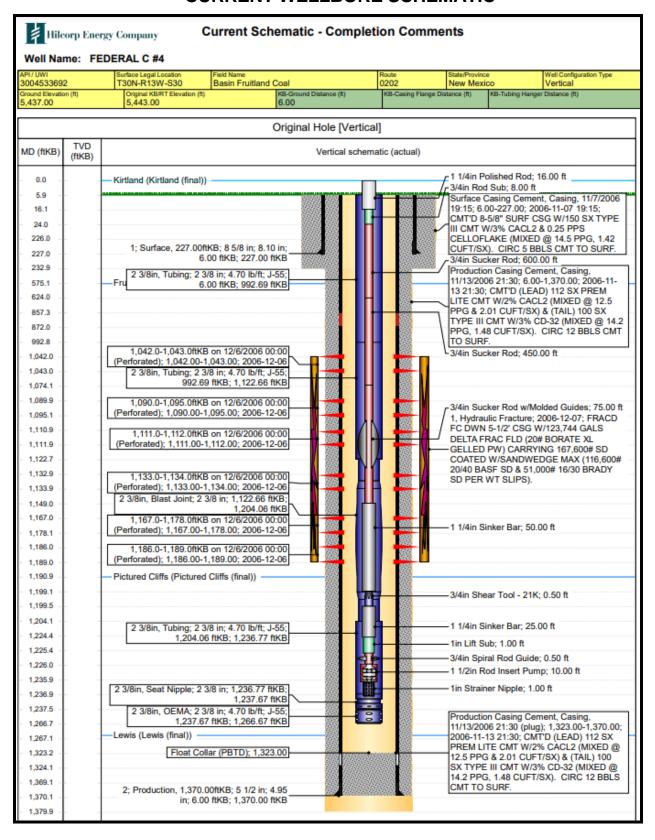

PROPOSED P&A WELLBORE SCHEMATIC

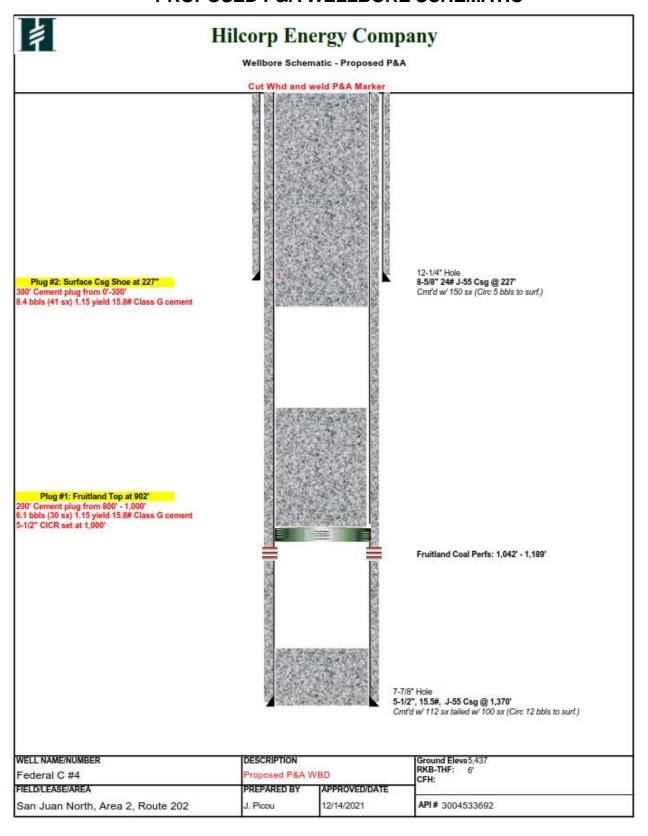

Hilcorp Energy P&A Final Reclamation Plan

Federal C 4

API: 30-045-33692 T30N- R13W-Sec. 30-Unit F

LAT: 36.786098 LONG: -108.248499 NAD 27 Footage: 1955' FNL & 920' FWL San Juan County, NM

1. PRE- RECLAMATION SITE INSPECTION

A pre-reclamation site inspection was completed with Bob Switzer from the BLM and Bobby Spearman, Hilcorp Energy SJ North Construction Foreman on January 6, 2022.

2. LOCATION RECLAMATION PROCEDURE

- 1. Reclamation work will begin in springtime.
- 2. Removal of all equipment, anchors, flowlines, cathodic, meter run.
- 3. All trash and debris will be removed within a 50' buffer outside of the location disturbance during reclamation.
- 4. Rip compacted soil and walk down disturbed portion of well pad.
- 5. Remove all gravel from berms, pads, and bury in toe of cut or spread on main access road
- 6. Enterprise will remove pipeline from meter run to dog leg or abandon in place.

3. ACCESS ROAD RECLAMATION PROCEDURE

- 1. The well access road will be blocked at the entrance with a berm.
- 2. Reclaim approx... 400' of access road by ripping and seeding. Pull in sides as good as possible.

4. **SEEDING PROCEDURE**

- 1. A Badlands seed mix mixed with some sage will be used for all reclaimed and disturbed areas of the well pad and lease road.
- 2. Drill seed will be done where applicable, and all other disturbed areas will be broadcast seeded and harrowed. Broadcast seeding will be applied at a double the rate of seed.
- 3. Timing of the seeding will be when the ground is not frozen or saturated.

5. WEED MANAGEMENT

1. No Noxious weeds were found on location.

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
 - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
 - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
 - 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
 - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
 - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
 - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
 - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
 - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
 - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2653720

Attachment to notice of Intention to Abandon

Well: Federal C 4

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. The following modifications to your plugging program are to be made:
- a) Add a plug to cover the Picture Cliffs formation at 1191 feet.
- 3. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 2/14/2022

BLM FLUID MINERALS P&A Geologic Report

Date Completed: 2/14/2022

Well No. Federal C #4 (API# 30-04	Location	1955	FNL	&	920	FWL	
Lease No. NMSF-078977	Sec. 30	T30N			R13W		
Operator Hilcorp Energy Compan	County	San Juan		State	New Mexico		
Total Depth 1380'	PBTD 1320'	Formation	Fruitland (producing), Lewis (TD)				
Elevation (GL) 5437'	Elevation (KE	Elevation (KB) 5443'					

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					Surface/freshwater sands
Nacimiento Fm					Possible freshwater sands
Ojo Alamo Ss					Aquifer (possible freshwater)
Kirtland Shale			Surface	846	
Fruitland Fm			846	1191	Coal/Gas/Possible water
Pictured Cliffs Ss			1191	1290	Gas
Lewis Shale			1290	PBTD	
Chacra					Gas
Cliff House Ss					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Mancos Shale					
Gallup					O&G/Water
Greenhorn					
Graneros Shale					
Dakota Ss					O&G/Water

Remarks:

P & A

- BLM pick for the Fruitland formation top varies from Operator's submission.

Reference Well:

1) Formation Tops

Same

- Add a plug to cover the Pictured Cliffs formation top at 1191'.
- The plugs proposed in the P&A procedure, with recommended plug changes, will adequately protect any freshwater sands in this well bore.
- Fruitland perfs 1042' 1189'.

Prepared by: Chris Wenman

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 81502

CONDITIONS

Operator:	OGRID:	
HILCORP ENERGY COMPANY	372171	
1111 Travis Street	Action Number:	
Houston, TX 77002	81502	
	Action Type:	
	[C-103] NOI Plug & Abandon (C-103F)	

CONDITIONS

Created By		Condition Date
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	2/16/2022
kpickford	Adhere to BLM approved COAs and plugs. See GEO report	2/16/2022