Office District L = (575) 393-6161 State of New Mexico Energy, Minerals and Natural Resources	Form $C-103^1$ Revised July 18, 2013			
1625 N. French Dr., Hobbs, NM 88240	WELL API NO. 30-025-38288			
District III - (505) 743-1205OIL CONSERVATION DIVISION811 S. First St., Artesia, NM 88210District III - (505) 334-61781220 South St. Francis Dr.	5. Indicate Type of Lease STATE STATE FEE			
1000 Rio Brazos Rd., Aztec, NM 87410 Santa Fe, NM 87505 District IV - (505) 476-3460 Santa Fe, NM 87505 1220 S. St. Francis Dr., Santa Fe, NM 87505	6. State Oil & Gas Lease No. VA-1333			
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	7. Lease Name or Unit Agreement Name Taco AUK State			
PROPOSALS.) 1. Type of Well: Oil Well 🛛 Gas Well 🗌 Other	8. Well Number 3			
2. Name of Operator	9. OGRID Number			
EOG Resources, Inc. 3. Address of Operator	7377 10. Pool name or Wildcat			
104 South Fourth Street, Artesia, NM 88210	Lane; Abo, Southeast			
4. Well Location Unit Letter I : 1750 feet from the South line and	430 feet from the East line			
Section 10 Township 10S Range 34E 11. Elevation (Show whether DR, RKB, RT, GR,				
4194'GR 12. Check Appropriate Box to Indicate Nature of Not	ice. Report or Other Data			
NOTICE OF INTENTION TO: S PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL V				
	DRILLING OPNS. P AND A			
PULL OR ALTER CASING MULTIPLE COMPL CASING/CEM	MENT JOB			
OTHER: OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple				
 OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 5536'-5284'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 28 7. Perforate at 477'. Attempt injection rate. Squeeze with 147 sx Class "C" cement from 47 Back fill as needed. 	e Completions: Attach wellbore diagram of ". WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top.			
 OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 5536'-5284'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 28 7. Perforate at 477'. Attempt injection rate. Squeeze with 147 sx Class "C" cement from 47 	e Completions: Attach wellbore diagram of ". WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top.			
 OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 5536'-5284'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 28 7. Perforate at 477'. Attempt injection rate. Squeeze with 147 sx Class "C" cement from 47 Back fill as needed. 8. Cut off wellhead and install dry hole marker. Clean location as per regulated. 	e Completions: Attach wellbore diagram of ". WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top.			
 OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 5536'-5284'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 28 7. Perforate at 477'. Attempt injection rate. Squeeze with 147 sx Class "C" cement from 47 Back fill as needed. 8. Cut off wellhead and install dry hole marker. Clean location as per regulated. 	e Completions: Attach wellbore diagram of ". WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top.			
 OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 7800'-7574'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 28 7. Perforate at 477'. Attempt injection rate. Squeeze with 147 sx Class "C" cement from 47 Back fill as needed. 8. Cut off wellhead and install dry hole marker. Clean location as per regulated. 	e Completions: Attach wellbore diagram of 7. WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top. 7' and circulate up to surface. Verify cement at surface.			
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 5536'-5284'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 28 7. Perforate at 477'. Attempt injection rate. Squeeze with 147 sx Class "C" cement from 47 Back fill as needed. 8. Cut off wellhead and install dry hole marker. Clean location as per regulated. Wellbore schematics attached LPC Area Below ground marker send pics before backfilling hole pud Date: Rig Release Date:	e Completions: Attach wellbore diagram of ". WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top.			
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 5536'-5284'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 47 Back fill as needed. 8. Cut off wellhead and install dry hole marker. Clean location as per regulated. Wellbore schematics attached LPC Area Below ground marker send pics before backfilling hole pud Date: Rig Release Date: pud Date: Rig Release Date: Mereby certify that the information above is true and complete to the best of my know	Completions: Attach wellbore diagram of WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top. 7' and circulate up to surface. Verify cement at surface. TACHED CONDITIONS PROVAL			
OTHER: OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. EOG Resources, Inc. plans to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. NU BOP. POOH with production equipment. 2. Set a CIBP at 8939'. Pressure test. Spot 25 sx Class "H" cement on top of CIBP to 8713' 3. Spot a 25 sx Class "H" cement plug from 7800'-7574'. This will cover Abo top. 4. Spot a 25 sx Class "C" cement plug from 5536'-5284'. This will cover Glorieta top. 5. Perforate at 4196'. Attempt injection rate. Squeeze with 39 sx Class "C" cement from 41 and San Andres top. 6. Perforate at 2831'. Attempt injection rate. Squeeze with 40 sx Class "C" cement from 28 7. Perforate at 477'. Attempt injection rate. Squeeze with 147 sx Class "C" cement from 47 Back fill as needed. 8. Cut off wellhead and install dry hole marker. Clean location as per regulated. Wellbore schematics attached LPC Area Below ground marker send pics before backfilling hole pud Date: Rig Release Date:	Completions: Attach wellbore diagram of WOC and tag. This will cover Abo perfs. 96'-3971'. WOC and tag. This will cover casing shoe 31'-2699'. WOC and tag. This will cover Yates top. 7' and circulate up to surface. Verify cement at surface. TACHED CONDITIONS PROVAL			

Condition	ns of Appr	oval (if any	8	•
Released to	Imaging:	3/14/2022	12:36:	05 PM

•

•

Taco AUK State 3 Current	Sec		10-10S-34E 1750' FSL & 430'	FEL		API: GL: KB:	30-025-3828 4194' 4214'	8		
	CASIN #	G DETAIL Hole Size	Cog Size	Wt.	Grade	Тор	Bottom	Sx Cmt	TOC	TOC by
	# A	14 1/2	Csg. Size 11 3/4	42	H-40	0	427	260	Surface	Circ.
	В	14 1/2	8 5/8	24/32	J-55	0	4146	1250	Surface	Circ.
	C	7 7/8	5 1/2	17	J-55/P-110	0	9200	1245	4090	CBL
		1								
	FORMA	ATION TOPS	T (10)	-		T (10)			T (10)	
		Formation Yates	Top (MD) 2,781		Formation	Top (MD)		Formation	Top (MD)	
		San Andres	4,037							
		Glorieta	5,486							
		Abo	7,750							
		Wolfcamp	9,034							
C - 4,090' by CBL										
		G DETAIL [6.2.1		10		, I		1 1		
		OD	Description	Length Undisclosed		+ +		-		+
		2 7/8"	L-80 tubing					_		
	1	5.5"	Tubing Anchor	Undisclosed						
	9	2 7/8"	L-80 tubing	Undisclosed				_		
	1	2 7/8"	Seat Nipple	Undisclosed Undisclosed				_		
	1	2 7/8" 2 7/8"	L-80 tubing Bull Plug	Undisclosed				-		
	1	2 1/8	Bull Plug	Undisclosed				-		
		_								
						<u> </u>				
	ROD D	ETAIL [6.3.17]								
	No.	OD	Description	Length						
	1	1 3/4"	Polished Rod	30				_		
	1	1"	Pony Rod	8				_		
	1	1" 1"	Pony Rod	2						
	78		Rod	1,950 2,650				_		
	106 166	7/8" 3/4"	Rod Rod	2,650				_		
	10	1"	Rod	250				1 1		
	1	2 1/2"	RHBC Insert Pump	230						
	PERFO	RATION DETAI								
		Formation	Тор	Bottom		Formation	Тор	Bottom		
		Abo	8,989	9,016						
					_					
		ONAL DETAIL								
	Well sw	abbed in May '0	7. Initial fluid level was 140	00', swabbed 90.5	bbl oil. Final fluid	level was 8800)'.			
	1									
sting Abo Perfs: 8989' - 9016'										
sting Abo Perfs: 8989' - 9016'										
ting Abo Perfs: 8989' - 9016'					KJP 2/17/					

•

		Sec-TWN-RNG:	10-10S-34	E		API:	30-025-38288			
Taco AUK State 3 Pr	oposed			& 430' FEL		GL:	4194'			
COMMENTS						KB:	4214'			
Plug 6: Perf @ 477. 0' - 477'. Verify @	CAR	ING DETAIL								
surface. Surface csg shoe + Surface plug.	#		Csg. Size	Wt.	Grade	Тор	Bottom	Sx Cmt	TOC	TOC by
	A	14 1/2	11 3/4	42	H-40	0	427	260	Surface	Circ.
			8 5/8	24/32	J-55	0	4146	1250	Surface	Circ.
	С	7 7/8	5 1/2	17	J-55/P-110	0	9200	1245	4090	CBL
	FOR	MATION TOPS	T (110)			T (110)	1		T (115)	
		Formation Yates	Top (MD) 2,781		Formation	Top (MD)		Formation	Top (MD)	
Plug 5: Perf @ 2831. 2699' - 2831'. WOC & tag.		San Andres	4,037							
Yates top		Glorieta	5,486							
		Abo Wolfcamp	7,750 9,034							
		Tronoump	0,001							
	PLU	GS				1	1			
	#	sx	Class	Тор	Bottom	Δ		Notes		Tag
TOC - 4,090' by CBL		25	н	8713	8939	226	CIBP at 8939. Press Abo Perfs	sure test. Spot 25	sx. WOC & Tag.	Y
Plug 4: Perf @ 4196. 3971' - 4196'. WOC & tag.							Spot 25 sx. Abo Top).		
Int Csg shoe + San Andres top B	2	25	Н	7574	7800	226	Spot 25 sx. Glorieta			Ν
	3	25	С	5284	5536	252	-		Maria Maria	Ν
	4	39	С	3971	4196	225	Perf at 4196'. Attemp WOC & Tag. Int. Csg	. Shoe + SA top		Y
	5	40	с	2699	2831	132	Perf at 2831'. Attem Yates Top.	pt Inj. Sqz 40 sx.	NOC & Tag.	Y
			с				Perf at 477'. Attemp	t Inj. Sqz 147 sx.	Verify @ surface.	Y
	6	147	C	0	477	477	Sur. Csg. Shoe + S	urrace plug		Y
Plug 3: 5284'-5536'. Glorieta top										
	PER	FORATION DETAIL								
	· · · · ·		-				-	5.4		
		Formation	Тор	Bottom		Formation	Тор	Bottom		
		Abo	8,989	9,016						
Plug 2: 7574' - 7800'. Abo top										
		ITIONAL DETAIL swabbed in May '07. Initia	l fluid level was	1400' swabbed	90.5 bbl oil. Eina	l fluid level was	8800'			
		enabbed in may ere initia			00.0 001 01.1 110					
Plug 1: CIBP @ 8939. 8713' - 8939'. WOC & tag. Abo perfs										
Existing Abo Perfs: 8989' - 9016'	M									
c –										
	AD A					JP 2/17/2022				
	MD				K.	JF 2/17/2022				

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.

2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.

3. Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.

4. Filing a subsequent C-103 will serve as notification that the well has been plugged.

5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.

6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.

7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.

8. Produced water will not be used during any part of the plugging operation.

9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.

10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.

11. Class 'C' cement will be used above 7500 feet.

12. Class 'H' cement will be used below 7500 feet.

13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged

14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set

17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.

18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.

20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops

- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.

K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

COMMENTS

Operator:	OGRID:
EOG RESOURCES INC	7377
P.O. Box 2267	Action Number:
Midland, TX 79702	83647
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	3/14/2022

Page 6 of 7

.

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator: EOG RESOURCES INC	OGRID: 7377		
	Action Number: 83647		
	Action Type: [C-103] NOI Plug & Abandon (C-103F)		

CONDITIONS

Created By		Condition Date
kfortner	See attached conditions of approval	3/11/2022

Page 7 of 7

.

Action 83647