

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report

Well Name: JICARILLA APACHE B Well Location: T24N / R5W / SEC 20 / County or Parish/State: RIO

SESE / 36.293664 / -107.378593 ARRIBA / NM

Well Number: 2 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

ELL JICARILLA APACHE

Lease Number: JIC11 Unit or CA Name: Unit or CA Number:

US Well Number: 3003905362 Well Status: Producing Gas Well Operator: DJR OPERATING LLC

#### **Notice of Intent**

**Sundry ID:** 2665183

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 04/04/2022 Time Sundry Submitted: 02:24

Date proposed operation will begin: 04/04/2022

**Procedure Description:** This NOI to P&A is being submitted for engineering & geological review prior to onsite inspection as approved by Dave M. of the BLM. A Reclamation Plan will be submitted on a subsequent sundry at a later date. DJR Operating, LLC requests permission to Plug & Abandon the subject well according to the attached Procedure, Current & Proposed Wellbore Diagram.

### **Surface Disturbance**

Is any additional surface disturbance proposed?: No

#### **NOI Attachments**

## **Procedure Description**

Jicarilla\_Apache\_B\_2\_BLM\_Submittal\_20220404142432.pdf

Page 1 of 2

Well Location: T24N / R5W / SEC 20 / County or Parish/State: RIO

SESE / 36.293664 / -107.378593

Well Number: 2 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

WELL JICARILLA APACHE

ARRIBA / NM

Lease Number: JIC11 Unit or CA Name: Unit or CA Number:

US Well Number: 3003905362 Well Status: Producing Gas Well Operator: DJR OPERATING LLC

# **Conditions of Approval**

#### **Specialist Review**

General\_Requirement\_PxA\_20220404173018.pdf

24N5W20\_Jicarilla\_Apache\_B\_2\_KGR\_20220404173004.pdf

2665183\_NOIA\_B\_2\_3003905362\_KR\_03312022\_20220404172946.pdf

## **Operator Certification**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: SHAW-MARIE FORD Signed on: APR 04, 2022 02:24 PM

Name: DJR OPERATING LLC

Title: Regulatory Specialist

Street Address: 1 Road 3263

City: Aztec State: NM

Phone: (505) 632-3476

Email address: sford@djrllc.com

# **Field Representative**

**Representative Name:** 

**Street Address:** 

City: State: Zip:

Phone:

**Email address:** 

### **BLM Point of Contact**

Signature: Kenneth Rennick

BLM POC Name: KENNETH G RENNICK BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742 BLM POC Email Address: krennick@blm.gov

**Disposition:** Approved **Disposition Date:** 04/04/2022

#### **Plug and Abandonment Procedure**

for

DJR Operating, LLC

Jicarilla Apache B 2

API # 30-039-05362

SE/SE, Unit P, Sec. 20, T24N, R5W

#### I.

1. Hold pre-job meeting, comply with all NMOCD, BLM and environmental regulations.

Rio Arriba County, NM

- 2. Check and record tubing, casing and bradenhead pressures.
- 3. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.
- 4. Trip out of hole with rods and pump. Lay down to be sent in for storage/salvage.
- 5. ND WH, NU BOP, function test BOP.
- 6. Trip out of hole with 1" (or possibly 2-3/8") tubing. LD tubing to be sent in for storage/salvage.

#### II.

- 7. PU workstring, TIH with bit and scraper, make sure that the bit and scraper will go below 2270'. TOOH.
- 8. PU and TIH with 5-1/2" CR. Set the CR at 2270'. Pressure test tubing to 1000 psi, sting out of CR, test casing to 600 psi. If casing does not test, contact engineering.
- 9. RU cement equipment. Pump water to assure that tubing is clear.
- 10. Plug 1. Pictured Cliffs: Establish rate. Mix and attempt to squeeze 25 sx cement through CR. If zone pressures up, sting back out of CR. Pump water to ensure tubing is clear. TOOH.

- 11. MIRU logging truck. Roll hole. Run CBL from CR to surface. Electronic copy of CBL to be sent to Ken Rennick <a href="mailto:krennick@blm.gov">krennick@blm.gov</a>, Monica Kueling <a href="mailto:monica.kueling@state.nm.us">monica.kueling@state.nm.us</a>, Loren Diede <a href="mailto:ldiede@djrllc.com">ldiede@djrllc.com</a>, and Scott Lindsay <a href="mailto:slindsay@djrllc.com">slindsay@djrllc.com</a>. Plugs may be adjusted per log results.
- 12. Plug 2. Fruitland, Kirtland, and Ojo Alamo: Spot plug on top of CR from 2270-1706'. Pump water to ensure tubing is clear.
- 13. Plug 3. Nacimiento: Perf holes at 1060'. Set CR at 1010'. Mix and pump sufficient volume to bring TOC to 960' inside and outside.
- 14. Plug 4. Surface casing shoe and surface plug: RIH with wireline. Perforate holes at 190'. Tie onto 5-1/2" casing. Establish rate. Mix and pump sufficient cement to bring cement to surface inside and outside 5-1/2" casing.
- 15. RD cementing equipment. Cut off wellhead, fill annuli with cement, as necessary.


  Install SURFACE P&A marker as per BIA requirements. Record GPS coordinates for P&A marker and the final P&A report. Photograph the P&A marker and attach to the report.
- 16. RD and MO all rig and cement equipment. Assure that location is free of trash and contamination before moving off.
- 17. Send all reports and attachments to DJR Aztec office for regulatory filings.

Note: All cement is to be Class G mixed at 15.8 ppg yield 1.15 cu. Ft./sk. Cement volumes are based on inside capacities +50' and outside capacities + 100% excess.

Surface PxA marker is to be installed at surface, 12"x18", and exposed at the reclaimed GL surface.

DJR Operating, LLC Current Wellbore Diagram Jicarilla Apache B 2 API # 30-039-05362 SE/SE, Unit P, Sec 20, T24N, R5W Rio Arriba County, NM

GL 6662' KB 6669' Spud Date 8/21/1955

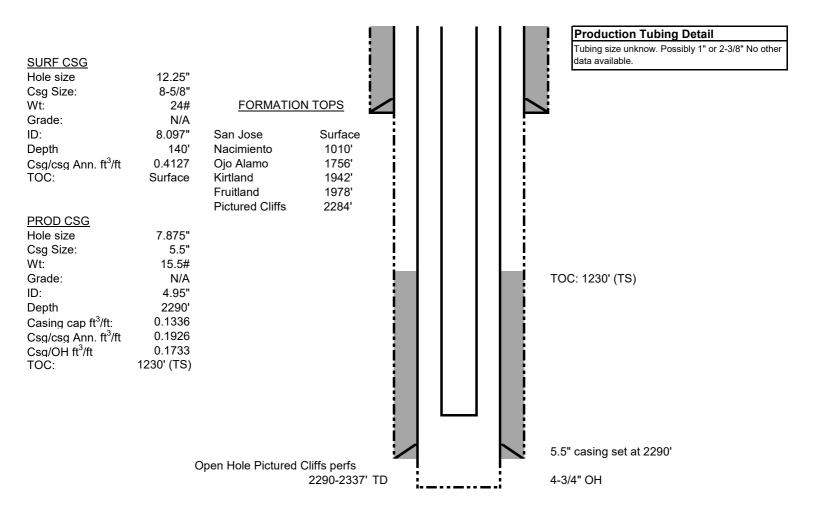

# DJR Operating, LLC Proposed Wellbore Diagram Jicarilla Apache B 2 API # 30-039-05362 SE/SE, Unit P, Sec 20, T24N, R5W Rio Arriba County, NM

GL 6662' KB 6669' Spud Date 8/21/1955

SURF CSG Hole size Csg Size: Wt: Grade: ID: Depth casing cap ft³/ft: TOC:  PROD CSG Hole size	12.25" 8-5/8" 24# N/A 8.097" 140' 0.4127 Surface	FORMATION San Jose Nacimiento Ojo Alamo Kirtland Fruitland Pictured Cliffs	ON TOPS Surface 1010' 1756' 1942' 1978' 2284'			Plug 4: Surface casing and surface plug: Perf holes at 190'. Tie onto 5-1/2" casing and mix and pump sufficient volume to bring TOC to surface, inside and outside.  Plug 3: Nacimiento: Perf holes at 1060'. Set CR at 1010'. Mix and pump sufficient volume to bring TOC to 960' inside and
Csg Size:	5.5"			<u> </u>		outside.
Wt:	15.5#			<u> </u>		
Grade:	N/A			!		TOC 1230' (TS)
ID:	4.95"			1		
Depth	2290'			3		
casing cap ft <sup>3</sup> /ft:	0.1336			ì	i i	Plug 2: Run CBL. Fruitland, Kirtland, Ojo
Csg/csg Ann. ft3/ft	0.1926			: :		Alamo: Spot plug on top of CR from 2270-
Csg/OH ft3/ft TOC:	0.1733					1706'
100.	1230' (TS)					Plug 1: Pictured Cliffs: Set CR at 2270'.
						Sqz below CR with 25 sx.
						OUZ DEIOW OIL WILLI 23 SX.
	0	pen Hole Pictured	Cliffs nerfs			5.5" casing set at 2290'
	O	pon noio i lotureu	2290-2337	" TD		4-3/4" OH

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2665183

Attachment to notice of Intention to Abandon

Well: Jicarilla Apache B 2

#### **CONDITIONS OF APPROVAL**

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 4/4/2022

# GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
  - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
  - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
  - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
  - 4.1 The cement shall be as specified in the approved plugging plan.
  - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.3 Surface plugs may be no less than 50' in length.
  - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
  - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
  - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
  - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
  - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
  - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
  - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
  - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain  $H_2S$ .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

# BLM FLUID MINERALS P&A Geologic Report

**Date Completed:** 04/04/2022

Well No. Jicarilla Apache B 2	ell No. Jicarilla Apache B 2 (API# 30-039-05362)				
Lease No. JIC11	Sec. 20	T24N		R5W	
Operator DJR Operating, L	LC	County	Rio Arriba	State	New Mexico
Total Depth 2337'	PBTD NA	Formation	Pictured Cliffs		
Elevation (GL) 6662'		Elevation (KI	3) 6669'		

<b>Geologic Formations</b>	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					Surface/freshwater sands
Nacimiento Fm			1010		Possible freshwater sands
Ojo Alamo Ss			1756		Aquifer (possible freshwater)
Kirtland Shale			1942		
Fruitland Fm			1978		Coal/Gas/Possible water
Pictured Cliffs Ss			2284		Gas
Lewis Shale					
Chacra					Gas
Cliff House					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Gallup					O&G/Water
Greenhorn					
Graneros Shale					
Dakota Ss					O&G/Water

Remarks:

P & A

Reference Well:

- Open Hole Completion, Pictured Cliffs 2290-2337' (TD).

Prepared by: Kenneth Rennick

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

# **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 95937

#### **CONDITIONS**

Operator:	OGRID:
DJR OPERATING, LLC	371838
1 Road 3263	Action Number:
Aztec, NM 87410	95937
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
kpickford	CBL required	4/8/2022
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	4/8/2022
kpickford	Adhere to BLM approved COAs and plugs. See GEO report.	4/8/2022