
Submit 1 Copy To Appropriate District	t Office			
D: . : . Y (575) 202 (1(1		ew Mexico		Form C-103
<u>District I</u> - (575) 393-6161 1625 N. French Dr.,Hobbs, NM 88240	Energy, Minerals ar	nd Natural Resources	WELL API NO.	Revised July 18,2013
<u>District II - (575) 748-1283</u>		ATION DIVISION	30-025	-26503
811 S. First St., Artesia, NM 88210			5. Indicate Type of Lea	ase
<u>Disrtict III - (</u> 505) 334-6178 1000 Rio Brazos Rd. Aztec, NM 87410	1220 South S	St. Francis Dr.	STATE 🗸	FEE
<u>District IV - (</u> 505) 476-3460	Santa Fe,	NM 87505	6. State Oil & Gas Lea	se No.
1220 S. St. Francis Dr., Santa Fe, NM				796
	Y NOTICES AND REPORTS ON WEI		7. Lease Name or Unit	Agreement Name
*	OPOSALS TO DRILL OR DEEPEN OR PLUG B FOR PERMIT" (FORM C-101) FOR SUCH PRO			STATE 17 COM
			8. Well Number	N4
1. Type of Well: Oil Well 2. Name of Operator	Gas Well Other		9. OGRID Numer	01
2. Name of Operator	Apache Corporation			73
3. Address of Operator			10. Pool Name or Wild	
	Airpark Lane, Ste. 3000, Midland,	TX 79705	NORTH VA	CUUM ABO
4. Well Location	D (60 C (6 1	NT 1' 1	660 6 6	***
Unit Letter Section	D : 660 feet from th 17 Township 17S	N line and Range 35E	660 feet from t NMPM	W line County LEA
Section	11. Elevation (Show whether I		INIVIEWI C	County LEA
	3987.7'G			
12	. Check Appropriate Box To Indica	te Nature of Notice. Re	port, or Other Data	
			•	OF.
PERFORM REMEDIAL WORK	F INTENTION TO:  PLUG AND ABANDON	REMEDIAL WORK	SEQUENT REPORT	OF: G CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	=	
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT JOB		Ш
DOWNHOLE COMMINGLE				
CLOSED-LOOP SYSTEM				
OTHER:		OTHER:		
	empleted operations. (Clearly state a			
	d work.) SEE RULE 19.15.7.14 NM	IAC. For Multiple Con	npletions: Attach wel	lbore diagram or
proposed completion or reco	ompletion.			
Apache Corporation prog	ooses to P&A the above mentioned	d well by the attached	procedure. A close	d loop system will
	fluids from this wellbore and disp	_	-	
4" diameter 4' tall Ab	oove Ground Marker			
		y and the second se	SEE ATTACHED CC	NDITIONS
		•	OF APPROVAL	
Spud Date:		Rig Release Date:		
Spaa Date.		rig release Bate.		
I hereby certify that the info	rmation above is true and complete	to the best of my knowl	edge and belief.	
, ,	1	,		
SIGNATURE	Guinn Burks TITLE	Sr. Reclamation Fo	oreman DATE	2/19/22
Type or print name	Guinn Burks E-mail add.	guinn.burks@apache	corp.com PHONE:	432-556-9143
For State Use Only		Jansarrio(w/apaorio	11101112.	300 0170
~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~	Mu Forther TITLE	Committee Off	or A DATE	E/E/00
APPROVED BY:	7.00	Compliance Office	er A DATE _	5/5/22
Conditions of Approval (if any)	. <i>o</i>	575-263-6633		



WELL BORE INFO.

LEASE NAME	Marathon Sec 17 State Com	2 "8"
WELL#	#001	
API#	30-025-26503	
COUNTY	LEA, NM	

DEPTH SX/CMT

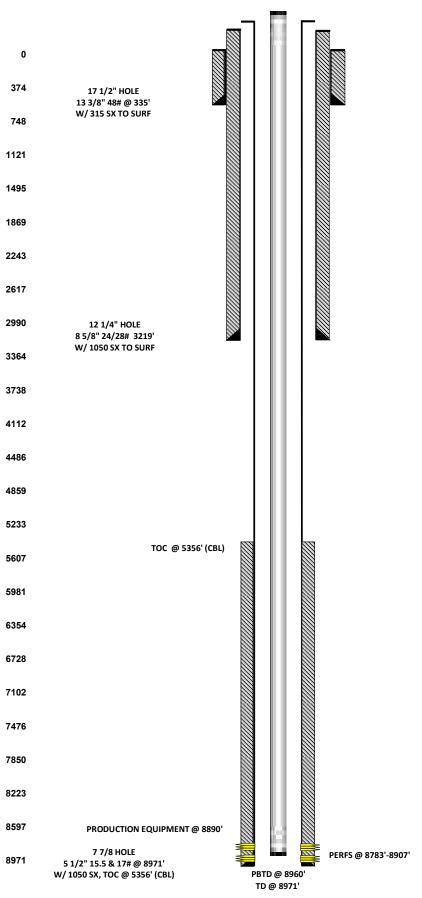

 WELL #
 #001

 API #
 30-025-26503

 COUNTY
 LEA, NM

PROPOSED PROCEDURE

**TUBB** 

MIRU P&A RIG. POOH & LD PRODUCTION EQUIPMENT.

RIH W/ WL & SET CIBP. RIH W/ TBG, CIRC W/ MLF & SPOT

**ABO** 

PLUG #01.

CLASS "C" CMT.

WELL BORE INFO. DEPTH SX/CMT

**SURF** 0 120 SX PUH & PERF, EPIR & SQZ/CIRC 5 1/2" TO SURF W/CLASS "C" CMT, FILL UP. 374 17 1/2" HOLE 13 3/8" 48# @ 335' 385' SURFACE SHOE, WATER BOARD, W/ 315 SX TO SURF 748 & SURFACE PLUG 1121 1495 PLUG #6. 1869 1850' 60 SX PUH & PERF, EPIR & SQZ CLASS "C" CMT, WOC/TAG 2050' 2243 TOP OF SALT (SALT MAP) 2617 2990 12 1/4" HOLE **PLUG #5.** 8 5/8" 24/28# 3219' 3069' 60 SX PUH & PERF, EPIR & SQZ CLASS "C" CMT, WOC/TAG 3269' W/ 1050 SX TO SURF 3364 **INTERM SHOE** 3738 4020' 4112 PLUG #4. 220 SX PUH & PERF, EPIR & SQZ CLASS "C" CMT, WOC/TAG 4486 4814' **SAN ANDRES & QUEEN** 4859 5233 TOC @ 5356' (CBL) 5607 5981 **PLUG #3.** 6090' 25 SX PUH & SPOT CLASS "C" CMT, WOC/TAG 6290' 6354 **GLORIETA** 6728 7102 7476 7440' 25 SX PLUG #2. 7640' PUH & SPOT CLASS "C" CMT.

8725'

PERFS @ 8783'-8907'

PBTD @ 8960' TD @ 8971' 25 SX

7 7/8 HOLE

5 1/2" 15.5 & 17# @ 8971'

W/ 1050 SX, TOC @ 5356' (CBL)

PRODUCTION EQUIPMENT @ 8890'

7850

8223

8597

8971

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

## Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

## DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

#### SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

#### SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

COMMENTS

Action 93831

#### **COMMENTS**

Operator:	OGRID:
APACHE CORPORATION	873
303 Veterans Airpark Ln	Action Number:
Midland, TX 79705	93831
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### COMMENTS

Created B	Comment	Comment Date
plmartir	ez DATA ENTRY PM	5/9/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

# **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 93831

#### **CONDITIONS**

Operator:	OGRID:
APACHE CORPORATION	873
303 Veterans Airpark Ln	Action Number:
Midland, TX 79705	93831
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
kfortner	See attached conditions of approval	5/5/2022