
Form 3160-5 (August 2007)


UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB No. 1004-0137 Expires: July 31, 2010

BURI	EAU OF LAND MANA	AGEMENT			5. Lease Serial No. NMNM68039	
Do not use this fo	OTICES AND REPO orm for proposals to Use Form 3160-3 (AF	o drill or to	re-enter an	,	6. If Indian, Allottee o	r Tribe Name
	IN TRIPLICATE - Other i	instructions on	page 2.		7. If Unit of CA/Agree	ement, Name and/or No.
1. Type of Well ✓ Oil Well Gas W	ell Other				8. Well Name and No.	
2. Name of Operator DEVON ENERGY PRODUCTION C					ALLIED 7 FEDERAL 9. API Well No. 30-015-25973	L 4
3a. Address 333 West Sheridan Avenue, Oklahoma City, OK	73102-5015	3b. Phone No. (include area cod	de)	10. Field and Pool or I SHUGART, N. (BO)	
4. Location of Well (Footage, Sec., T.,F. 1980 FNL 660 FEL SEC 7 T18S R31E		405-228-3047			11. Country or Parish, EDDY, NM	<u> </u>
	K THE APPROPRIATE BOX	X(ES) TO INDIC	 CATE NATURI	E OF NOTIC		ER DATA
TYPE OF SUBMISSION		()		PE OF ACTI		
Notice of Intent	Acidize Alter Casing	Deeper Fractur	n re Treat	=	action (Start/Resume)	Water Shut-Off Well Integrity
Subsequent Report	Casing Repair		Construction	=	mplete	Other
Final Abandonment Notice	Change Plans Convert to Injection	Plug ar	nd Abandon ack	_ `	oorarily Abandon r Disposal	
Attach the Bond under which the w following completion of the involve testing has been completed. Final Adetermined that the site is ready for 1. MIRU P&A unit. 2. Pull rod pump and 2-7/8" productions. Set CIBP @ 7675'. Tag. Circ 10#4. Spot 25 sx CI H from 7675'-7500'. Pump 25 sx CI C from 5000-4775'. Pump 85 sx CI C from 3125'-2370'. Perf @ 1560'. R. Pump 375 sx CI C from 1560' to 69. Perf @ 47'. Pump 25 sx CI C from 47' to surf 11. Cut WH off 3' BGL, Set dry hole. Integrate the following into above plan: - Yates@2089:25sx from 2139' to 2018'. Ensure cement to surface inside 5.5" caperf and squeezed if 375sx plug cannot be Tag and verify depth of all plugs.	ed operations. If the operation Abandonment Notices must be final inspection.) on tubing assembly from ~ salt gel. Leak test. (Perfs @ 7728') '. WOC & tag. (T. Bone Sp.) '. WOC & tag. (T. Delaward) O'. (Shoe @ 469'; B. Salt @ face. marker. sing and 5.5"-8.625" annulus e circulated to surface in the 5	on results in a muse filed only after -8,400'. orings @ 4916' re @ 2972') @ 1507'; T. Sal	ultiple completion all requirement) t @ 673')	n or recompl	letion in a new interval reclamation, have been	, a Form 3160-4 must be filed once completed and the operator has Digitally signed by KEITH IMMATTY Date: 2022.05.07 11:16:33-06'00'
 I hereby certify that the foregoing is tr Name (<i>Printed/Typed</i>) Karsan Sprague 	ue and correct.		Title Production	on Enginee	r	
Kanan Si					•	
Signature / William Sp		I	Date 04/26/20			
Accepted for record – NMOCD gc 5/9/202	THIS SPACE I	FOR FEDER	RAL OR ST	ATE OFF	FICE USE	
Approved by			T:41-		,	Data
Conditions of approval, if any, are attached that the applicant holds legal or equitable ti entitle the applicant to conduct operations t	tle to those rights in the subject				ا ا	Date
Title 18 U.S.C. Section 1001 and Title 43 U			son knowingly ar	nd willfully to	make to any departmen	nt or agency of the United States any false.

(Instructions on page 2)

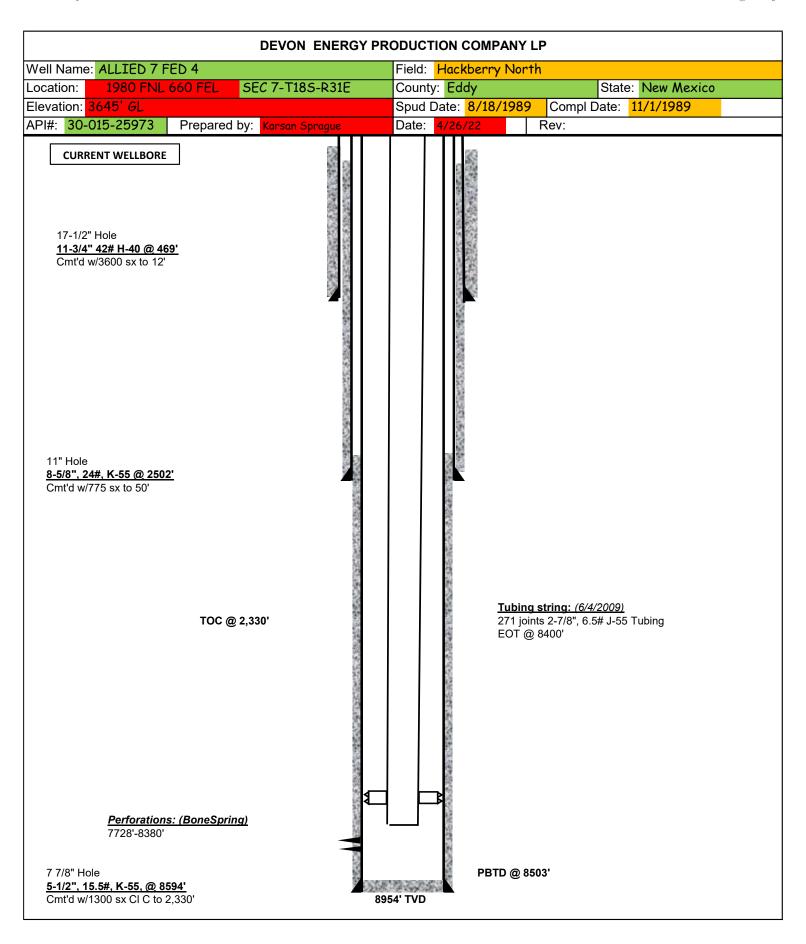

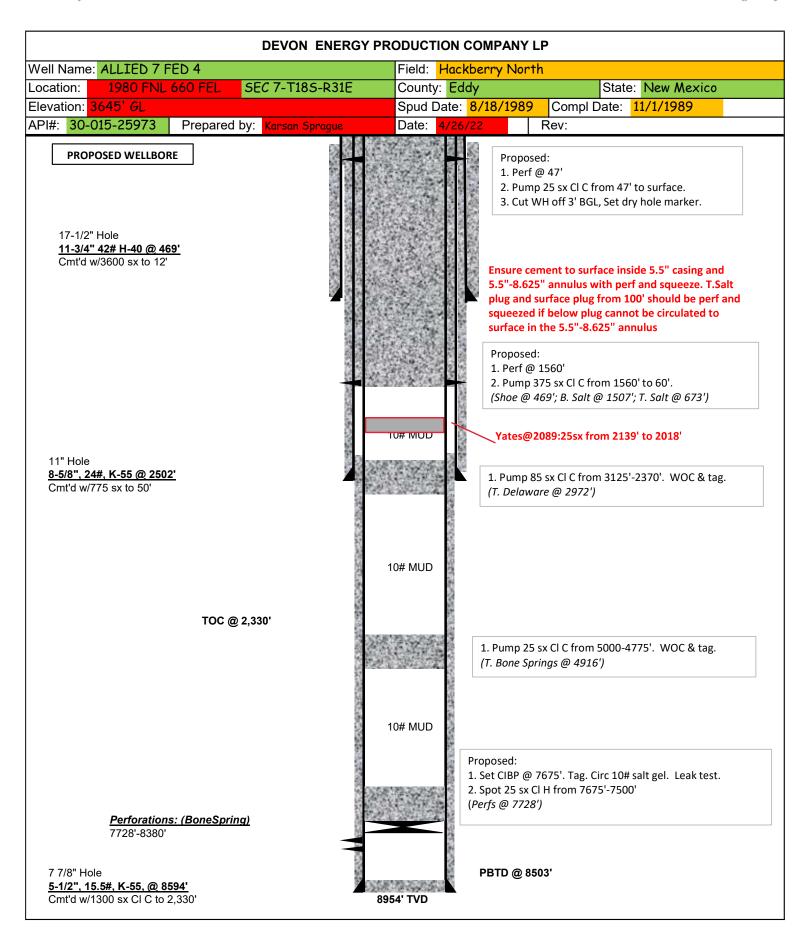

Sundry ID 2668715

Sundry ID	2668715					
Plug Type	Тор	Bottom	Length	Tag	Sacks	Notes
Surface Plug	0.00	100.00	100.00	Tag/Verify	375.00	Same as BOS plug
Shoe Plug	414.31	519.00		Tag/Verify		Same as BOS plug
Top of Salt @ 673	616.27	723.00	106.73	Tag/Verify	375.00	Same as BOS plug
						. •
Base of Salt @ 1507	1441.93	1557.00	115.07	Tag/Verify	375.00	
				If solid		
				base no		
				need to		
				Tag		
				(CIBP		
				present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak		
				Test all		
				CIBP if no		
				Open		
				Perforatio		
Yates @ 2089	2018.11	2139.00	120.89		25.00	
1 ates @ 2003	2010.11	2100.00	120.03	110	20.00	Same as delaware
Shoe Plug	2426.98	2552.00	125.02	Tag/Verify	85.00	plug
				lf a alial		
				If solid		
				base no		
				need to		
				Tag		
				(CIBP		
				present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak		
				Test all		
				CIBP if no		
				Open		
				Perforatio		
Delaware @ 2972	2892.28	3022.00	129.72	ns	85.00	

				If solid		
				base no		
				need to		
				Tag		
				(CIBP		
				,		
				present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak		
				Test all		
				CIBP if no		
				Open		
				Perforatio		
Bonesprings @ 4916	4816.84	4966.00	149.16	ns	25.00	
						
. 5 5				If solid		
. 5 5				If solid base no		
				If solid base no need to		
				If solid base no need to Tag		
				If solid base no need to Tag (CIBP		
				If solid base no need to Tag (CIBP present		
				If solid base no need to Tag (CIBP present and/or		
				If solid base no need to Tag (CIBP present and/or Mechanic		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf &		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no		
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open		
CIBP Plug	7640.00			If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio		Test to 500psi, 30mins

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Critical, High, Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water.

R111P: 50' from bottom of salt to surface

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2 III G Drilling Abandonment Requirements: "All formations bearing usable-quality water

oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Medium Top o	f Salt to surface	
Shoe @	469.00		
Shoe @	2502.00		
Shoe @	8594.00		
Perforatons Top @	7728.00	Perforations	8380.00
		CIBP @	7675.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 105134

CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	105134
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	None	5/9/2022