
	State of New N	Mexico	Form C	Page 1 of 3 -103
Office <u>District I</u> – (575) 393-6161	Energy, Minerals and Na	tural Resources	Revised July 18, 2013	
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283			WELL API NO. 30-015-31149	
811 S. First St., Artesia, NM 88210	OIL CONSERVATIO		5. Indicate Type of Lease	
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fr		STATE FEE	
<u>District IV</u> – (505) 476-3460	Santa Fe, NM	87505	6. State Oil & Gas Lease No.	
1220 S. St. Francis Dr., Santa Fe, NM 87505			VO4655	
	TICES AND REPORTS ON WEL		7. Lease Name or Unit Agreement Na	ame
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			Bandit State	
PROPOSALS.)			8. Well Number 2	
1. Type of Well: Oil Well Gas Well Other		9. OGRID Number		
2. Name of Operator Read & Stevens, Inc.			9. OGRID Nulliber 18917	
3. Address of Operator			10. Pool name or Wildcat	
PO Box 1518, Roswell, NI	M 88202		#77190, Frnt Hls Straw & #77193 l	Jpenn
4. Well Location	1000	20		
Unit Letter L	1980 feet from the South		0feet from the West	_line
Section 10		Range 26E	NMPM County Eddy	
	11. Elevation (Show whether L 3322 Gl	OR, RKB, RT, GR, etc. - 1 3342' RKB)	
12 Chack	Appropriate Box to Indicate	Nature of Notice	Papert or Other Data	
12. Check	Appropriate Box to indicate	rvature or rvotice,	Report of Other Data	
NOTICE OF II	NTENTION TO:	SUB	SEQUENT REPORT OF:	
PERFORM REMEDIAL WORK	 -	REMEDIAL WOR		_
TEMPORARILY ABANDON		COMMENCE DRI		
PULL OR ALTER CASING DOWNHOLE COMMINGLE		CASING/CEMEN	I JOB	
CLOSED-LOOP SYSTEM				
	<u> </u>		Decemblation	
OTHER:		OTHER:	Recompletion	\checkmark
OTHER: 13. Describe proposed or com		Il pertinent details, and	d give pertinent dates, including estimat	
OTHER: 13. Describe proposed or com of starting any proposed w	ork). SEE RULE 19.15.7.14 NM	Il pertinent details, and	.	
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re	completion.	ll pertinent details, and AC. For Multiple Con	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of	
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6	vork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tank	Il pertinent details, and AC. For Multiple Con	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine	ed date
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk	70rk). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tank be bbls for well control. Untorque 5Kx7	Il pertinent details, and AC. For Multiple Con Con Con Con Con Con Con Con Con Con	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of	ed date
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr.	Ork). SEE RULE 19.15.7.14 NM completion. On psi. Bleed tbg off to production tanker bbls for well control. Untorque 5Kx7 or and unset. Pkr dragging 8K over est	Il pertinent details, and AC. For Multiple Con. C. Csg 0 psi. RU PU. Pul/16 bolts off tree. Decid string weight until pulling	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on W g unit out of liner top (6 stands). Finish POOH	ed date H. w/2-3/8 tbg
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 moru Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csq w/fresh wtr for CBL run.	Vork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 or and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 P for 7" csg. Set @ 8714' (Top of Wolfe	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Pu. 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on eap plug) New PBTD. D	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 tr and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 of for 7" csg. Set @ 8714' (Top of Wolfd & tag PBTD. Pressure up to 1000 psik. Test ok. RIH w/tbg in derrick and later to the complete the set of the set	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Pul/16 bolts off tree. Decid string weight until pulling by Dump bail 35' cmt on ap plug) New PBTD. Dump log csg to 2470'(bot y down.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc	Vork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 or and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 P for 7" csg. Set @ 8714' (Top of Wolfe	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Pul/16 bolts off tree. Decid string weight until pulling by Dump bail 35' cmt on ap plug) New PBTD. Dump log csg to 2470'(bot y down.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 tr and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 of for 7" csg. Set @ 8714' (Top of Wolfd & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Pul/16 bolts off tree. Decid string weight until pulling by Dump bail 35' cmt on ap plug) New PBTD. Dump log csg to 2470'(bot y down.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 tr and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 of for 7" csg. Set @ 8714' (Top of Wolfd & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Pul/16 bolts off tree. Decid string weight until pulling by Dump bail 35' cmt on ap plug) New PBTD. Dump log csg to 2470'(bot y down.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 tr and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 of for 7" csg. Set @ 8714' (Top of Wolfd & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Pul/16 bolts off tree. Decid string weight until pulling by Dump bail 35' cmt on ap plug) New PBTD. Dump log csg to 2470'(bot y down.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 tr and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 of for 7" csg. Set @ 8714' (Top of Wolfd & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Pul/16 bolts off tree. Decid string weight until pulling by Dump bail 35' cmt on ap plug) New PBTD. Dump log csg to 2470'(bot y down.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 or and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 or 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psik. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Put 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on cap plug) New PBTD. Dump and log csg to 2470'(boty down. C. SI pending recomplete.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool. etion evaluation.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 or and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 or 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psik. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Put 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on cap plug) New PBTD. Dump and log csg to 2470'(boty down. C. SI pending recomplete.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU	Jork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 or and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 or 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psik. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State	Il pertinent details, and AC. For Multiple Cond. C. Csg 0 psi. RU PU. Put 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on cap plug) New PBTD. Dump and log csg to 2470'(boty down. C. SI pending recomplete.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill ttom of intermediate shoe). LD logging tool. etion evaluation.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBI csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU Spud Date: 1/7/2002 & 6/26	Cork). SEE RULE 19.15.7.14 NM completion. Of psi. Bleed tbg off to production tanker bbls for well control. Untorque 5Kx7 for and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 or for 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State	Il pertinent details, and AC. For Multiple Con AC. For Multiple Con II. Csg 0 psi. RU PU. Pti 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on cap plug) New PBTD. Dand log csg to 2470'(bot y down. Sand Sand II. Sand II. Sand III. Sand	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill tom of intermediate shoe). LD logging tool. etion evaluation.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU	Cork). SEE RULE 19.15.7.14 NM completion. Of psi. Bleed tbg off to production tanker bbls for well control. Untorque 5Kx7 for and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 or for 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State	Il pertinent details, and AC. For Multiple Con AC. For Multiple Con II. Csg 0 psi. RU PU. Pti 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on cap plug) New PBTD. Dand log csg to 2470'(bot y down. Sand Sand II. Sand II. Sand III. Sand	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 bump bail 35' cmt on top. RD WL. Top fill tom of intermediate shoe). LD logging tool. etion evaluation.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU Spud Date: 1/7/2002 & 6/26	Cork). SEE RULE 19.15.7.14 NM completion. 00 psi. Bleed tbg off to production tanke bbls for well control. Untorque 5Kx7 tr and unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 P for 7" csg. Set @ 8714" (Top of Wolfd & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and lask tree. RDPU & move to Bandit State	Il pertinent details, and AC. For Multiple Con AC. For Multiple Con II. Csg 0 psi. RU PU. Pu 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on pap plug) New PBTD. Dand log csg to 2470'(bot y down. 23. SI pending recomples Date: 1/15/2002	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill tom of intermediate shoe). LD logging tool. etion evaluation.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBI csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU Spud Date: 1/7/2002 & 6/26 I hereby certify that the information SIGNATURE Kelly Bax	Cork). SEE RULE 19.15.7.14 NM completion. Oo psi. Bleed tbg off to production tanker bbls for well control. Untorque 5Kx7 is rand unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 P for 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State of the state of	Il pertinent details, and AC. For Multiple Con AC. For Multiple Con II. Csg 0 psi. RU PU. Pti 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on cap plug) New PBTD. Dand log csg to 2470'(bot y down. Sand Sand II. Sand II. Sand III. Sand	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill tom of intermediate shoe). LD logging tool. etion evaluation.	ed date H. I w/2-3/8 tbg 0' (TOL plug).
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBI csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU Spud Date: 1/7/2002 & 6/26 I hereby certify that the information SIGNATURE Kelly Bax	Cork). SEE RULE 19.15.7.14 NM completion. Oo psi. Bleed tbg off to production tanker bbls for well control. Untorque 5Kx7 is rand unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 P for 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State of the state of	Il pertinent details, and AC. For Multiple Con AC. For Multiple Con II. Csg 0 psi. RU PU. Pt 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on app plug) New PBTD. Dand log csg to 2470'(bot y down. Date: 1/15/2002 best of my knowledg	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill tom of intermediate shoe). LD logging tool. etion evaluation.	H. I w/2-3/8 tbg O' (TOL plug). Close BOP
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBF csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU Spud Date: 1/7/2002 & 6/26	Cork). SEE RULE 19.15.7.14 NM completion. Oo psi. Bleed tbg off to production tanker bbls for well control. Untorque 5Kx7 is rand unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 P for 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State of the state of	Il pertinent details, and AC. For Multiple Con AC. For Multiple Con II. Csg 0 psi. RU PU. Pt 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on app plug) New PBTD. Dand log csg to 2470'(bot y down. Date: 1/15/2002 best of my knowledg	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill bettom of intermediate shoe). LD logging tool. etion evaluation. 2 & 9/8/2000 The and belief. DATE 7/11/2022	H. I w/2-3/8 tbg O' (TOL plug). Close BOP
OTHER: 13. Describe proposed or com of starting any proposed w proposed completion or re 3/29/2021: Notify FAA of RU. SITP 6 & well on a vacuum. Pumped 45 more Unscrew tree & NU 5K BOP. Work pk & pkr. 3/30/2021: SICP 0 psi. RU WL. RIH Dump bail 35' cmt on top. RIH w/CIBI csg w/fresh wtr for CBL run. 3/31/2021: SICP 0 psi. RU CBL. RIH blinds & test csg to 3000 psi w/kill truc 4/1/2021: SICP 0 psi. NDBOP & NU Spud Date: 1/7/2002 & 6/26 I hereby certify that the information SIGNATURE Kelly Baraja Type or print name Kelly Baraja	Cork). SEE RULE 19.15.7.14 NM completion. Oo psi. Bleed tbg off to production tanker bbls for well control. Untorque 5Kx7 is rand unset. Pkr dragging 8K over est w/CIBP for 4.5" csg. Set plug @ 1008 P for 7" csg. Set @ 8714' (Top of Wolfe & tag PBTD. Pressure up to 1000 psi k. Test ok. RIH w/tbg in derrick and la 5K tree. RDPU & move to Bandit State of the state of	Il pertinent details, and AC. For Multiple Con AC. For Multiple Con II. Csg 0 psi. RU PU. Put 1/16 bolts off tree. Decid string weight until pulling 5'. Dump bail 35' cmt on eap plug) New PBTD. Dand log csg to 2470'(bot y down. String and log recomples and log csg to 2470'(bot y down. String and log csg to 2470'(bot y down.	d give pertinent dates, including estimat mpletions: Attach wellbore diagram of umped 15 bbls 10# brine led to leave 7-1/16 5K to 10K WH spool on Wg unit out of liner top (6 stands). Finish POOH top. RIH w/CIBP for 7" csg. Set plug @ 961 brump bail 35' cmt on top. RD WL. Top fill bettom of intermediate shoe). LD logging tool. etion evaluation. 2 & 9/8/2000 The and belief. DATE 7/11/2022	H. I w/2-3/8 tbg O' (TOL plug). Close BOP

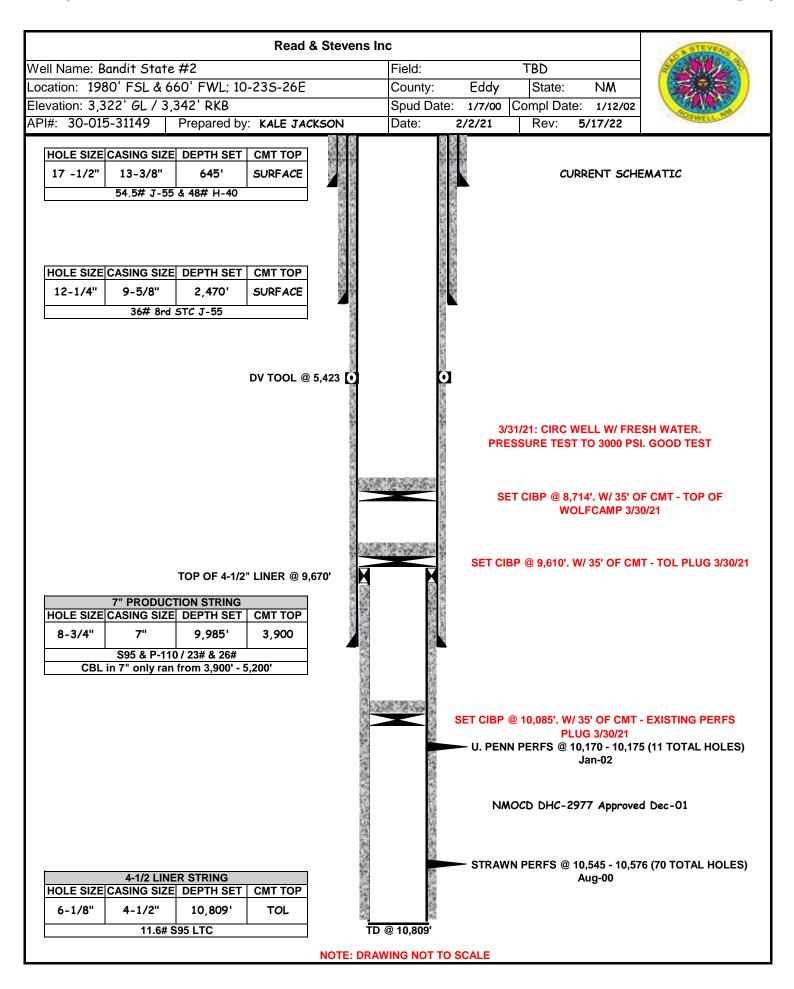

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 124045

CONDITIONS

Operator:	OGRID:
READ & STEVENS INC	18917
P.O. Box 1518 Roswell, NM 88202	Action Number: 124045
	Action Type: [C-103] Sub. Workover (C-103R)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	7/22/2022