Submit 1 Copy To Appropriate District

District I – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283 811 S. First St., Artesia, NM 88210

<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	1220 South St. Fran Santa Fe, NM 87	ncis Dr.	5. Indicate Type of Lease  STATE ☐ FEE ☐  6. State Oil & Gas Lease No.
	ND REPORTS ON WELLS		7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DIFFERENT RESERVOIR. USE "APPLICATION I PROPOSALS.)	FOR PERMIT" (FORM C-101) FO		McAlester State 8. Well Number #1
1. Type of Well: Oil Well Gas We	ell Other		
2. Name of Operator			9. OGRID Number 190595
Endeavor Energy Resources, LP  3. Address of Operator			10. Pool name or Wildcat
110 North Marienfeld, Suite 200, Midlan	id, TX 79701		Topac Penn
4. Well Location			
Unit Letter 0 : 1980	feet from theE	_line and660	feet from the S line
Section 20 Townsl			NMPM County Chavez
	levation (Show whether DR)		
	4394		
The second secon			***************************************
12. Check Approp	oriate Box to Indicate N	ature of Notice,	Report or Other Data
			•
NOTICE OF INTENT		I .	SEQUENT REPORT OF:
	GAND ABANDON ⊠ NGE PLANS □	REMEDIAL WOR	
_	TIPLE COMPL	CASING/CEMEN	
DOWNHOLE COMMINGLE	III CL COMIT C	OAGINO/OLIVILIN	. 1005
CLOSED-LOOP SYSTEM			
OTHER:		OTHER:	
<ol> <li>Describe proposed or completed op of starting any proposed work). SE proposed completion or recompletion</li> </ol>	EE RULE 19.15.7.14 NMAG	pertinent details, and C. For Multiple Con	d give pertinent dates, including estimated date impletions: Attach wellbore diagram of
<ol> <li>Set CIBP @ 8922'. Spot 25 st</li> <li>Perf &amp; Sqz 30 sx class H cmt</li> <li>Perf &amp; Sqz 30 sx class C cmt</li> <li>Perf &amp; Sqz 40 sx class C cmt</li> <li>Perf &amp; Sqz 45 sx class C cmt</li> <li>Perf &amp; Sqz 45 sx class C cmt</li> <li>Perf &amp; Sqz 45 sx class C cmt</li> </ol>	a @ 8200-8100'. WOC & tag @ 6500-6400'. WOC & tag @ 3664-3564'. WOC & T @ 1200-1100'. WOC & T @ 419-319'. WOC & Tag @ 150' to surface.	ag (Shoe) ag (Shoe)	
8. Cut off wellhead, verify cmt	@ surface, weld on Below	Ground Dry Hole	Marker.
LPC area Below ground marker Take pics before	e before back filling	See attached	conditions of approval
Spud Date:	Rig Release Da	Note chan	ges to procedure
I hereby certify that the information above is	s true and complete to the h	est of my knowledg	e and belief.
and the months above it			
SIGNATURE AND SE	TITLE Senio	or Regulatory Analyst	DATE 7/21/2022
Type or print name Jan South For State Use Only		s: <u>jsouth@eeronlir</u>	ne.com PHONE: 432-6871575
APPROVED BY: Yeary Forther Conditions of Approver (11 ans).	TITLE_ Co	mpliance of	ice A _DATE 7/25/22

State of New Mexico

Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

Form C-103

Released to Imaging: 7/25/2022 2:21:44 PM


Revised July 18, 2013

WELL API NO. 30-005-10039

Page 2 of 8

<b>Endeavor End</b>	ergy	PRO	POSED
Author:	Abby BCM		
Well Name	McAlester #1	Well No.	#1
Field/Pool	Tobac Penn	 API #:	30-005-10039
County	Chavez	Location:	Sec 20, T8S, R33E
State	NM		1980 FEL & 660 FSL
Spud Date	9/11/1964	GL:	4394

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	13 3/8		48#	369	17 1/2	350	0
Inter Csg	8 5/8	J55	24#28#	3,614	11	350	unknown
Prod Csg	4 1/2	J55	11.6#	9,137	7 7/8	200	7300 TS

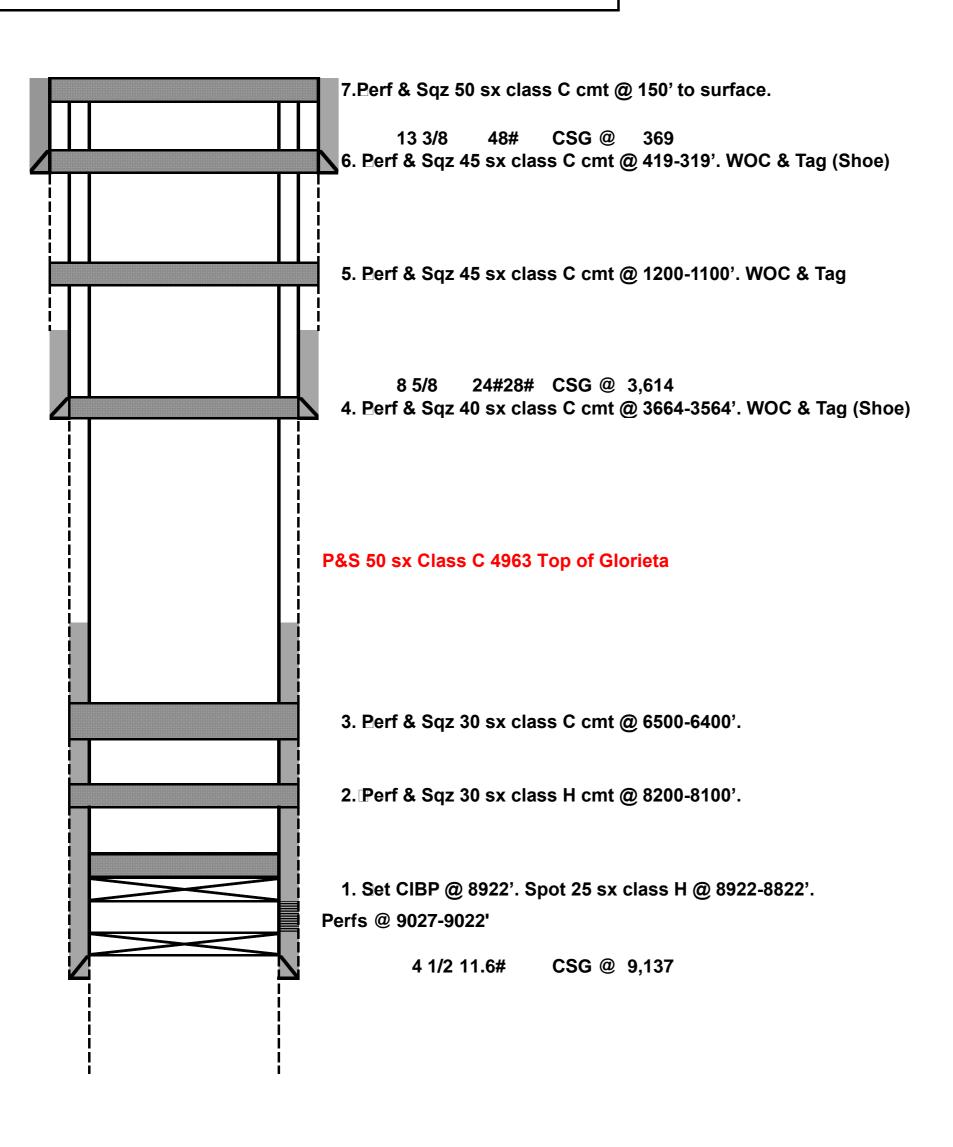

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

# Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

## SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS


In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

#### SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

Page 5 of 8

<b>Endeavor End</b>	ergy	CUF	RRENT
Author:	Abby BCM		
Well Name	McAlester #1	Well No.	#1
Field/Pool	Tobac Penn	API #:	30-005-10039
County	Chavez	Location:	Sec 20, T8S, R33E
State	NM		1980 FEL & 660 FSL
Spud Date	9/11/1964	GL:	4394

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	13 3/8		48#	369	17 1/2	350	0
Inter Csg	8 5/8	J55	24#28#	3,614	11	350	unknown
Prod Csg	4 1/2	J55	11.6#	9,137	7 7/8	200	7300 TS

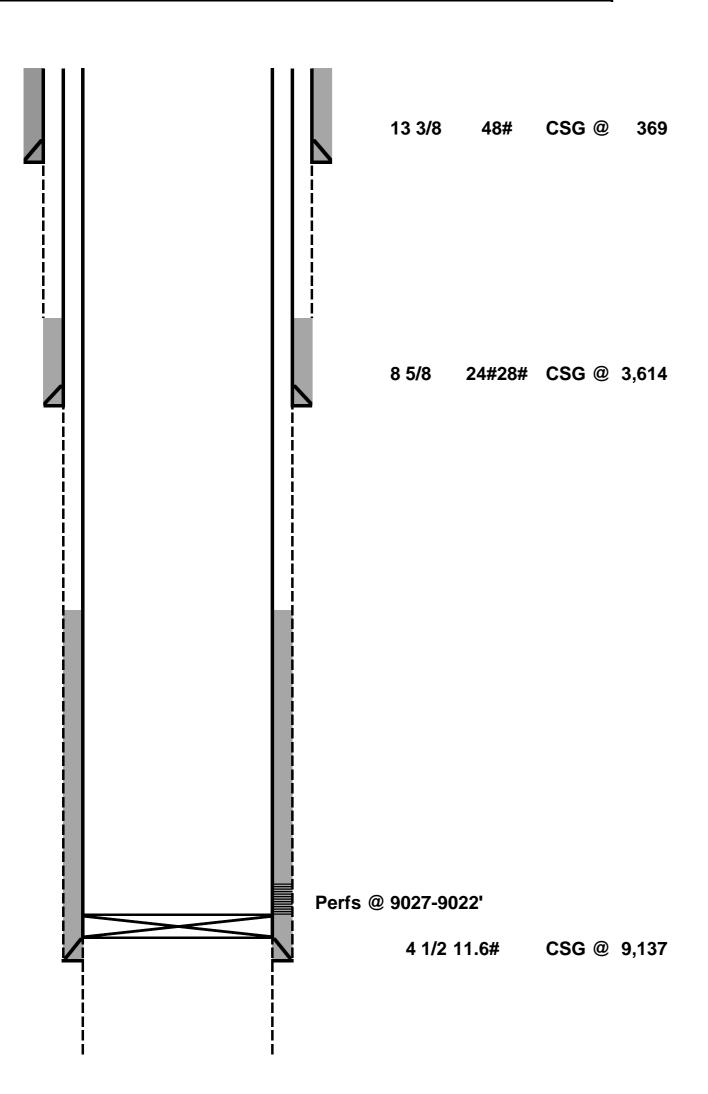


Formation	Тор
Anhy	1818
T/Salt	1845
B/Salt	2365
Yates	2365
Queen	3033
San Andre	3550
Glorieta	4963
Tubbs	6443
Abo	7340
Bough	9015

Page 6 of 8

<b>Endeavor End</b>	ergy	PRO	POSED
Author:	Abby BCM		
Well Name	McAlester #1	Well No.	#1
Field/Pool	Tobac Penn	API #:	30-005-10039
County	Chavez	Location:	Sec 20, T8S, R33E
State	NM		1980 FEL & 660 FSL
Spud Date	9/11/1964	GL:	4394

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	13 3/8		48#	369	17 1/2	350	0
Inter Csg	8 5/8	J55	24#28#	3,614	11	350	unknown
Prod Csg	4 1/2	J55	11.6#	9,137	7 7/8	200	7300 TS

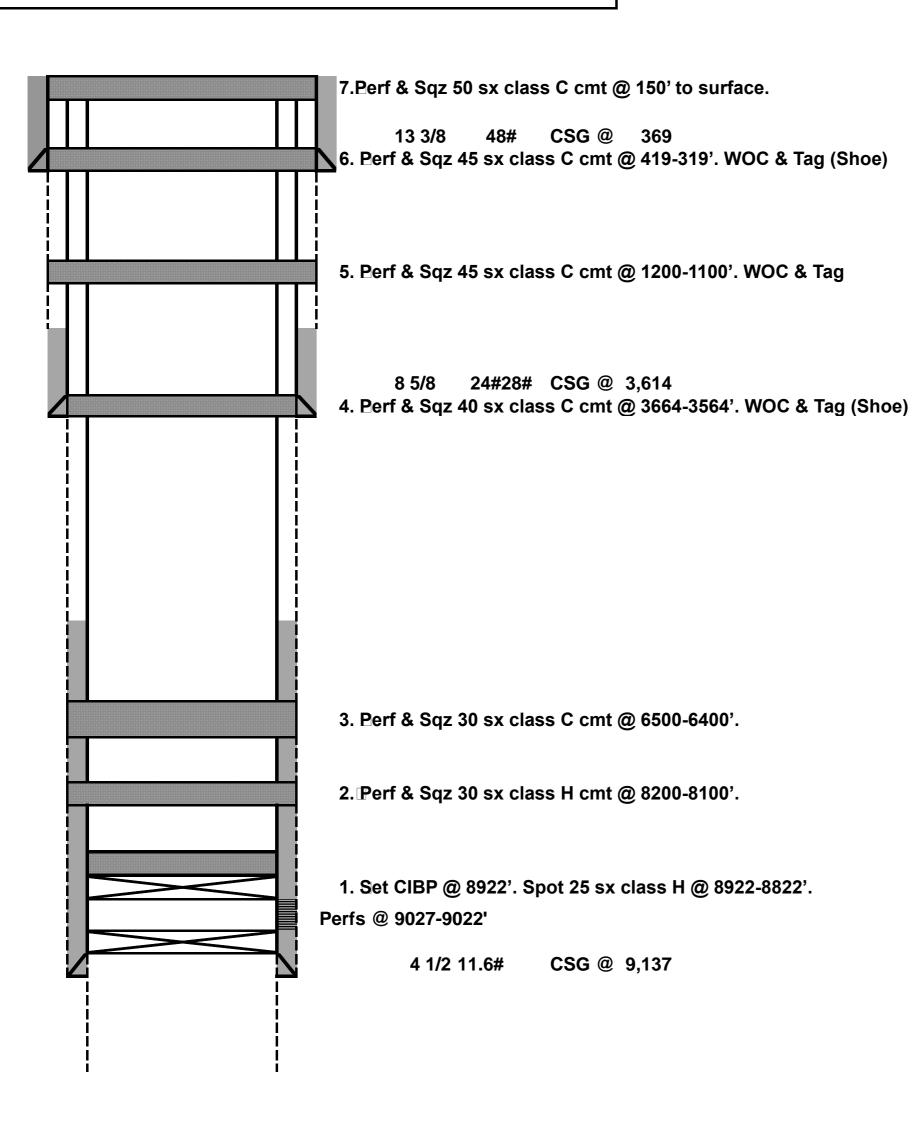

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

COMMENTS

Action 128053

#### **COMMENTS**

Operator:	OGRID:
ENDEAVOR ENERGY RESOURCES, LP	190595
110 North Marienfeld	Action Number:
Midland, TX 79701	128053
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### COMMENTS

Created By	Comment	Comment Date
plmartine	z DATA ENTRY PM.	7/25/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 128053

## **CONDITIONS**

Operator:	OGRID:
ENDEAVOR ENERGY RESOURCES, LP	190595
110 North Marienfeld	Action Number:
Midland, TX 79701	128053
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached COA Note changes to procedure	7/25/2022