

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Reports

Well Name: BUNNY ET AL Well Location: T27N / R9W / SEC 10 / County or Parish/State: SAN

SESE / 36.58531 / -107.77042 JUAN / NM

Well Number: 1 Type of Well: CONVENTIONAL GAS Allottee or Tribe Name:

WELL EASTERN NAVAJO

US Well Number: 3004506609 Well Status: Gas Well Shut In Operator: HILCORP ENERGY

COMPANY

# **Notice of Intent**

**Sundry ID:** 2681520

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 07/12/2022 Time Sundry Submitted: 11:13

Date proposed operation will begin: 07/26/2022

**Procedure Description:** Hilcorp Energy Company requests permission to P&A the subject well per the attached procedures, current and proposed wellbore schematics. The Pre-Disturbance Site Visit was held on 7/11/22 with Roger Herrera/BLM. The Re-Vegetation Plan is attached. A closed loop system will be used.

# **Surface Disturbance**

Is any additional surface disturbance proposed?: No

# **NOI Attachments**

# **Procedure Description**

 $Plug\_and\_Abandonment\_Procedure\_\_\_Bunny\_Et\_Al\_1\_20220712111303.pdf$ 

Bunny\_ET\_AL\_1\_Final\_Reclamation\_Plan\_20220712111248.pdf

Page 1 of 2

eceived by OCD: 7/22/2022 5:25:42 AM Well Name: BUNNY ET AL

Well Location: T27N / R9W / SEC 10 /

SESE / 36.58531 / -107.77042

County or Parish/State: SAN 2 of

JUAN / NM

Well Number: 1

Type of Well: CONVENTIONAL GAS

Allottee or Tribe Name: **EASTERN NAVAJO** 

Lease Number: I149IND8464

**Unit or CA Name:** 

**Unit or CA Number:** 

**US Well Number: 3004506609** 

Well Status: Gas Well Shut In

**Operator: HILCORP ENERGY** 

COMPANY

Zip:

# **Conditions of Approval**

# **Additional**

General\_Requirement\_PxA\_20220721175414.pdf

2681520\_NOIA\_1\_3004506609\_KR\_07212022\_20220721175359.pdf

27N09W10PKd\_Bunny\_et\_al\_1\_20220721130347.pdf

# **Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: KANDIS ROLAND Signed on: JUL 12, 2022 11:13 AM

Name: HILCORP ENERGY COMPANY

Title: Operation Regulatory Tech Street Address: 382 Road 3100

City: Farmington State: NM

Phone: (505) 599-3400

Email address: kroland@hilcorp.com

# **Field**

**Representative Name:** 

**Street Address:** 

City:

Phone:

**Email address:** 

# **BLM Point of Contact**

Signature: Kenneth Rennick

**BLM POC Name: KENNETH G RENNICK BLM POC Title:** Petroleum Engineer

**BLM POC Phone:** 5055647742 BLM POC Email Address: krennick@blm.gov

**Disposition:** Approved **Disposition Date:** 07/21/2022

State:

Page 2 of 2

# Plug and Abandonment - NOI Bunny Et Al 1 API # - 3004506609

#### Procedure:

Hold PJSM prior to beginning any and all operations. Properly document all operations via the JSA process. Ensure that all personnel onsite abide by HEC safety protocol, including PPE, housekeeping, and standard guidelines.

Verify cathodic protection is off and wellhead instrumentation is properly disconnected from the wellhead. Comply with all NMOCD, BLM, and HEC safety and environmental regulations.


Verify there is no H2S present prior to beginning operations. If any H2S is present, take the necessary actions to ensure that the location is safe prior to beginning operations.


Observe and record pressures across all string daily, prior to beginning operations. Remember to notify NMOCD 24 hours prior to starting operations on location.

NOTE: **This procedure is contingent upon P&A sundry approval by NMOCD**. All cement volumes use 100% excess outside pipe and 50' excess inside (unless otherwise stated). All cement will be Class G, mixed at 15.8 ppg w/ a 1.15 cf/sx yield. The stabilizing wellbore fluid will be an 8.3 ppg fluid, sufficient to balance all exposed formation pressures.

- 1. This project will use a steel tank to handle waste fluids circulated from the well and cement wash up.
- Test anchors if not using a base beam. Comply with all NMOCD, BLM, and HEC safety regulations. MIRU and conduct safety meeting for all personnel on location.
- 3. Record casing, tubing, and bradenhead pressures. Remove existing piping on casing valve. RU blow lines from casing valves and begin BD casing pressure. Kill well with water as necessary. Ensure well is dead or on a vacuum.
- 4. ND wellhead and NU BOP. Function test BOP. RU floor and 2 3/8" handling tools.
- 5. TOOH and tally 2-3/8" tubing inspecting each joint (6625').
- 6. TIH w/ CIBP and set at 6382'. Pump 4 sx of cement on top of plug to bring top to 6332' (Dakota Top: 6501' Dakota Perforations: 6432' 6670').
- 7. Load a roll the hole with fresh water and PT casing. TOOH and RU WL and run CBL from 6332' to surface. (Cemented in 2 stages and circulated to surface so assuming all inside plugs for procedure).
- 8. TIH open ended to 5597'.

- 9. Plug #2, 5597' 5497' (Gallup Top: 5547') Mix & pump 8 sx of Class G cement and spot a balanced plug to cover the Gallup top.
- 10. TOOH w/ tubing and RIH and set CIBP at 4307'. Pump 4 sx of cement on top of plug to bring top to 4257'. (Mesa Verde Top: 4356' Mesa Verde Perforations: 4357' 4399')
- 11.LD tubing to 2150'.
- 12. Plug #4, 2150' 1975' (Pictured Cliffs Top: 2100' Fruitland Coal Top: 2025') Mix & pump 14 sxs of Class G cement and spot a balanced plug to cover the Pictured Cliffs and Fruitland Coal tops.
- 13. LD tubing to 1324'.
- 14. Plug #5, 1324' 1110' (Kirtland Top: 1274' Ojo Alamo Top: 1160') Mix & pump 17 sxs of Class G cement and spot a balanced plug to cover the Kirtland and Ojo Alamo tops.
- 15. LD tubing to 389'.
- 16. Plug #6, 389' Surface' (Surface Shoe: 339') Mix & pump 31 sxs of Class G cement and spot a balanced plug to cover the surface casing shoe.
- 17. LD the rest of the tubing.
- 18. Ensure we have a good Bradenhead test where no communication is seen before cutting off the wellhead.
- 19. ND BOP and cut off wellhead below surface casing flange per regulation. Top off w/ cement if needed. Install PxA marker w/ cement to comply w/ regulations.
- 20. RD, MOL and cut off anchors. Restore location per BLM stipulations.

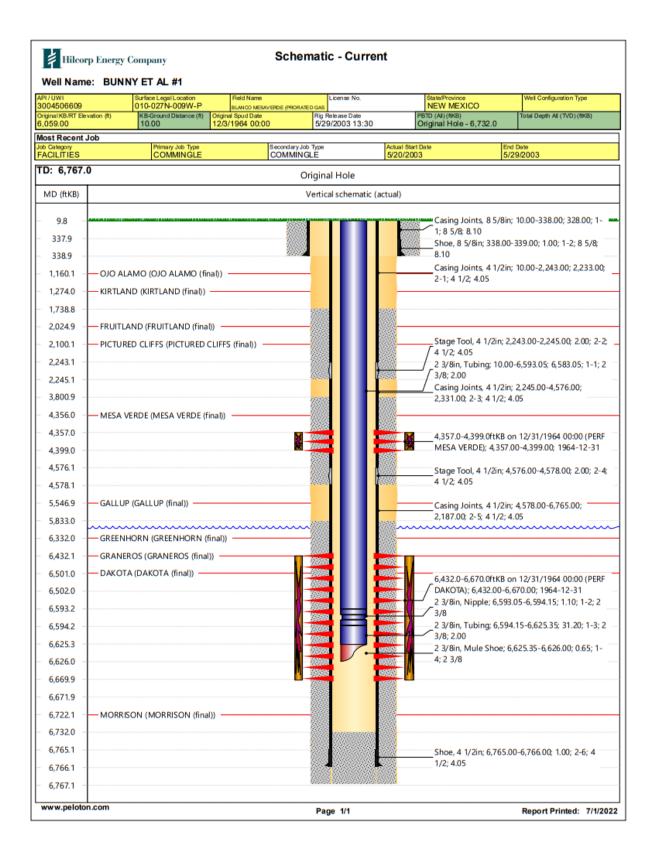

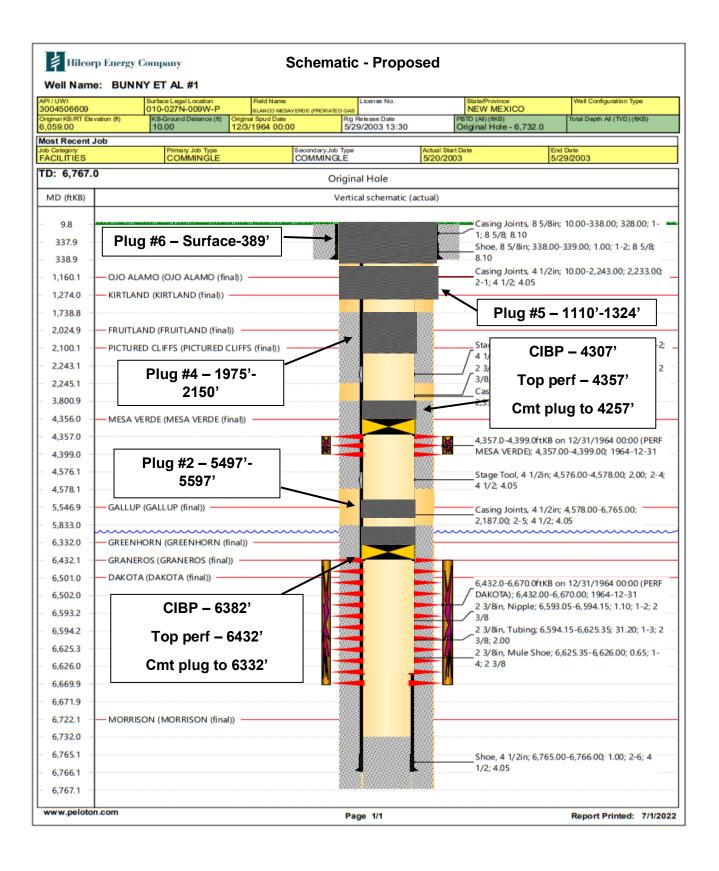

Hilcorp Energy
Final Reclamation Plan
Bunny ET AL 1
API: 30-045-06609
T27N-R9W-Sec.10-P

LAT: 36.58426 LONG: -107.77022 NAD 27 Footage: 1040' FSL & 1190' FEL San Juan County, NM

#### 1. PRE- RECLAMATION SITE INSPECTION

A pre-reclamation site inspection was completed with Roger Herrera from the BLM and Dale Crawford, Hilcorp Energy SJ South Construction Foreman, on July 11, 2022.

#### 2. LOCATION RECLAMATION PROCEDURE

- 1. Reclamation work will begin in the Fall.
- 2. All trash and debris will be removed within a 25' buffer outside of the location disturbance during reclamation.
- 3. Remove all production equipment. NOTE: This location does not have a BGT.
- 4. Enterprise to remove meter run and riser.
- 5. Remove cable concrete erosion control mats.
- 6. Pad is already on plane with surroundings so no pushback of fill slope is needed.
- 7. Reclaim area that is disturbed by the removal of equipment and mats.

#### 3. **SEEDING PROCEDURE**

- 1. A sagebrush grass mix will be used for all reclaimed and disturbed areas of the well pad.
- 2. Drill seed will be done where applicable and all other disturbed areas will be broadcast seeded and harrowed. Broadcast seeding will be applied at a double the rate of seed.
- 3. Timing of the seeding will be when the ground is not frozen or saturated.

#### 4. WEED MANAGEMENT

1. No action is required at this time for weed management, no noxious weeds were identified during this onsite.

# GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
  - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
  - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
  - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
  - 4.1 The cement shall be as specified in the approved plugging plan.
  - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.3 Surface plugs may be no less than 50' in length.
  - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
  - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
  - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
  - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
  - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
  - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
  - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
  - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
  - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain  $H_2S$ .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

(October 2012 Revision)

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2681520

Attachment to notice of Intention to Abandon

Well: Bunny et al 1

# **CONDITIONS OF APPROVAL**

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. The following modifications to your plugging program are to be made:
  - a. Add a plug to cover the top of the Mancos formation top at 4498'.
  - b. Add a plug to cover the top of the Cliff House (Mesaverde) formation top at 3632'.
  - c. Add a plug to cover the top of the Chacra formation top at 2620'.
  - d. Bring the top of proposed Plug #4 (Pictured Cliffs/Fruitland) up to 1830' to cover BLM pick for the Fruitland top.
- 3. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 7/21/2022

# BLM FLUID MINERALS P&A Geologic Report

**Date Completed:** 07/21/2022

Well No. Bunny et al #1 (API# 30-0	Location	1040	FSL	&	1190	FEL	
Lease No. I149IND8464	Sec. 10	T27	T27N		R09W		
Operator Hilcorp Energy Company		County	San J	San Juan		New Mexico	
Total Depth 6767'	PBTD 6732'	Formation	Dakota/Mesaverde				
Elevation (GL)	Elevation (KE	Elevation (KB) 6059'					

<b>Geologic Formations</b>	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose					
Nacimiento			Surface	1160	Surface/possible freshwater sands
Ojo Alamo Ss			1160	1278	Aquifer (possible freshwater)
Kirtland Shale			1278	1880	Possible gas
Fruitland			1880	2100	Coal/Gas/Water
Pictured Cliffs Ss			2100	2150	Probable Gas
Lewis Shale			2150	2620	
Chacra			2620	3632	Possible Gas
Cliff House Ss			3632	3720	Water/probable gas
Menefee			3720	4356	Coal/Ss/Water/probable gas
Point Lookout Ss			4356	4498	Probable water/O&G
Mancos Shale			4498	5547	Probable O&G
Gallup			5547	6332	Probable O&G
Greenhorn			6332	6382	
Graneros Shale			6382	6501	O&G
Dakota Ss			6501	6722	O&G/water
Morrison			6722	PBTD	

## Remarks:

#### P & A

- BLM picks for the Graneros, Mancos, Mesaverde (Cliff House), Chacra, and Fruitland formation tops vary from Operator.
- Add a plug to cover the top of the Mancos formation top at 4498'.
- Add a plug to cover the top of the Cliff House (Mesaverde) formation top at 3632'.
- Add a plug to cover the top of the Chacra formation top at 2620'.
- Bring the top of proposed Plug #4 (Pictured Cliffs/Fruitland) up to 1830' to cover BLM pick for the Fruitland top.
- The plugs proposed in the P&A procedure, with recommended changes, will adequately protect any freshwater sands in this well bore.
- Graneros/Dakota perfs 6432' 6670'.
- Mesaverde perfs 4357' 4399'.

Reference Well:
1) Formation Tops
Same

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 127971

#### **CONDITIONS**

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street	Action Number:
Houston, TX 77002	127971
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
kpickford	CBL required	7/27/2022
kpickford	Notify NMOCD 24 Hours Prior to beginning operations	7/27/2022
kpickford	Adhere to BLM approved COAs and plugs. See GEO report.	7/27/2022