Submit 1 Copy To Appropriate District Office <u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	State of New M Energy, Minerals and Nat OIL CONSERVATION 1220 South St. Fra Santa Fe, NM 8	ural Resources N DIVISION uncis Dr.	STA	NO. 10 Type <u>of</u> Lease	
(DO NOT USE THIS FORM FOR PROPOSADIFFERENT RESERVOIR. USE "APPLICAPROPOSALS.)		LUG BACK TO A	7. Lease Na Cooper Jal 8. Well Nur		eement Name
Name of Operator Legacy Reserves Operating LP Address of Operator				me or Wildcat	
15 Smith Road, Suite 3000, Midlan	d, TX 79705		Jalmat, T-Y	7-7R;Langlie M	attix; 7R-Q-G
4. Well Location Unit Letter O: Section 23	660 feet from the Township 24S Rai	S line and	1980 fe	et from the	E line Lea
	11. Elevation (Show whether DI 3334	R, RKB, RT, GR, etc.) ' GR			
12. Check Ap	propriate Box-to Indicate N	Nature of Notice,	Report or O	ther Data	
NOTICE OF INT		SUB:		REPORT O	F: G CASING

PERFORI TEMPORARILY ABANDON **CHANGE PLANS** COMMENCE DRILLING OPNS. ☐ P AND A MULTIPLE COMPL CASING/CEMENT JOB PULL OR ALTER CASING DOWNHOLE COMMINGLE **CLOSED-LOOP SYSTEM** П OTHER: OTHER:

- 13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.
- MIRU. ND Wellhead, NU BOP. Load w/ fluid to kill well.
- Set 7" CIBP @ 3350'. Spot 25 sx cmt @ 3350'-3200'. WOC & tag. (Queen)
- Set 7" CIBP @ 2900'. Circ w/ MLF & spot 25 sx cmt @ 2900'-2750'. WOC & tag. Pressure test casing. (Yates)
- Perf & Sqz 60 sx cmt @ 2740'-2570'. WOC & Tag (9 5/8" Shoe & B Salt)
- Perf & Sqz 100 sx cmt @ 1400'-1250'. WOC & Tag (T/Salt)
- Perf & Sqz 70 sx cmt @ 360'-260'. WOC & tag. (13 3/8" shoe)
- Spot 65 sx cmt from 200' to surface. 7.
- Cut off well head, verify cmt @ surface, weld on Dry Hole Marker.

4" Diam pud Date:	eter 4' tall above ground m	narker Rig Release Date:	***************************************	ched co	inditions of appr
hereby certify	that the information above is true ar	nd complete to the best	of my knowledge and belief.		
IGNATURE_	MIR	TITLE	Regulatory Tech	_DATE	9/1/22
ype or print no or State Use		E-mail address: _n	nreyes@legacyreserves.com_	PHONE:	(432)221-6358

Released to Imaging: 9/12/2022 7:12:26 AM

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County


SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

Legacy Rea	serves Operating C. Greene		CURRENT
Well Name	Cooper Jal Unit Jalmat, T-Y-7R, LM; 7R-Q-	Well No.	#237
Field/Pool	G	API #:	30-025-09610
County	Lea	Location:	Sec 23, T24S, R36E
State	NM		660' FSL & 1980' FEL
Spud Date	11/9/1934	GL:	3334'

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	13 3/8	J-55	54#	309'	15 1/2	130	circ
Inter Csg	9 5/8	J-55	36#	2789'	10 5/8	800	circ
Prod Csg (cut)	7	J-55	24#	1990'- 3400'	8 3/4	175	2335 (calc)

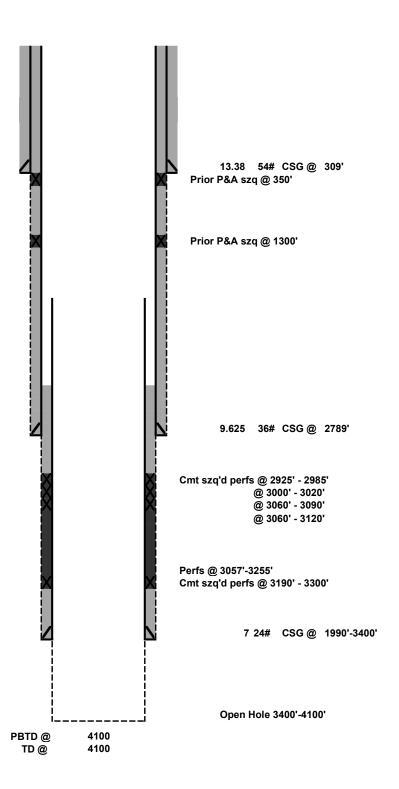


Formation	Тор
Anhydrite	1235
T Salt	1342
B Salt	2720
Yates	2940
7 Rivers	3150
Queen	3545
•	

32.19737625 -103.2337723

Legacy Re	serves Operating	PROPOSED		
Author:	C. Greene			
Well Name		Well No.	#237	
	Jalmat, T-Y-7R, LM; 7R-Q-			
Field/Pool	G	API #:	30-025-09610	
County	Lea	Location:	Sec 23, T24S, R36E	
State	NM		660' FSL & 1980' FEL	
Spud Date	11/9/1934	GL:	3334'	

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	TOC
Surface Csg	13 3/8	J-55	54#	309'	15 1/2	130	circ
Inter Csg	9 5/8	J-55	36#	2789'	10 5/8	800	circ
Prod Csg (cut)	7	J-55	24#	1990'- 3400'	8 3/4	175	2335 (calc)

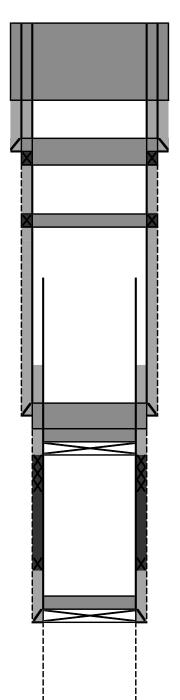

8. Cut off well head, verify cmt at surface, weld on dry hole marker.

7. Spot 65 sx cmt from 200' to surface.

13.38 54# CSG @ 309'

6. Perf and sqz 70 sx cmt @ 360'-260'. WOC & tag. (13 3/8" shoe)

5. Perf and sqz 100 sx cmt @ 1400'-1250'. WOC & tag. (T Salt)

Formation	Тор
Anhydrite	1235
T Salt	1342
B Salt	2720
Yates	2940
7 Rivers	3150
Queen	3545

9.625 36# CSG @ 2789'

- 4. Perf and sqz 60 sx cmt @2740'-2570'. WOC & tag. (9 5/8" shoe & B Salt)
- 3. Set 7" CIBP @ 2900'. Circ w/ MLF & spot 25 sx cmt @ 2900'-2750'. WOC & tag. Pressure test casing. (Yates)

32.19737625 -103.2337723

2. Set 7" CIBP @ 3350'. Spot 25 sx cmt @ 3350'-3200'. WOC & tag. (Queen)

7 24# CSG @ 1990'-3400'

1. MIRU. ND Wellhead, NU BOP. Load w/ fluid to kill well.

Open Hole 3400'-4100'

4100 4100

PBTD@

TD@

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 140227

COMMENTS

Operator:	OGRID:
LEGACY RESERVES OPERATING, LP	240974
15 Smith Road	Action Number:
Midland, TX 79705	140227
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Ī	Created By	Comment	Comment Date
	plmartinez	DATA ENTRY PM	9/12/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 140227

CONDITIONS

Operator:	OGRID:
LEGACY RESERVES OPERATING, LP	240974
15 Smith Road	Action Number:
Midland, TX 79705	140227
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
kfortner	See attached COA	9/6/2022