

Office	4 PM State of New M	lexico	Form <i>Page 1 of 1</i>
<u>District I</u> – (575) 393-6161	Energy, Minerals and Nat	tural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283	OH CONGERNATION	N DHUGION	WELL API NO. 30-025-37515
811 S. First St., Artesia, NM 88210	OIL CONSERVATION		5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fra		STATE FEE _
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, NM 8	37303	6. State Oil & Gas Lease No.
SUNDRY NOT	TICES AND REPORTS ON WELL		7. Lease Name or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPL	OSALS TO DRILL OR TO DEEPEN OR P ICATION FOR PERMIT" (FORM C-101)		JOSHUA STATE
PROPOSALS.) 1. Type of Well: Oil Well	Gas Well 🗹 Other		8. Well Number #001
Name of Operator OXY USA INC.	<u>=</u>		9. OGRID Number 16696
3. Address of Operator			10. Pool name or Wildcat
PO BOX 4294, HOUSTON	N. TX 77210		BAR-U; ATOKA (GAS)
4. Well Location			- (/
Unit Letter_J	: 1980 feet from the SOUTH		feet from the EAST line
Section 11	Township 9S	Range 32E	NMPM County LEA
	11. Elevation (Show whether D		
	4414'		
12 Charle	Annuanista Day to Indicata	Noting of Notice	Donart or Other Data
12. Check	Appropriate Box to Indicate 1	Nature of Notice,	Report of Other Data
NOTICE OF I	NTENTION TO:	SUB	SEQUENT REPORT OF:
PERFORM REMEDIAL WORK		REMEDIAL WOR	_
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DR	
PULL OR ALTER CASING DOWNHOLE COMMINGLE	-	CASING/CEMEN	
DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM]		Notify OCD 24 hrs. prior to any work
OTHER:		OTHER:	done
13. Describe proposed or com			d give pertinent dates, including estimated date
13. Describe proposed or com of starting any proposed v	ork). SEE RULE 19.15.7.14 NMA		d give pertinent dates, including estimated date mpletions: Attach wellbore diagram of
13. Describe proposed or com	ork). SEE RULE 19.15.7.14 NMA		
13. Describe proposed or com of starting any proposed v proposed completion or re	vork). SEE RULE 19.15.7.14 NMA completion.	AC. For Multiple Con	mpletions: Attach wellbore diagram of
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WE	AC. For Multiple Con	
13. Describe proposed or com of starting any proposed v proposed completion or re	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WE	AC. For Multiple Con	mpletions: Attach wellbore diagram of
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WE	AC. For Multiple Con	mpletions: Attach wellbore diagram of
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	york). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED.	C. For Multiple Con	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	york). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED.	AC. For Multiple Con	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED. SEE CH	AC. For Multiple Con	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED. SEE CH	C. For Multiple Con	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED. SEE CH	AC. For Multiple Con	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED. SEE CH	AC. For Multiple Con	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE PLUGGING PROCEDUR	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED. SEE CH	AC. For Multiple Control ANGES TO PROCE CBL to surface.	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE	Ork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WEE ARE ATTACHED. SEE CH	AC. For Multiple Control ANGES TO PROCE CBL to surface.	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE PLUGGING PROCEDUR	Cork). SEE RULE 19.15.7.14 NMA completion. QUESTS TO PA THE SUBJECT WE E ARE ATTACHED. SEE CH Run (ANGES TO PROCE CBL to surface. Date:	mpletions: Attach wellbore diagram of WELLBORE, PROPOSED WELLBORE, AND
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE PLUGGING PROCEDUR Spud Date:	COCA's****	AC. For Multiple Contact. ANGES TO PROCE CBL to surface. Oate: MUST BE	WELLBORE, PROPOSED WELLBORE, AND CEDURE PLUGGED BY 11/2/2023
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE PLUGGING PROCEDUR Spud Date: ****SEE ATTACHEI	COCA's****	AC. For Multiple Contact. ANGES TO PROCE CBL to surface. Oate: MUST BE	WELLBORE, PROPOSED WELLBORE, AND CEDURE PLUGGED BY 11/2/2023
13. Describe proposed or com of starting any proposed v proposed completion or re OXY RESPECTFULLY RE PLUGGING PROCEDUR Spud Date: ****SEE ATTACHEI	Rig Release D COA's**** n above is true and complete to the	AC. For Multiple Contact. ANGES TO PROCE CBL to surface. Oate: MUST BE	WELLBORE, PROPOSED WELLBORE, AND CEDURE PLUGGED BY 11/2/2023 ge and belief.
13. Describe proposed or composed of starting any proposed or proposed completion or responsed complet	Rig Release I COA's**** a above is true and complete to the COACEK TITLE REG	ANGES TO PROCE CBL to surface. MUST BE best of my knowledge	WELLBORE, PROPOSED WELLBORE, AND CEDURE PLUGGED BY 11/2/2023 ge and belief. EER DATE 9/22/2022
13. Describe proposed or composed of starting any proposed or proposed or completion or respectively. Spud Date: ****SEE ATTACHE! I hereby certify that the information of starting any proposed or completion or response of the proposed of the proposed or completion or response or completion or response of the proposed or completion or response or completion or response of the proposed or completion or response of the proposed or completion or response or completion or	Rig Release I COA's**** a above is true and complete to the COACEK TITLE REG	ANGES TO PROCE CBL to surface. MUST BE best of my knowledge	WELLBORE, PROPOSED WELLBORE, AND CEDURE PLUGGED BY 11/2/2023 ge and belief.
13. Describe proposed or composed of starting any proposed or proposed completion or responsed complet	Rig Release I COA's**** a above is true and complete to the COACEK TITLE REG	ANGES TO PROCE CBL to surface. MUST BE best of my knowledge	WELLBORE, PROPOSED WELLBORE, AND CEDURE PLUGGED BY 11/2/2023 ge and belief. EER DATE 9/22/2022 CEK@OXY.COM PHONE: 972-404-3722
13. Describe proposed or composed of starting any proposed or proposed or completion or respectively. Spud Date: ****SEE ATTACHE! I hereby certify that the information of starting any proposed or completion or response of the proposed of the proposed or completion or response or completion or response of the proposed or completion or response or completion or response of the proposed or completion or response of the proposed or completion or response or completion or	Rig Release I COA's**** a above is true and complete to the COACEK TITLE REG	ANGES TO PROCE CBL to surface. MUST BE best of my knowledge	WELLBORE, PROPOSED WELLBORE, AND CEDURE PLUGGED BY 11/2/2023 ge and belief. EER DATE 9/22/2022 CEK@OXY.COM PHONE: 972-404-3722

OXY USA WTP LP- Current Wellbore Joshua St 1 API No. 30-025-37515

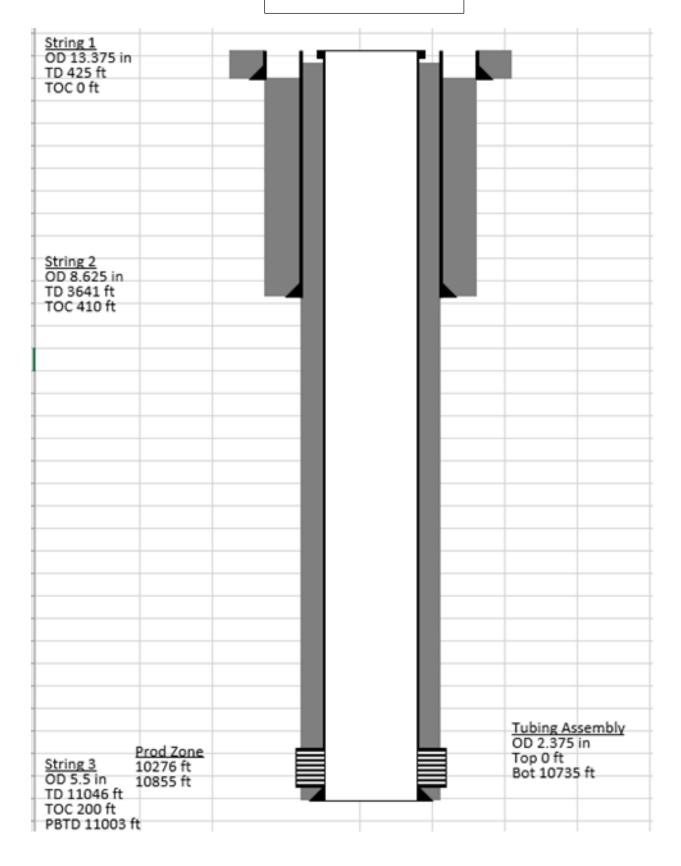

OXY USA WTP LP- Proposed Wellbore Joshua St 1

API No. 30-025-37515

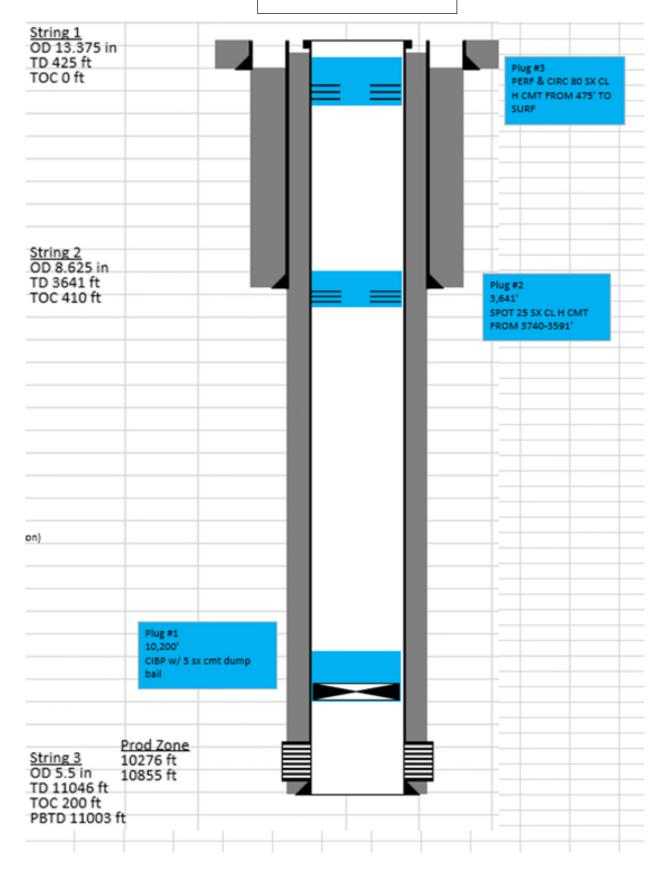

Run CBL to surface.

PA PROCEDURE

10# MLF BETWEEN PLUGS. UTILIZE ABOVE STEEL GROUND TANKS.

- 1. CIBP WITH 5 SX CMT DUMP AT 10200'. WOC AND TAG Test csg 500psi / 30 min
- 2. SPOT 25 SX CL C CMT 3740'-3591'. WOC AND TAG. Perf 3690' & attempt to circ cmt.
- 3. PERF AND CIRC 80 SX CL C CMT 475'-SURF'. WOC AND VERIFY TO SURF.

Spot 25 sx cl C cmt @ 9067' - T Cisco

Verify cmt to surface on all strings

Spot 25 sx cl C cmt @ 8543' - T Wolfcamp

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- A notice of intent to plug and abandon a wellbore is required to be approved before plugging
 operations are conducted. A cement evaluation tool is required in order to ensure isolation of
 producing formations, protection of water and correlative rights. A cement bond log or other
 accepted cement evaluation tool is to be provided to the division for evaluation if one has not
 been previously run or if the well did not have cement circulated to surface during the original
 casing cementing job or subsequent cementing jobs. Insure all bradenheads have been
 exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K)Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3.API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S - R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S - R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A-F. Sec 27 Unit A,B,C,F,G,H.

T 19S - R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S - R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S - R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S - R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S - R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S - R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S - R 30E

Sec 1 – Sec 36

T 21S - R 31E

Sec 1 – Sec 36

T 22S - R 28E

Sec 36 Unit A,H,I,P.

T 22S - R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S - R 30E

Sec 1 – Sec 36

T 22S - R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S - R 28E

Sec 1 Unit A

T 23S - R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S - R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S - R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S - R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S - R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S - R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 145680

COMMENTS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	145680
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Crea	ated By	Comment	Comment Date
pln	martinez	DATA ENTRY PM	11/2/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 145680

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	145680
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created I	y Condition	Condition Date
gcorde	None None	11/2/2022