
Office	To Appropriate 13 istrict	3:13 AM	State of New Me	exico			Form C-103 ¹ o
<u>District I</u> – (575	*	0.	Minerals and Natu	ıral Resources	WELL ADIA		sed July 18, 2013
1625 N. French District II – (57	Dr., Hobbs, NM 88240 5) 748-1283				WELL API N 30-025-0320		
811 S. First St.,	Artesia, NM 88210		ONSERVATION		5. Indicate T		
<u>District III</u> – (50 1000 Rio Brazo	95) 334-6178 s Rd., Aztec, NM 87410	0	20 South St. Fran		STAT		
<u>District IV</u> – (5 1220 S. St. Fran 87505	05) 476-3460 ncis Dr., Santa Fe, NM		Santa Fe, NM 8'	/303	6. State Oil 8	& Gas Lease No	١.
07303	SUNDRY NO	OTICES AND REI	PORTS ON WELLS	3	7. Lease Nan	ne or Unit Agre	ement Name
`	ESERVOIR. USE "AP		OR TO DEEPEN OR PL MIT" (FORM C-101) F				QUEEN UNIT
1. Type of V	Well: Oil Well 🗸	Gas Well	Other		8. Well Num	^{lber} 021	
2. Name of Breitburn O	perating LP				9. OGRID N 370080		
3. Address of	_	1000 11	TV 77000		10. Pool nam		
4. Well Loc	by Street Ste 1	600 Houston,	1X //002		[[49780] PI	EARL; QUE	.EN
	t Letter	. 1980 feet	from the South	line and 60	30 _{feet}	t from the Eas	st _{line}
	tion 23	400	wnship 35E R		NMPM	County	Lea
			(Show whether DR			,	
	12. Chec	ek Appropriate F	Box to Indicate N	lature of Notice	, Report or Ot	her Data	
	NOTICE OF	INTENTION 1	<u> </u>	l sui	BSEQUENT	REPORT O	ıE.
PERFORM F	REMEDIAL WORK			REMEDIAL WO	_		G CASING
TEMPORAR	ILY ABANDON	☐ CHANGE PL	ANS 🗆	COMMENCE DE	RILLING OPNS.	P AND A	
	TER CASING	☐ MULTIPLE C	OMPL	CASING/CEMEI	NT JOB	コーニー こうしゅん	
OTHER:	OF STSTEM			OTHER:			
			s. (Clearly state all				
prop	osed completion or	recompletion.	E 19.15.7.14 NMA	•	•		ıgram of
Surfa 1.32 <u>y</u>	ce - Mix, Spot, and SQZ rield Class "C" Cmt. WO	210' surface plug in the 4 C 4 hrs. Tag & Record.	4-1/2" & 4-1/2" x 8-5/8"	Csg Annulus f/ 210' - Sເ	rface w/ (13 bbls / 71	cuft / 54 sx)	
210' -	Perf 4-1/2" Csg 50' belo	w 8-5/8" Csg Shoe @ 21	0'. Attempt SQZ. Do not e	exceed 500 psi on SQZ.			
300' -	Mix, Spot & SQZ 100' pl	ug in the 4-1/2" & 4-1/2"	x 7-5/8" hole annulus f/ 4	00'-300' w/ (6.5 bbls / 3	5 cuft / 27 sx) 1.32 yiel	id Class "C" Cmt. W	OC 4 hrs. Tag & Record
400' -	Perf 4-1/2" casing @ 40	0' and attemp to SQZ Fr	eshwater Isolation Plug. [o not exceed 500 psi o	n SQZ.		
	- Mix, Spot & SQZ 100' I Record.	solation Plug in the 4-1/2	2" & 4-1/2" x 7-7/8" hole a	nnulus f/ 2,000' - 1,900'	w/ (6.5 bbls / 35 cu/ft	/ 27sx) 1.32 yield Cl	ass "C" Cmt. WOC 4 hr
_		00' and attempt to SQZ 1	00' Isolation Plug. Do not	exceed 500 psi on the	SQZ.		
330	6 Spot 25 sx Class C 33	306 WOC & tag	1/2" csg f/ 4,260'- 3,890' v	•		" cmt. WOC 4 hrs. T	ag & Record.
4260'	- Set CIBP above perfs (@4260'					
4" diame	ter 4' tall Above (Ground Marker			E ATTACHED	CONDITIONS	S
G 1D (D' D 1 D		APPROVAL		
Spud Date:	11-22-62		Rig Release Da	ate:			
					No	ote changes to	o procedure
I hereby certif	y that the informati	ion above is true ar	nd complete to the b	est of my knowled	ge and belief.		
). 1	,					
SIGNATURE	Nicole L	ee	TITLE Regu	llatory Analyst	,	_DATE_12/15	5/2022
Type or print	name Nicole Le	е	E-mail addres	s:		PHONE: 713	3-437-8050
For State Use	e Only					·—•	
V DDD OAED	DV. YAAAA	Forther	└ TITLE Com	pliance Officer	Δ	DATE 1/23/2	23
APPROVED Conditions of	Approval (if any)	,,,,,,,,		263-6633	•	DATE 112012	<u> </u>
			71 / Ta	z (), 1=()(), 3, 3			

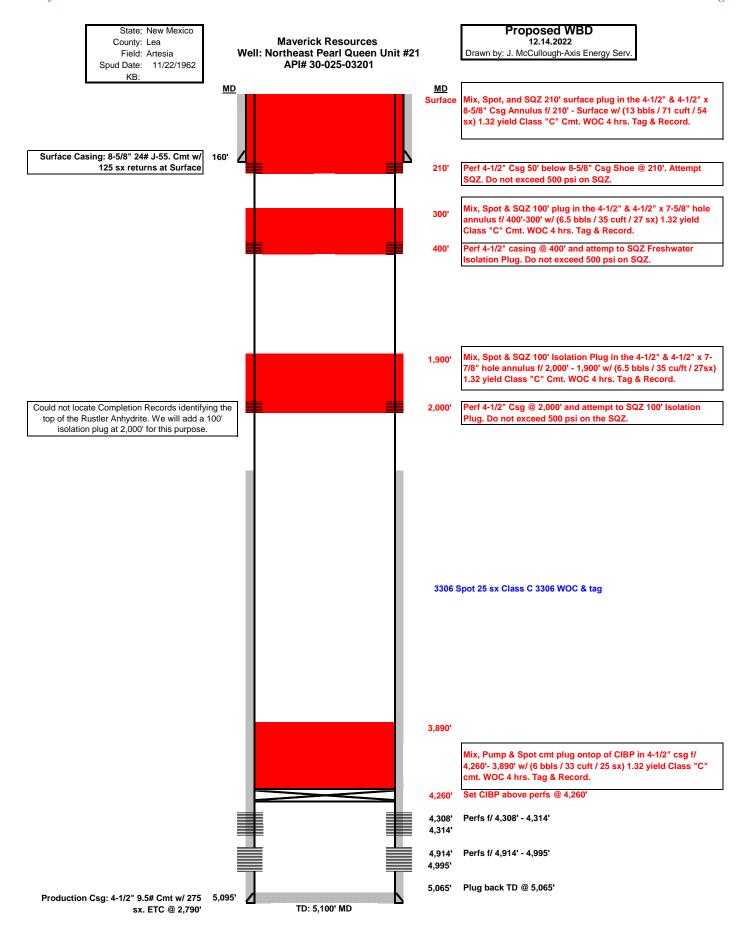

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS


The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

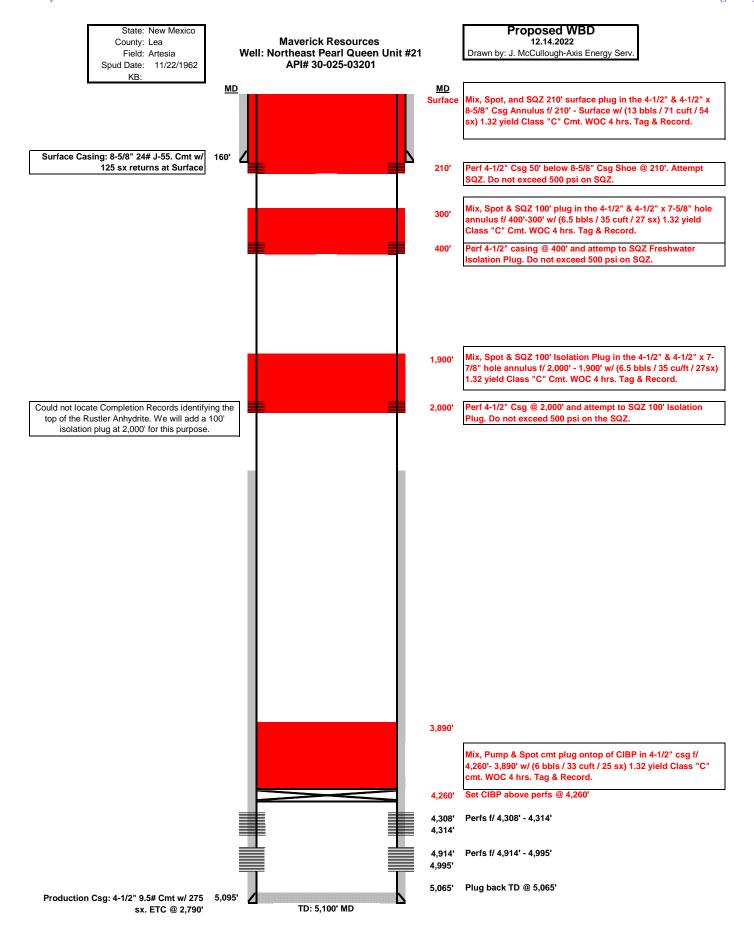

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 167304

COMMENTS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1111 Bagby St. Suite 1600	Action Number:
Houston, TX 77002	167304
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
plmartine	z DATA ENTRY PM	1/23/2023

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 167304

CONDITIONS

Operator:	OGRID:
BREITBURN OPERATING LP	370080
1111 Bagby St. Suite 1600	Action Number:
Houston, TX 77002	167304
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
kfortner	See attached COA Note changes to procedure	1/23/2023