Office	State of New Mexic	:0	Form C <sup>P</sup> 42631 C	
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	rgy, Minerals and Natural	Resources	Revised July 18, 2013 WELL API NO.	
District II - (575) 748-1283	OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505		30-025-42377	
811 S. First St., Artesia, NM 88210 <u>District III</u> – (505) 334-6178			<ul> <li>5. Indicate Type of Lease</li> <li>STATE   FEE  </li> <li>6. State Oil &amp; Gas Lease No.</li> </ul>	
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460				
1220 S. St. Francis Dr., Santa Fe, NM 87505		_	o. State On & Gas Lease 110.	
SUNDRY NOTICES AND			7. Lease Name or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DI DIFFERENT RESERVOIR. USE "APPLICATION FO		UCH	Iggles State Com	
PROPOSALS.) 1. Type of Well, $O(1 Well, \nabla C = C = Well$	C Other		8. Well Number #1H	
1. Type of Well: Oil Well ⊠ Gas Well         2. Name of Operator	Other		9. OGRID Number	
COG Operating, LLC			229137	
<ol> <li>Address of Operator</li> <li>2208 W. Main Street Artesia, NM 88210</li> </ol>			<ol> <li>Pool name or Wildcat</li> <li>Vacuum, Bone Spring, West</li> </ol>	
4. Well Location			Vacuum, Done Spring, West	
	feet from theSlin	e and350	feet from theWline	
Section 21 Towns			IPM County Lea	
	vation (Show whether DR, RK			
	4040' GF	R		
	ate Box to Indicate Natu			
			EQUENT REPORT OF:	
		EMEDIAL WORK OMMENCE DRIL		
		ASING/CEMENT		
CLOSED-LOOP SYSTEM			_	
CLOSED-LOOP SYSTEM		THER:	give pertinent dates including estimated date	
CLOSED-LOOP SYSTEM	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F	inent details, and	give pertinent dates, including estimated date pletions: Attach wellbore diagram of	
CLOSED-LOOP SYSTEM DTHER: 13. Describe proposed or completed operation of starting any proposed work). SEE proposed completion or recompletion	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F	inent details, and For Multiple Com	pletions: Attach wellbore diagram of	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F  v/ MLF. Pressure test csg. S	inent details, and For Multiple Com	pletions: Attach wellbore diagram of	
CLOSED-LOOP SYSTEM D OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F  v/ MLF. Pressure test csg. S 5'. (Brushy)	inent details, and For Multiple Com <b>pot 25 sx class C</b>	pletions: Attach wellbore diagram of	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed operation of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166' 4. Perf & Sqz 50 sx class C cmt @ 211	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa	inent details, and For Multiple Com pot 25 sx class C & B/Salt)	pletions: Attach wellbore diagram of	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface.	For Multiple Comp pot 25 sx class C & B/Salt) alt)	pletions: Attach wellbore diagram of	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed operation of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166' 4. Perf & Sqz 50 sx class C cmt @ 211	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface.	For Multiple Comp pot 25 sx class C & B/Salt) alt)	pletions: Attach wellbore diagram of cmt @ 9331-9130'.	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166' 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur 6. Cut off wellhead, verify cmt @ surf	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe .2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma	For Multiple Com For Multiple Com Foot 25 sx class C & B/Salt) alt) rker.	pletions: Attach wellbore diagram of	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe .2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma	For Multiple Com For Multiple Com Foot 25 sx class C & B/Salt) alt) rker.	pletions: Attach wellbore diagram of cmt @ 9331-9130'.	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur 6. Cut off wellhead, verify cmt @ surf LPC Area Below ground marker send	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face. face, Weld on Dry Hole Ma pics before backfilling ho	For Multiple Com For Multiple Com Foot 25 sx class C & B/Salt) alt) rker.	pletions: Attach wellbore diagram of cmt @ 9331-9130'.	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166' 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur 6. Cut off wellhead, verify cmt @ surf	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe .2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma	For Multiple Com For Multiple Com Foot 25 sx class C & B/Salt) alt) rker.	pletions: Attach wellbore diagram of cmt @ 9331-9130'.	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur 6. Cut off wellhead, verify cmt @ surf LPC Area Below ground marker send	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face. face, Weld on Dry Hole Ma pics before backfilling ho	For Multiple Com For Multiple Com Foot 25 sx class C & B/Salt) alt) rker.	pletions: Attach wellbore diagram of cmt @ 9331-9130'.	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed operation of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole with the set of the set o	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma pics before backfilling ho Rig Release Date:	inent details, and For Multiple Com pot 25 sx class C & B/Salt) alt) rker.	SEE ATTACHED CONDITIONS OF APPROVAL	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur 6. Cut off wellhead, verify cmt @ surf LPC Area Below ground marker send	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma pics before backfilling ho Rig Release Date:	inent details, and For Multiple Com pot 25 sx class C & B/Salt) alt) rker.	SEE ATTACHED CONDITIONS OF APPROVAL	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed operations of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole with the set of the set	ations. (Clearly state all pert RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma pics before backfilling ho Rig Release Date:	inent details, and For Multiple Com <b>pot 25 sx class C</b> & <b>B/Salt</b> ) alt) rker.	e cmt @ 9331-9130'. SEE ATTACHED CONDITIONS OF APPROVAL and belief.	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur 6. Cut off wellhead, verify cmt @ surf LPC Area Below ground marker send Spud Date:	ations. (Clearly state all pert: RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma pics before backfilling hc Rig Release Date: rue and complete to the best of TITLE	inent details, and For Multiple Com Spot 25 sx class C & B/Salt) alt) rker.	e cmt @ 9331-9130'. SEE ATTACHED CONDITIONS OF APPROVAL and belief.	
CLOSED-LOOP SYSTEM       □         13. Describe proposed or completed operation of starting any proposed work). SEE proposed completion or recompletion         1. Set 5 1/2 CIBP @ 9331'. Circ hole w         2. Spot 25 sx class C cmt @ 6315-6115         3. Perf & Sqz 60 Sx cmt @ 3460-3166         4. Perf & Sqz 50 sx class C cmt @ 211         5. Spot 25 sx class C cmt @ 200' to sure         6. Cut off wellhead, verify cmt @ sure         LPC Area Below ground marker send         Spud Date:         I hereby certify that the information above is the structure         SIGNATURE Ruth Shockency         Type or print name Ruth Shockency         For State Use Only	ations. (Clearly state all pert: RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma pics before backfilling hc Rig Release Date: rue and complete to the best of TITLE	inent details, and For Multiple Com Spot 25 sx class C & B/Salt) alt) rker.	ecmt @ 9331-9130'. SEE ATTACHED CONDITIONS OF APPROVAL and belief. atorDATE_1/17/2023 percent diagram of the second	
CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or completed opera of starting any proposed work). SEE proposed completion or recompletion 1. Set 5 1/2 CIBP @ 9331'. Circ hole w 2. Spot 25 sx class C cmt @ 6315-6115 3. Perf & Sqz 60 Sx cmt @ 3460-3166' 4. Perf & Sqz 50 sx class C cmt @ 211 5. Spot 25 sx class C cmt @ 200' to sur 6. Cut off wellhead, verify cmt @ surf LPC Area Below ground marker send Spud Date: I hereby certify that the information above is the SIGNATURE Ruth Shockency Fype or print name Ruth Shockency	ations. (Clearly state all pert: RULE 19.15.7.14 NMAC. F v/ MLF. Pressure test csg. S 5'. (Brushy) '. WOC & Tag (9 5/8'' Shoe 2-1844'. WOC & Tag (T/Sa rface. face, Weld on Dry Hole Ma pics before backfilling hc Rig Release Date: rue and complete to the best of TITLE	inent details, and For Multiple Com Spot 25 sx class C & B/Salt) alt) rker.	Pletions: Attach wellbore diagram of         cmt @ 9331-9130'.         SEE ATTACHED CONDITIONS OF APPROVAL         and belief.         and belief.         DATE_1/17/2023	

•

## CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

### Company representative will be on location during plugging procedures.

**1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.

**2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.

**3.** Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.

4. Filing a subsequent C-103 will serve as notification that the well has been plugged.

**5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.

**6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.

7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.

8. Produced water will not be used during any part of the plugging operation.

9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.

**10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.

11. Class 'C' cement will be used above 7500 feet.

12. Class 'H' cement will be used below 7500 feet.

**13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged

**14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

**16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set

17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.

**18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.

20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops

- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.

#### K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS


The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:


- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

#### SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS


In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

# SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

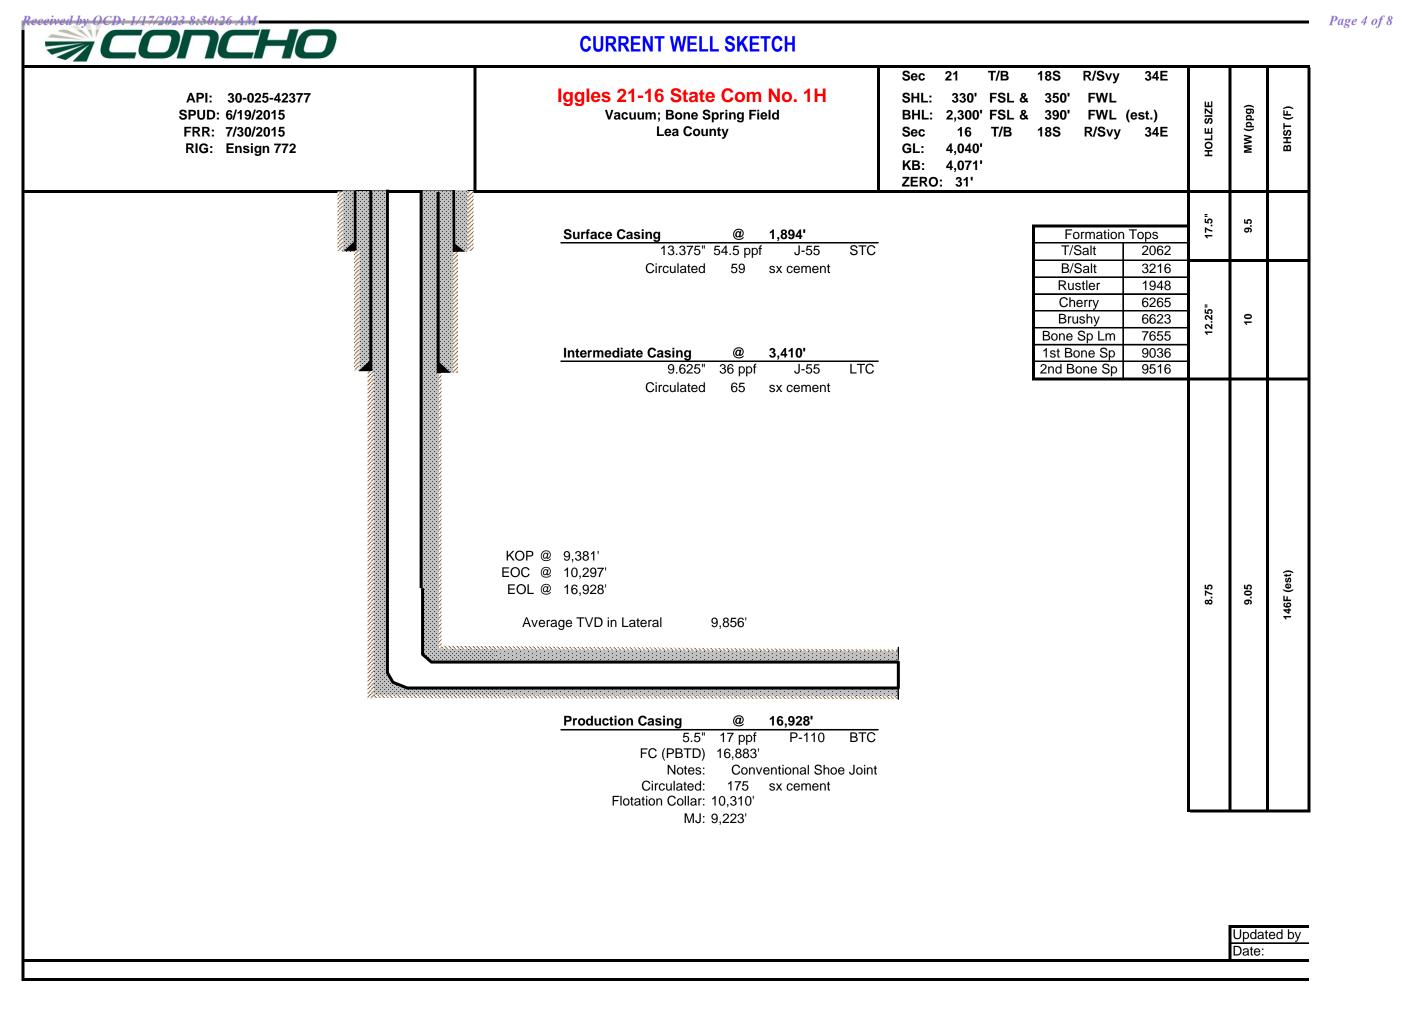

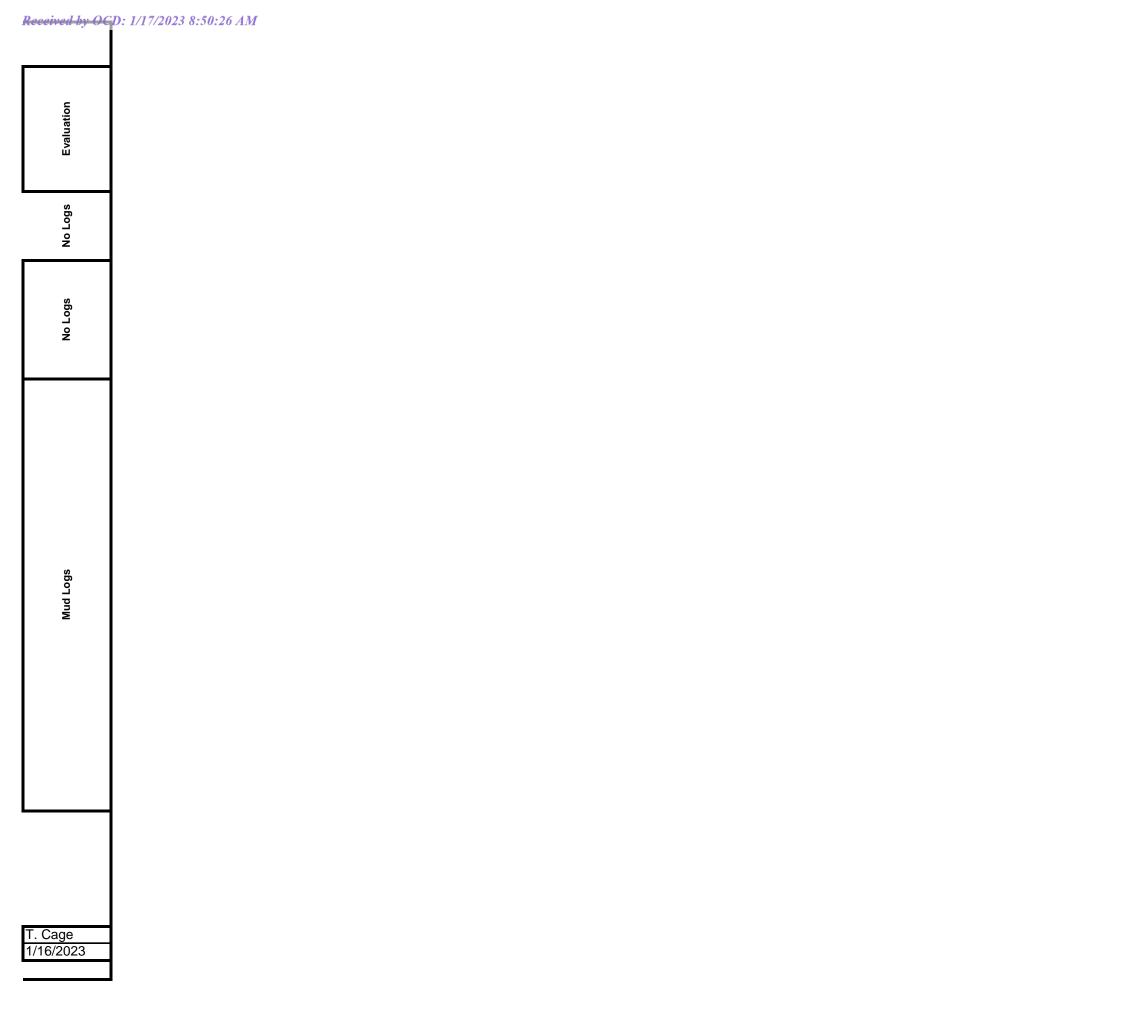

•

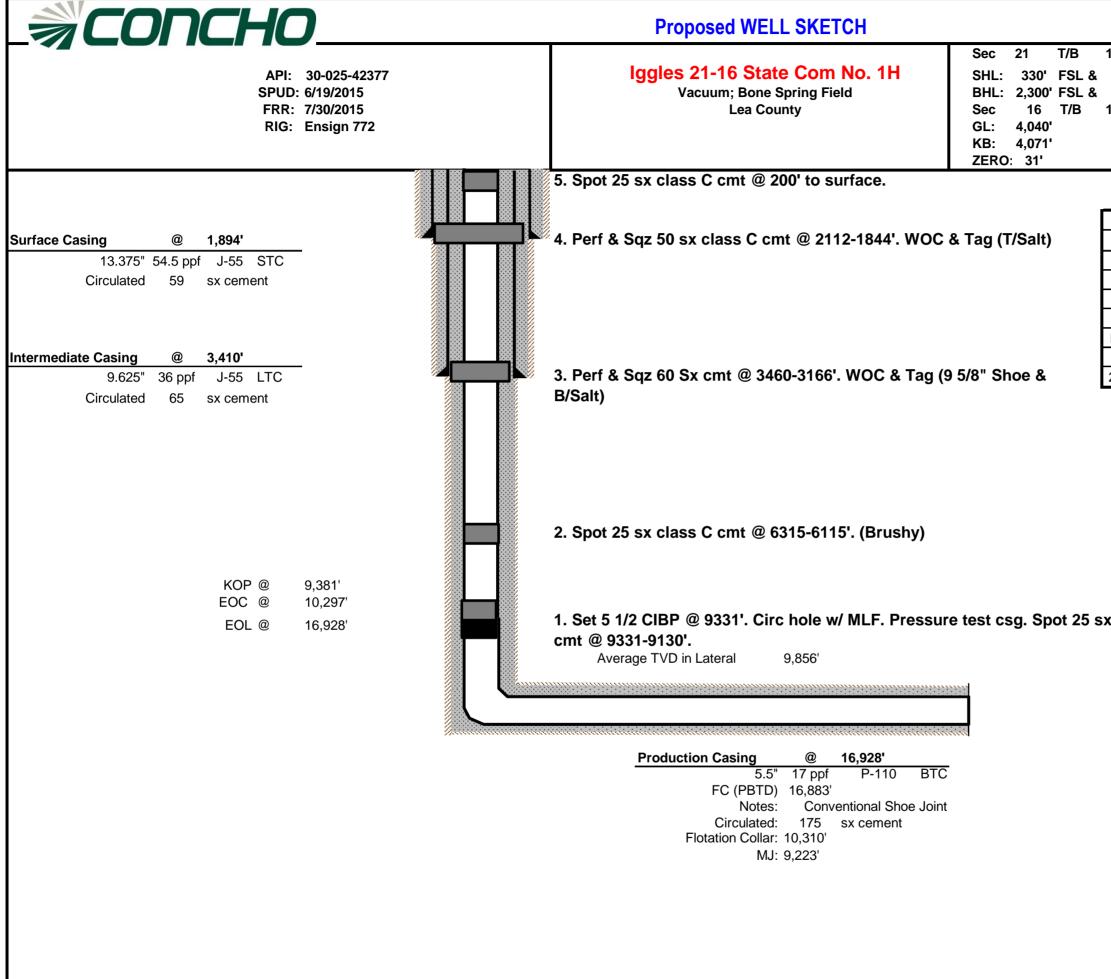

18S R/Svy 350' FWL 390' FWL 18S R/Svy	(est.)	HOLE SIZE	(6dd) MW	BHST (F)	Evaluation
Formation T/Salt	Tops 2062	17.5"	9.5		No Logs
B/Salt Rustler Cherry Brushy Bone Sp Lm 1st Bone Sp 2nd Bone Sp	3216 1948 6265 6623 7655 9036 9516	12.25"	10		No Logs
sx class C		8.75	9.05	146F (est)	Mud Logs
			Updat Date:	ted by	T. Cage 1/16/2023

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

COMMENTS

	OGRID:
COG OPERATING LLC	229137
600 W Illinois Ave	Action Number:
Midland, TX 79701	176549
A	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)
COMMENTS	

Created By		Comment
		Date
plmartinez	DATA ENTRY PM	1/31/2023

COMMENTS

Action 176549

Page 7 of 8

.

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
COG OPERATING LLC	229137
600 W Illinois Ave	Action Number:
Midland, TX 79701	176549
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)
	-

#### CONDITIONS

Created By		Condition Date
kfortner	See attached COA	1/31/2023

Page 8 of 8

.

Action 176549