	State of New Mexico	Form C-103
Office District I – (575) 393-6161 Enc	ergy, Minerals and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240		WELL API NO.
District II – (575) 748-1283 811 S. First St., Artesia, NM 88210	IL CONSERVATION DIVISION	30-025-05542
<u>District III</u> – (505) 334-6178	1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd., Aztec, NM 87410	Santa Fe, NM 87505	STATE FEE 6. State Oil & Gas Lease No.
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa 1 6, 1 (1) 6 7 5 6 5	
87505		19520
	D REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO I DIFFERENT RESERVOIR. USE "APPLICATION FO		North Hobbs G/SA Unit
PROPOSALS.) 1. Type of Well: Oil Well Gas Wel	1 Other Injection	8. Well Number 211
2. Name of Operator	T Guidi injection	9. OGRID Number
Occidental Permian LTD		157984
3. Address of Operator		10. Pool name or Wildcat
P.O. Box 4294 Houston, TX 77210-42	94	HOBBS; GRAYBURG-SAN ANDRES
4. Well Location		
Unit Letter C: 330	feet from the NORTH line and	2310 feet from the WEST line
Section 36	Township 18S Range 37E	NMPM County LEA
11. Ele	vation (Show whether DR, RKB, RT, GR, etc.	.)
3670'	(GL)	
12. Check Appropr	iate Box to Indicate Nature of Notice,	Report or Other Data
NOTICE OF INTENT	ON TO:	SCEOUENT DEDORT OF
NOTICE OF INTENTI PERFORM REMEDIAL WORK ☐ PLUG	ON TO: SUE AND ABANDON □ REMEDIAL WOF	SSEQUENT REPORT OF: RK □ ALTERING CASING □
	<u> </u>	ILLING OPNS. P AND A
	PLE COMPL CASING/CEMEN	
DOWNHOLE COMMINGLE	TEL GOIVILE GOAGIIVO/GEIVIEIV	11 30B
CLOSED-LOOP SYSTEM		
OTHER:	□ OTHER:	П
	rations. (Clearly state all pertinent details, an	ad give pertinent dates, including estimated date
13. Describe proposed or completed ope		
		mpletions: Attach wellbore diagram of
	E RULE 19.15.7.14 NMAC. For Multiple Co	empletions: Attach wellbore diagram of
of starting any proposed work). SEE	E RULE 19.15.7.14 NMAC. For Multiple Co	empletions: Attach wellbore diagram of
of starting any proposed work). SEE	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA	E RULE 19.15.7.14 NMAC. For Multiple Con. wellbore attached.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion	E RULE 19.15.7.14 NMAC. For Multiple Con.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA	E RULE 19.15.7.14 NMAC. For Multiple Con. wellbore attached.	empletions: Attach wellbore diagram of
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA. Spud Date:	Rig Release Date:	
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA	Rig Release Date:	
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA. Spud Date: I hereby certify that the information above is a second completion or recompletion.	Rig Release Date: Rig Release Date:	ge and belief.
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA. Spud Date:	Rig Release Date:	
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA. Spud Date: I hereby certify that the information above is a signature. Romi Mathew.	Rig Release Date: TITLE Regulatory Advisor	ge and belief. DATE 06/20/2023
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA. Spud Date: I hereby certify that the information above is a signature. SIGNATURE Roni Mathew. Type or print name Roni Mathew.	Rig Release Date: Rig Release Date:	ge and belief. DATE 06/20/2023
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA. Spud Date: I hereby certify that the information above is a SIGNATURE. Romi Mathew.	Rig Release Date: TITLE Regulatory Advisor	ge and belief. DATE 06/20/2023
of starting any proposed work). SEE proposed completion or recompletion. See performed PxA procedure and final PxA. Spud Date: I hereby certify that the information above is a signature. SIGNATURE Roni Mathew. Type or print name Roni Mathew.	Rig Release Date: TITLE Regulatory Advisor	ge and belief. DATE_06/20/2023 @oxy.com PHONE: (713) 215-7827

Daily Log

06/08/2023: Crew HTGSM. Spot in pulling unit & rig up. Rig up all plugging equipment. Function Test BOPE. 0 PSI on TBG & CSG. ND WH & NU BOPE. Lay down 100 Jts of 2-7/8 production TBG. Install TIW Valve. Close BOPE & Lock Pins. Close all valves. SION


06/09/2023: Crew HTGSM. 0 PSI on TBG & CSG. Cont to lay down 31 JTs of Production TBG & PKR. Remove production tbg float. Spot in WS Float. Change out TBG Rams. R/U Wireline. RIH w/ 5-1/2 CIBP & Set @ 4140' POOH w/ Wireline & rig down. Pick up 130 Jts of WS TBG & Tag CIBP @ 4140'. Circulated well w/ 120 BBIs of 10# Salt Gel. Spot 13 BBLs (55 sxs) of Class C CMT & Displaced down to 3706' w/ 14 BBLs. Lay down 15 JTs of TBG. POOH w/ 50 JTs of TBG. Install TIW Valve. Close BOPE & Lock Pins. Close all Valves. Secure Location. SION

06/12/2023: Htgsm, Check psi, 0 psi, Rih w 112 2-7/8" tbg, Tagged TOC @3590', Notified NMOCD, Pooh w 112 2-3/8" tbg, Rih w 5-1/2" packer and 2-3/8" tbg, Isolated csg 30' from surface, Rih w 5-1/2" packer and 72 2-3/8" tbg, Set packer @2307', Ruwl, Rih and perforated 5-1/2" csg @2920', Pooh and rdwl, Pressured up to 1500 psi, No injection rate, Notified NMOCD, Released packer, Rih w 21 2-3/8" tbg, EOT @2983', Mixed and pumped 25 sxs class c cmt and displaced w 10.6 bbls of gelled bw, TOC @2743', Pooh laying down 7 2-3/8" tbg, Pooh w 50 2-3/8" tbg to derrick, Sion.

06/13/2022: Crew HTGSM. 0 PSI on TBG & CSG. RIH w/ TBG & Tag CMT Plug @ 2797'. LAy down 56 JTso f TBG to 952'. Rig up Wireline. RIH w/ Perf Gun. Perforate CSG @ 1660'. POOH w/ Wireline & Rig down. Est Injection Rate @ 1.5 BPM @ 600 PSI. Squeeze 14.5 BBLs (60 sxs) of Class C CMT & Displaced down to 1550' w/ 12 BBLs. Wait on CMT. RIH w/ TBG & Tag CMT Plug @ 1526'. Lay down 46 JTs of WS TBG. Rig up Wireline. RIH w/ 3-1/8" Perf Gun. Perf CSG @ 484'. POOH w/ Wireline. RIH w/ 10 JTs & AD1 PKR. Est Injection Rate & Circulated through Surface. Close BOPE & Lock Pins. Close all Valves. Secure Location

06/14/2023: Crew HTGSM. 0 PSI on TBG & CSG. Est Injection Rate. Circulated 71 BBLs (295 sxs) of Class C CMT & Circulated to surface. Release PKR & Circulated CMT through CSG. Lay down 10 JTs of TBG & AD1 PKR. ND BOPE. Rig down Pulling Unit. Top off wellbore. Rig down all plugging equipment. Clean up location. Well is Plugged.

FINAL P&A WBD

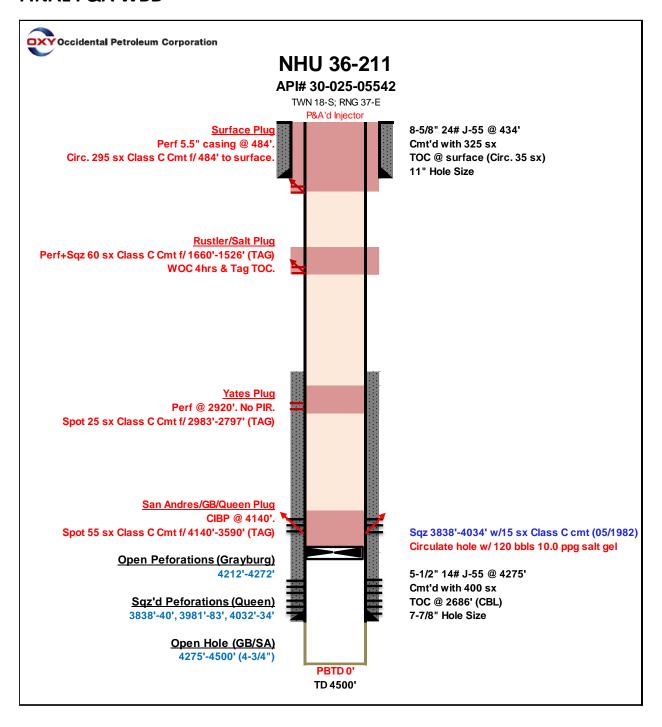

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 230621

CONDITIONS

Operator:	OGRID:
OCCIDENTAL PERMIAN LTD	157984
P.O. Box 4294	Action Number:
Houston, TX 772104294	230621
	Action Type:
	[C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By		Condition Date
john.harrison	None - Well P&A'd 6/14/23	7/3/2023